

General Information

Date & Time: 09, Jun, 2026 14:12

Make	Toyota	Model	Wigo
YOM	2025	Odo Meter Reading	10,603
Registration No.	GBK5162	Chassis No.	MHKAA1BC6SJ040486
CC	1.0	Transmission	CVT
Fuel Type	Gas	Type of Body	Hatchback
Colour	Gray		

Body / Panel Condition



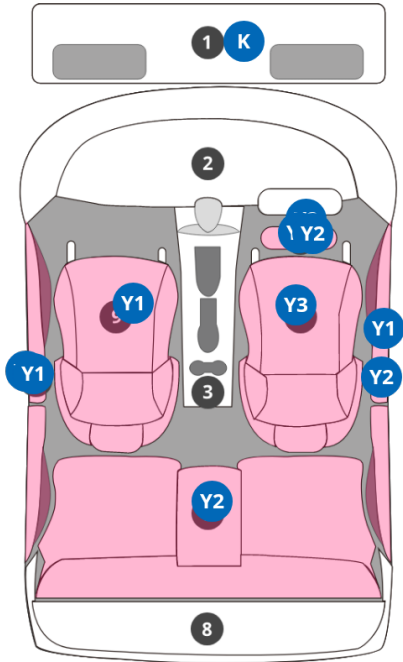
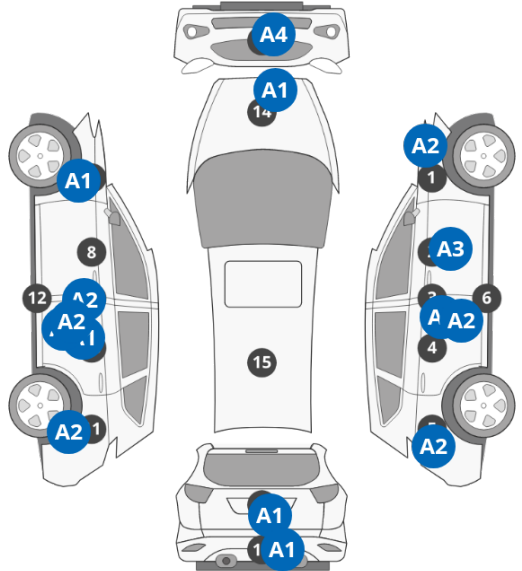
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	127.0	127	125	129
2	Boot Lid	111.0	107	113	113
3	Roof	100.4	100	100	97/105
4	Left Front Fender	110.3	111	106	114
5	Left Front Door	116.3	111	111	127
6	Center Panel Left				
7	Left Rear Door	111.0	120	112	101
8	Left Back Panel	104.0	99	100	113
9	Right Front Fender	116.0	121	115	112
10	Right Front Door	108.3	110	114	101
11	Center Panel Right				
12	Right Rear Door	123.0	119	128	122
13	Right Back Panel	106.0	112	105	101

Overall Evaluation :

B

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : D
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Mat Other - Grime - Small / Overall Interior - Animal Hair - Yes / (R) Rear Trim - Grime - Small / Rear Seat - Grime - Small / (R) Front Trim - Grime - Minimal / (R) Front Floor Mat - Grime - Small / (R) Front Seat - Grime - Medium / (L) Rear Trim - Grime - Minimal / (L) Front Trim - Grime - Minimal / (L) Front Seat - Grime - Minimal / (L) Front Floor Mat - Grime - Small	Remarks (L) Front Fender, Molding - Scratch - Minimal / Front Bumper, Grille, Lamps - Scratch - Large / Bonnet, Headlight - Scratch - Minimal / (R) Front Fender, Molding - Scratch - Small / (R) Front Door, Molding - Scratch - Medium / (R) Rear Door, Molding - Scratch - Medium / (R) Step, In-panel, Side Spoiler - Scratch - Small / (R) Rear Fender, Molding - Scratch - Small / Trunk Hood, Rear Gate - Scratch - Minimal / Rear Bumper, Lamps, Panels - Scratch - Minimal / (L) Rear Fender, Molding - Scratch - Small / (L) Rear Door, Molding - Scratch - Minimal / (L) Front Door, Molding - Scratch - Small / (L) Mirror - Scratch - Medium / (L) Step, In-panel, Side Spoiler - Scratch - Small
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Defects not found

Inspector Notes

Minimal scratch at left headlight. Incomplete tools. With warranty booklet, seatcover, sparetire, jack, LTO Plate and 2keys.