

General Information

Date & Time: 22, Feb, 2025 10:37

Make	Toyota	Model	Vios
YOM	2024	Mileage	8,695
Registration No.	NHM1466	Chassis No.	PA1B18F38P4234268
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Red Mica Metallic		

Body / Panel Condition



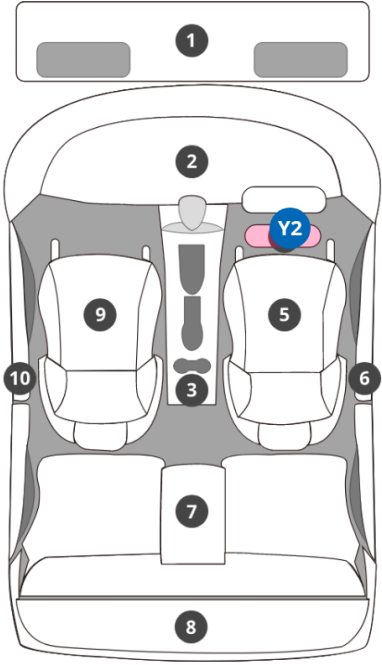
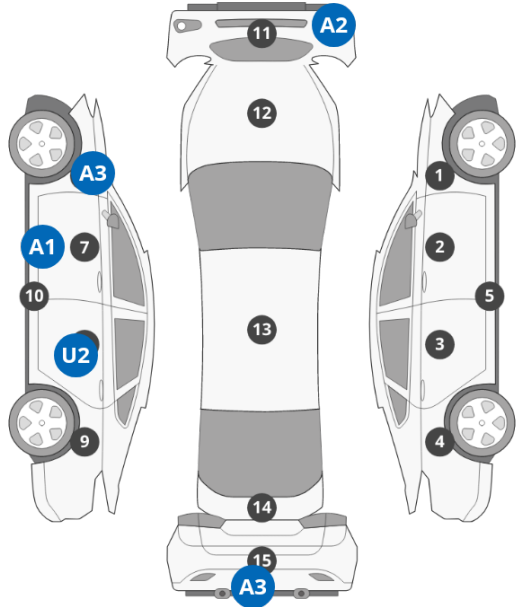
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	248.6	253	257	236
2	Boot Lid	108.0	101	110	113
3	Roof	96.0	96	96	93/99
4	Left Front Fender	167.3	157	181	164
5	Left Front Door	100.2	101	98	102
6	Center Panel Left				
7	Left Rear Door	106.3	110	106	103
8	Left Back Panel	105.4	113	106	97
9	Right Front Fender	105.3	110	105	101
10	Right Front Door	103.2	110	99	101
11	Center Panel Right				
12	Right Rear Door	102.3	103	98	106
13	Right Back Panel	106.7	94	106	120

Overall Evaluation :

A

Disclaimer

This Grading Report is intended to record the general appearance and condition of the interior, exterior & frame of the vehicle. This is not a detailed inspection report. This is issued on the date and time given herein and the company shall not be liable for the condition of the vehicle after this date and time. Any disputes regarding this report shall not be grounds for arbitration.

Interior Evaluation : A	Exterior Evaluation : B
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks (L) Front Floor Mat - Grime - Small	Remarks (R) Front Fender - Repair Traces - Yes / Bonnet - Repair Traces - Yes / (L) Front Fender - Repair Traces - Yes / (L) Front Fender, Molding - Scratch - Medium / Front Bumper, Grille, Lamps - Scratch - Small / Rear Bumper, Lamps, Panels - Scratch - Medium / (L) Step, In-panel, Side Spoiler - Scratch - Minimal / (L) Rear Door, Molding - Dent - Small
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Reverse Camera - N/A - Yes

Inspector Notes

with LTO plate/without spare tire/jack and tools/No warranty booklet