

General Information

Date & Time: 11, Jun, 2026 10:29

Make	Toyota	Model	Hilux Tamaraw
YOM	2025	Odo Meter Reading	11,306
Registration No.	GBB3644	Chassis No.	PAHAD9DAXS1628442
CC	2.4	Transmission	A/T
Fuel Type	Diesel	Type of Body	Dropside
Colour	Black		

Body / Panel Condition



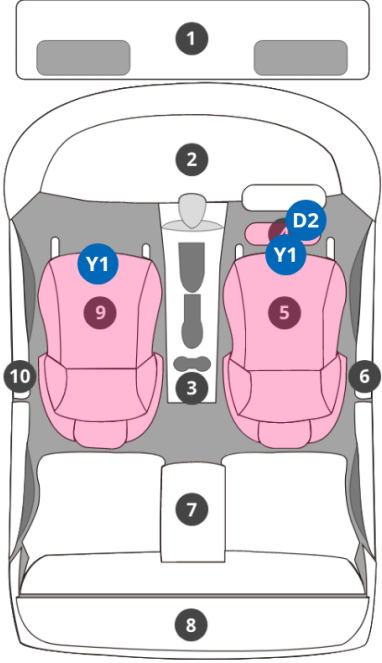
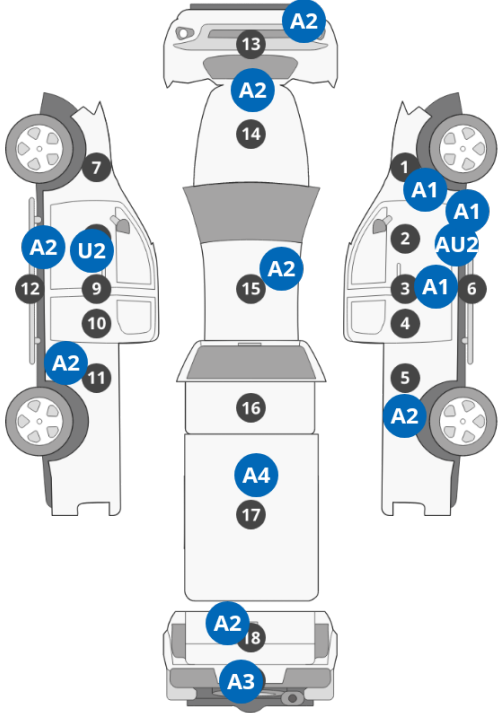
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	88.8	84	96	86
2	Boot Lid	61.7	67	62	56
3	Roof	94.6	100	96	93/90
4	Left Front Fender	97.6	93	100	100
5	Left Front Door	88.8	93	88	86
6	Center Panel Left				
7	Left Rear Door				
8	Left Back Panel	69.7	69	71	69
9	Right Front Fender	105.6	112	112	93
10	Right Front Door	93.1	90	94	96
11	Center Panel Right				
12	Right Rear Door				
13	Right Back Panel	61.0	64	68	51

Overall Evaluation :

A

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : A	Exterior Evaluation : C
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks (L) Front Seat - Grime - Minimal / (R) Front Seat - Grime - Minimal / (L) Front Floor Mat - Worked - Small	Remarks (R) Front Fender, Molding - Scratch - Minimal / (R) Front Door, Molding - Scratch & Dent - Small / (R) Center Panel - Scratch - Minimal / (R) Step, In-panel, Side Spoiler - Scratch - Minimal / (R) Side Gate - Scratch - Small / Rear Bumper, Lamps, Panels - Scratch - Medium / Rear Gate - Scratch - Small / Cargo Bed Floor - Scratch - Large / (L) Side Gate - Scratch - Small / (L) Front Door, Molding - Dent - Small / (L) Step, In-panel, Side Spoiler - Scratch - Small / Front Bumper, Grille, Lamps - Scratch - Small / Bonnet, Headlight - Scratch - Small / Roof - Scratch - Small
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Reverse Camera - N/A - Yes / Spare Key - Issue - Unexist

Inspector Notes
no lto plate, with warranty booklet, with spare tire, no tools and jack, no spare key, no reverse camera, hairline scratches in the body