

General Information

Date & Time: 10, Jun, 2026 07:27

Make	Toyota	Model	Vios
YOM	2023	Odo Meter Reading	1
Registration No.	CCA2151	Chassis No.	PA1B18F3XP4224020
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Red		

Body / Panel Condition



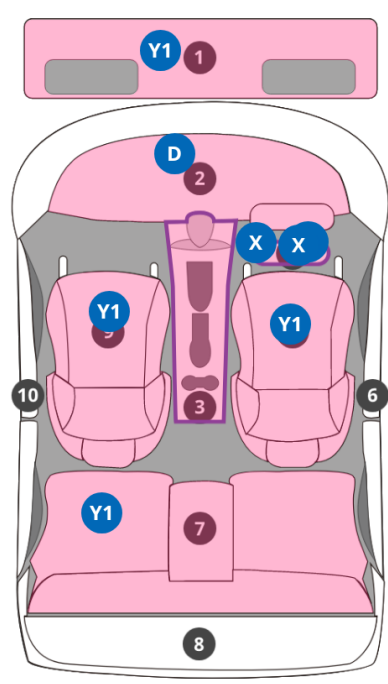
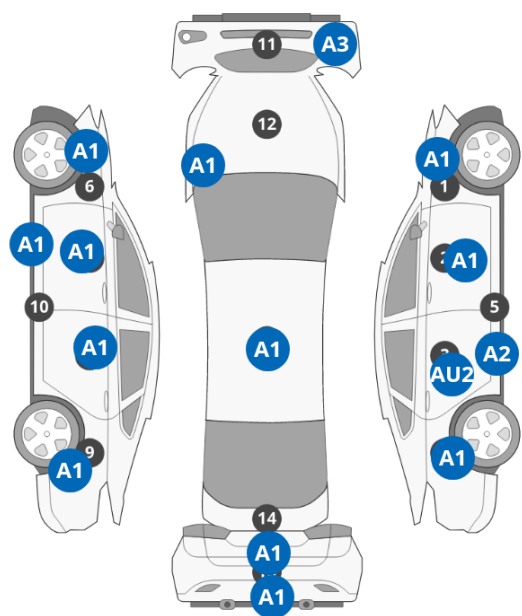
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	112.3	122	111	104
2	Boot Lid	128.6	127	126	133
3	Roof	103.2	117	102	94/100
4	Left Front Fender	110.6	113	108	111
5	Left Front Door	109.0	107	116	104
6	Center Panel Left				
7	Left Rear Door	107.3	115	103	104
8	Left Back Panel	112.3	128	105	104
9	Right Front Fender	106.3	104	108	107
10	Right Front Door	102.6	102	102	104
11	Center Panel Right				
12	Right Rear Door	108.0	104	110	110
13	Right Back Panel	106.3	106	104	109

Overall Evaluation :

B

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : B
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Display, Audio System - Missing - Yes / (L) Front Seat - Grime - Minimal / (R) Front Seat - Grime - Minimal / (L) Front Floor Mat - Missing - Yes / (R) Front Floor Mat - Missing - Yes / Mat Other - Missing - Yes / Rear Seat - Grime - Minimal / Dashboard - Traces of Adhesive Tape - Yes / Ceiling - Grime - Minimal / Overall Interior - Worn as per age - Yes	Remarks Front Bumper, Grille, Lamps - Scratch - Medium / (R) Rear Door, Molding - Scratch & Dent - Small / (R) Front Door, Molding - Scratch - Minimal / (R) Front Fender, Molding - Scratch - Minimal / (R) Rear Fender, Molding - Scratch - Minimal / Trunk Hood, Rear Gate - Scratch - Minimal / Rear Bumper, Lamps, Panels - Scratch - Minimal / Roof - Scratch - Minimal / (L) Rear Fender, Molding - Scratch - Minimal / (L) Rear Door, Molding - Scratch - Minimal / (L) Front Door, Molding - Scratch - Minimal / (L) Front Fender, Molding - Scratch - Minimal / Bonnet, Headlight - Scratch - Minimal / (L) Step, In-panel, Side Spoiler - Scratch - Minimal / (R) Step, In-panel, Side Spoiler - Scratch - Small
Frame Evaluation : A	Functional Evaluation : E
Remarks Defects not found	Remarks Retractable Mirror - Issue - Yes / Warning Lamps - Issue - Yes / Panel, Meter - Issue - Yes / Power Window (each) - Stuck, Gap - Yes / Door Lock - Issue - Yes / Sun Roof - Stuck, Gap - Yes / Power Seat - Issue - Yes / Power Steering - Issue - Yes / Shift Shock - Function - Weak / Air Conditioner - Function - Weak / Power Steering Pump - Leak - Yes / Radiator Water Pump - Leak - Yes / Battery - Weak - Yes / Remote Key & Smart entry - Issue - Yes / Audio, Radio - Issue - Yes / Reverse Camera - N/A - Yes / Parking Brake - Function - Weak / Brake Pedal - Function - Weak / Turn Signal, Hazard Flasher - Issue - Yes / Head Light, High Beam - Issue - Yes / Lamps (Brake, Tail, Fog) - Issue - Yes / Wiper - Function - Weak / Horn - Issue - Yes / Seat Belts - Issue - Yes / Spare Key - Issue - Unexist

Inspector Notes

with front lto plate only/non moving unit/functional cannot identified/Scratches and dent on the body