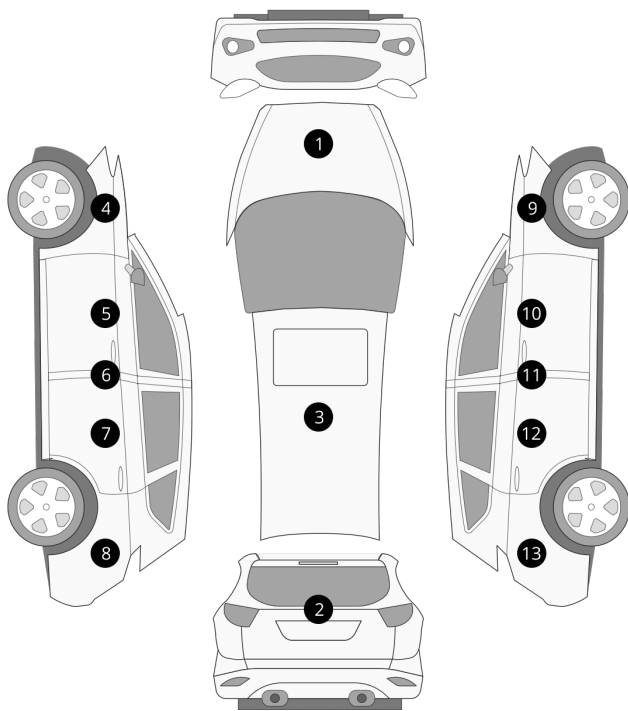


General Information

Date & Time: 10, Jun, 2026 07:40

Make	Toyota	Model	Vios
YOM	2022	Odo Meter Reading	1,234
Registration No.	NHC2809	Chassis No.	PA1B18F30N4190926
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	White		

Body / Panel Condition



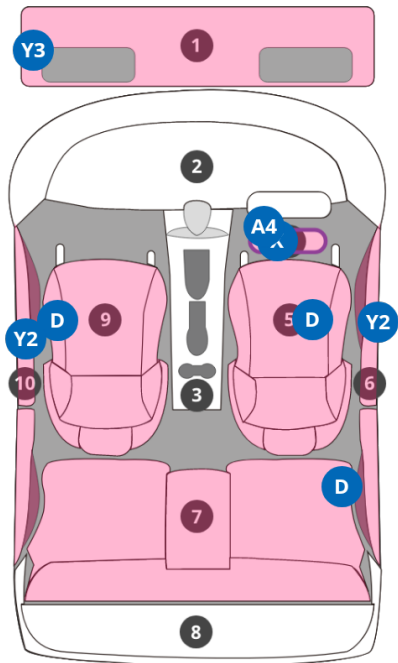
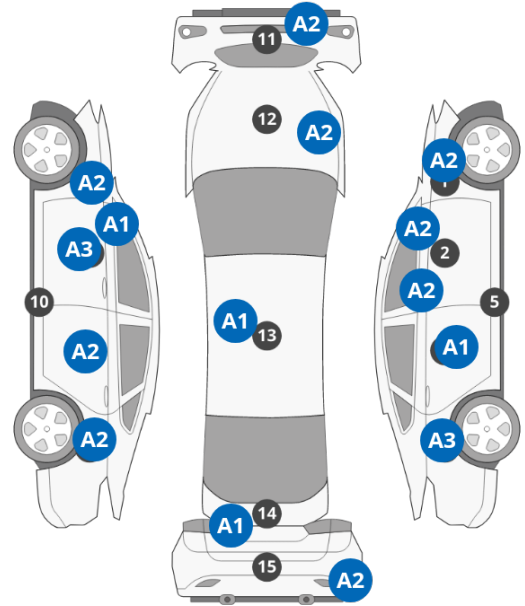
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	146.3	152	131	156
2	Boot Lid	157.6	169	150	154
3	Roof	127.7	134	135	121/121
4	Left Front Fender	121.3	125	117	122
5	Left Front Door	121.3	125	118	121
6	Center Panel Left				
7	Left Rear Door	120.6	125	120	117
8	Left Back Panel	129.6	121	148	120
9	Right Front Fender	124.0	127	124	121
10	Right Front Door	128.0	132	127	125
11	Center Panel Right				
12	Right Rear Door	124.6	123	125	126
13	Right Back Panel	128.0	121	122	141

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : C
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Mat Other - Missing - Yes / (L) Front Floor Mat - Cut, Crack - Large / (L) Front Seat - Worn - Yes / (R) Front Seat - Worn - Yes / Rear Seat - Worn - Yes / Ceiling - Grime - Medium / (L) Front Trim - Grime - Small / (R) Front Trim - Grime - Small	Remarks (R) Front Fender, Molding - Scratch - Small / (R) Mirror - Scratch - Small / (R) Front Door, Molding - Scratch - Small / (R) Rear Door, Molding - Scratch - Minimal / (R) Rear Fender, Molding - Scratch - Medium / Rear Bumper, Lamps, Panels - Scratch - Small / Trunk Hood, Rear Gate - Scratch - Minimal / (L) Rear Fender, Molding - Scratch - Small / (L) Front Door, Molding - Scratch - Medium / (L) Rear Door, Molding - Scratch - Small / (L) Mirror - Scratch - Minimal / (L) Front Fender, Molding - Scratch - Small / Front Bumper, Grille, Lamps - Scratch - Small / Bonnet, Headlight - Scratch - Small / Roof - Scratch - Minimal
Frame Evaluation : A	Functional Evaluation : E
Remarks Defects not found	Remarks Retractable Mirror - Issue - Yes / Warning Lamps - Issue - Yes / Panel, Meter - Issue - Yes / Power Window (each) - Stuck, Gap - Yes / Door Lock - Issue - Yes / Sun Roof - Stuck, Gap - Yes / Power Seat - Issue - Yes / Power Steering - Issue - Yes / Shift Shock - Function - Weak / Air Conditioner - Function - Weak / Power Steering Pump - Leak - Yes / Radiator Water Pump - Leak - Yes / Battery - Weak - Yes / Remote Key & Smart entry - Issue - Yes / Audio, Radio - Issue - Yes / Reverse Camera - N/A - Yes / Parking Brake - Function - Weak / Brake Pedal - Function - Weak / Turn Signal, Hazard Flasher - Issue - Yes / Head Light, High Beam - Issue - Yes / Lamps (Brake, Tail, Fog) - Issue - Yes / Wiper - Function - Weak / Horn - Issue - Yes / Seat Belts - Issue - Yes / Spare Key - Issue - Unexist

Inspector Notes

non moving unit, functional and mileage can't verify due to non moving unit, no warranty booklet,with jack, incomplete tools, with spare tire, with LTO plate, scratches on tail light, other scratches on exterior can't verify due to build up dirt