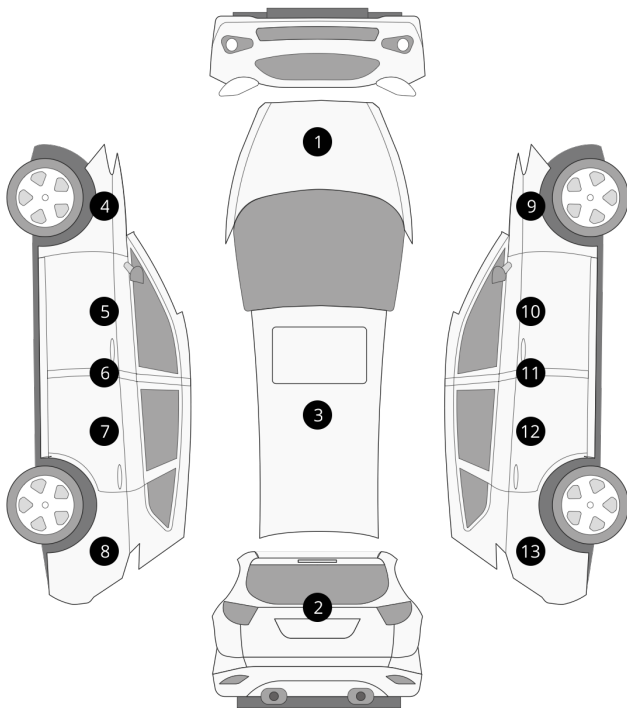


General Information

Date & Time: 24, Feb, 2025 08:52

Make	Toyota	Model	Wigo
YOM	2021	Mileage	74,583
Registration No.	DAV3642	Chassis No.	MHKA4DF5FMJ055990
CC	1.0	Transmission	A/T
Fuel Type	Gas	Type of Body	Hatchback
Colour	Gray		

Body / Panel Condition



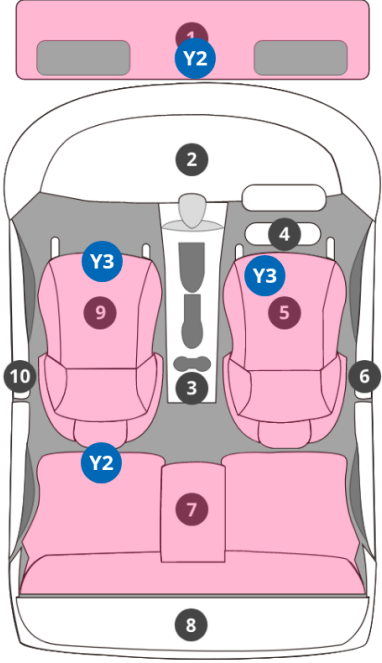
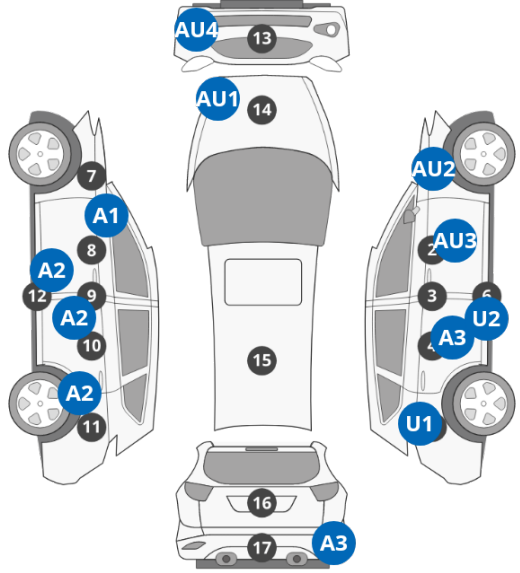
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	98.5	113	92	91
2	Boot Lid	94.2	94	95	95
3	Roof	83.1	74	87	92/80
4	Left Front Fender	89.0	89	87	91
5	Left Front Door	86.3	87	91	81
6	Center Panel Left				
7	Left Rear Door	86.3	83	91	85
8	Left Back Panel	193.6	357	116	108
9	Right Front Fender	88.3	93	87	85
10	Right Front Door	85.6	84	87	85
11	Center Panel Right				
12	Right Rear Door	85.5	81	87	89
13	Right Back Panel	85.9	89	85	83

Overall Evaluation :

B

Disclaimer

This Grading Report is intended to record the general appearance and condition of the interior, exterior & frame of the vehicle. This is not a detailed inspection report. This is issued on the date and time given herein and the company shall not be liable for the condition of the vehicle after this date and time. Any disputes regarding this report shall not be grounds for arbitration.

Interior Evaluation : B	Exterior Evaluation : C
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Ceiling - Grime - Small / Rear Seat - Grime - Small / (L) Front Seat - Grime - Medium / (R) Front Seat - Grime - Medium	Remarks (L) Rear Fender - Repair Traces - Yes / (R) Front Fender, Molding - Scratch & Dent - Small / (R) Front Door, Molding - Scratch & Dent - Medium / (R) Rear Door, Molding - Scratch - Medium / (R) Step, In-panel, Side Spoiler - Dent - Small / (R) Rear Fender, Molding - Dent - Minimal / (L) Mirror - Scratch - Minimal / Bonnet, Headlight - Scratch & Dent - Minimal / (L) Rear Door, Molding - Scratch - Small / (L) Front Door, Molding - Scratch - Small / (L) Rear Fender, Molding - Scratch - Small / Front Bumper, Grille, Lamps - Scratch & Dent - Large / Rear Bumper, Lamps, Panels - Scratch - Medium
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Remote Key & Smart entry - Issue - Yes / Spare Key - Issue - Unexist

Inspector Notes
with spare tire. without jack, tools, and warranty booklet. with LTO plate.putty on the right side mirror.