

General Information

Date & Time: 22, Feb, 2025 08:24

Make	Toyota	Model	Vios
YOM	2021	Mileage	76,632
Registration No.	DAT5285	Chassis No.	PA1B18F31L4125001
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Green		

Body / Panel Condition



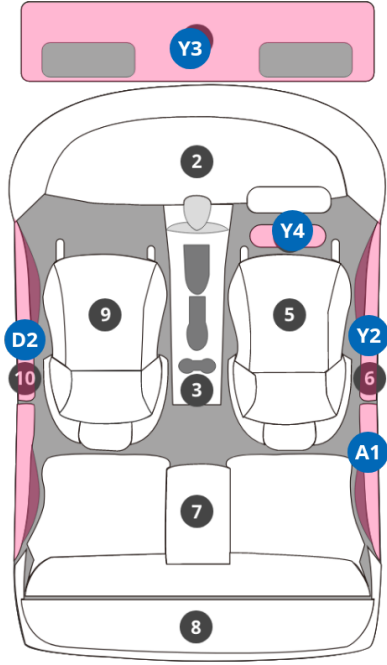
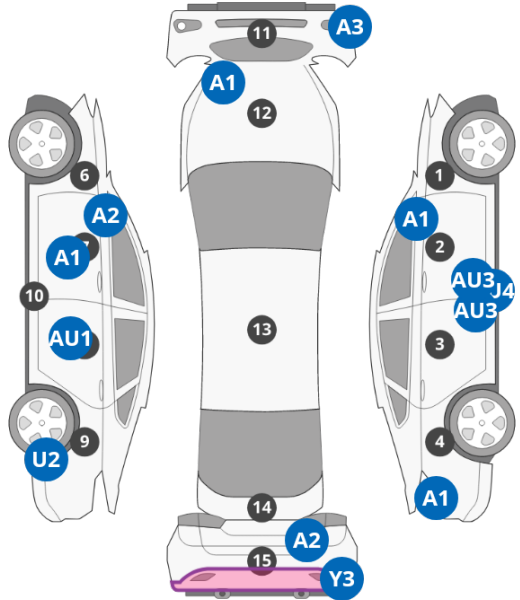
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	102.1	103	99	104
2	Boot Lid	173.3	174	151	195
3	Roof	88.8	102	83	84/87
4	Left Front Fender	87.4	85	94	83
5	Left Front Door	88.4	84	88	93
6	Center Panel Left				
7	Left Rear Door	89.1	91	87	89
8	Left Back Panel	173.0	156	201	162
9	Right Front Fender	88.8	89	90	88
10	Right Front Door	92.8	95	92	92
11	Center Panel Right				
12	Right Rear Door	88.3	84	91	90
13	Right Back Panel	105.0	87	93	135

Overall Evaluation :

C

Disclaimer

This Grading Report is intended to record the general appearance and condition of the interior, exterior & frame of the vehicle. This is not a detailed inspection report. This is issued on the date and time given herein and the company shall not be liable for the condition of the vehicle after this date and time. Any disputes regarding this report shall not be grounds for arbitration.

Interior Evaluation : C	Exterior Evaluation : D
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Mat Other - Grime - Large / (R) Rear Trim - Cut, Crack - Minimal / (R) Front Trim - Grime - Small / (L) Front Trim - Worked - Small / Ceiling - Grime - Medium	Remarks (L) Rear Fender - Repair Traces - Yes / Trunk Hood, Rear Gate - Repair Traces - Yes / (R) Step, In-panel, Side Spoiler - Scratch & Dent - Large / (R) Rear Fender, Molding - Scratch - Minimal / Trunk Hood, Rear Gate - Scratch - Small / Rear Bumper, Lamps, Panels - Repair mark - Yes / (L) Rear Fender, Molding - Dent - Small / (L) Mirror - Scratch - Small / (L) Front Door, Molding - Scratch - Minimal / Front Bumper, Grille, Lamps - Scratch - Medium / Bonnet, Headlight - Scratch - Minimal / Rear Bumper, Lamps, Panels - Crack, Gap - Medium / (R) Rear Door, Molding - Scratch & Dent - Medium / (R) Front Door, Molding - Scratch & Dent - Medium / (R) Mirror - Scratch - Minimal / (L) Rear Door, Molding - Scratch & Dent - Minimal
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Reverse Camera - N/A - Yes / Spare Key - Issue - Unexist

Inspector Notes
no warranty booklet, with jack, no tools, with spare tire, with LTO plate, grime on trunk floor cover, grime on carpet front right passenger seat, left side reverse light issue