

General Information

Date & Time: 24, Feb, 2025 09:37

Make	Toyota	Model	Vios
YOM	2024	Mileage	27,380
Registration No.	DBN2234	Chassis No.	PA1B18F32P4230989
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Red Mica Metallic		

Body / Panel Condition



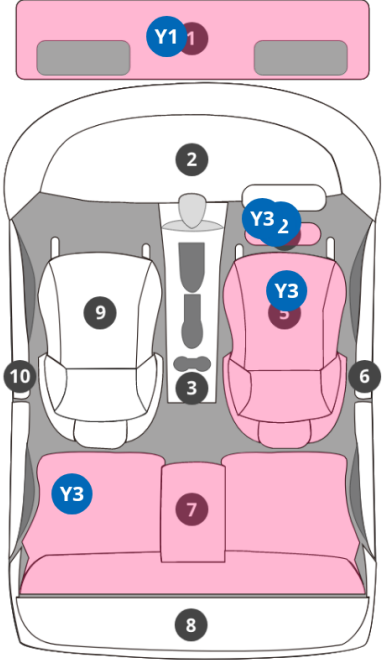
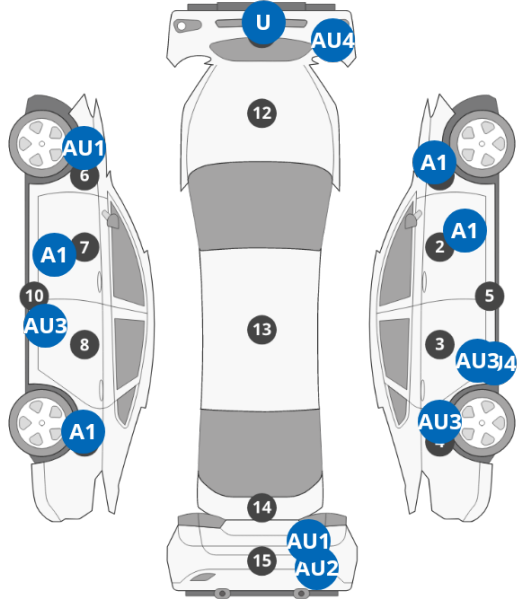
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	102.6	102	103	103
2	Boot Lid	101.5	96	103	106
3	Roof	91.2	98	86	91/90
4	Left Front Fender	97.1	91	104	96
5	Left Front Door	96.5	97	100	93
6	Center Panel Left				
7	Left Rear Door	167.6	184	194	125
8	Left Back Panel	106.5	112	113	95
9	Right Front Fender	133.3	119	139	142
10	Right Front Door	101.2	106	95	103
11	Center Panel Right				
12	Right Rear Door	98.7	97	98	101
13	Right Back Panel	98.9	93	94	110

Overall Evaluation :

C

Disclaimer

This Grading Report is intended to record the general appearance and condition of the interior, exterior & frame of the vehicle. This is not a detailed inspection report. This is issued on the date and time given herein and the company shall not be liable for the condition of the vehicle after this date and time. Any disputes regarding this report shall not be grounds for arbitration.

Interior Evaluation : C	Exterior Evaluation : C
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Rear Seat - Grime - Medium / (R) Front Seat - Grime - Medium / (R) Front Floor Mat - Grime - Medium / (L) Front Floor Mat - Worked - Small / (L) Front Floor Mat - Grime - Medium / Ceiling - Grime - Minimal	Remarks (R) Front Fender - Repair Traces - Yes / (L) Front Fender - Repair Traces - Yes / (L) Rear Door - Repair Traces - Yes / Member (Bolted) - Dent - Yes / Front Bumper, Grille, Lamps - Scratch & Dent - Large / (R) Front Door, Molding - Scratch - Minimal / (R) Step, In-panel, Side Spoiler - Scratch & Dent - Large / (R) Rear Fender, Molding - Scratch & Dent - Medium / Rear Bumper, Lamps, Panels - Scratch & Dent - Small / Trunk Hood, Rear Gate - Scratch & Dent - Minimal / (L) Rear Fender, Molding - Scratch - Minimal / (L) Rear Door, Molding - Scratch & Dent - Medium / (L) Front Door, Molding - Scratch - Minimal / (L) Front Fender, Molding - Scratch & Dent - Minimal / (R) Rear Door, Molding - Scratch & Dent - Medium / (R) Front Fender, Molding - Scratch - Minimal
Frame Evaluation : A	Functional Evaluation : B
Remarks Defects not found	Remarks Battery - Weak - Yes / Reverse Camera - N/A - Yes / Spare Key - Issue - Unexist

Inspector Notes
with warranty booklet, no jack, with tools, with spare tire, with LTO plate, weak battery, no reverse camera