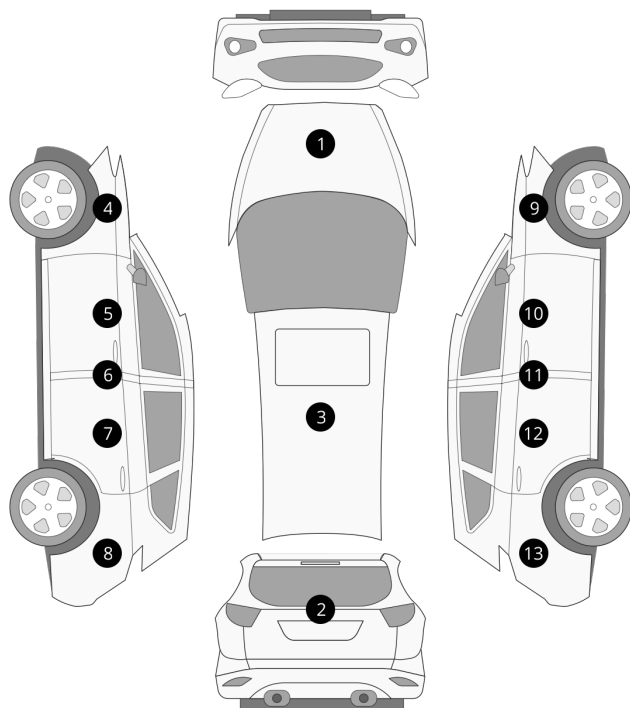


General Information

Date & Time: 22, Feb, 2025 13:22

Make	Toyota	Model	Vios
YOM	2021	Mileage	93,024
Registration No.	NGU8367	Chassis No.	PA1B18F38M4144064
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Red Mica Metallic		

Body / Panel Condition



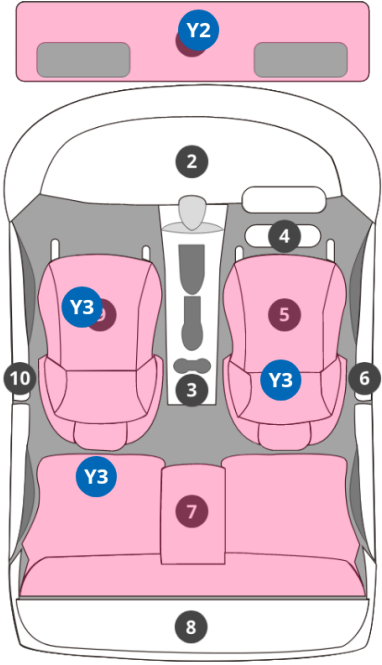
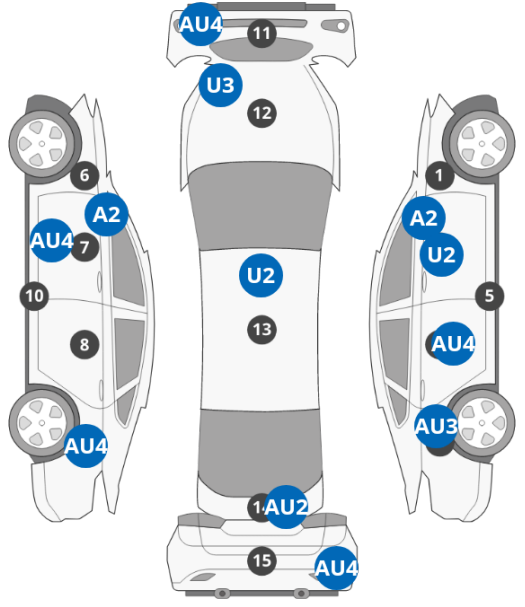
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	115.0	103	104	138
2	Boot Lid	135.6	124	122	161
3	Roof	104.4	105	98	112/103
4	Left Front Fender	138.0	147	126	141
5	Left Front Door	115.3	120	112	114
6	Center Panel Left				
7	Left Rear Door	111.0	124	106	103
8	Left Back Panel	105.9	143	75	100
9	Right Front Fender	133.3	128	144	128
10	Right Front Door	99.2	90	105	103
11	Center Panel Right				
12	Right Rear Door	189.0	192	185	190
13	Right Back Panel	140.6	146	144	132

Overall Evaluation :

C

Disclaimer

This Grading Report is intended to record the general appearance and condition of the interior, exterior & frame of the vehicle. This is not a detailed inspection report. This is issued on the date and time given herein and the company shall not be liable for the condition of the vehicle after this date and time. Any disputes regarding this report shall not be grounds for arbitration.

Interior Evaluation : B	Exterior Evaluation : E
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks (R) Front Seat - Grime - Medium / Rear Seat - Grime - Medium / (L) Front Seat - Grime - Medium / Ceiling - Grime - Small	Remarks (R) Rear Door - Repair Traces - Yes / Bonnet, Headlight - Dent - Medium / (L) Rear Fender, Molding - Scratch & Dent - Large / (L) Front Door, Molding - Scratch & Dent - Large / Front Bumper, Grille, Lamps - Scratch & Dent - Large / Rear Bumper, Lamps, Panels - Scratch & Dent - Large / Trunk Hood, Rear Gate - Scratch & Dent - Small / (R) Rear Door, Molding - Scratch & Dent - Large / Roof - Dent - Small / (R) Mirror - Scratch - Small / (R) Front Door, Molding - Dent - Small / (R) Rear Fender, Molding - Scratch & Dent - Medium / (L) Mirror - Scratch - Small
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Reverse Camera - N/A - Yes / Spare Key - Issue - Unexist

Inspector Notes
left reverse light not working, cannot confirm if it has spare tire and tools due of trunk door cannot open. with Jack. with LTO plate.