

General Information

Date & Time: 22, Feb, 2025 08:28

Make	Toyota	Model	Vios
YOM	2024	Mileage	11,411
Registration No.	NHR5929	Chassis No.	PA1B18F33P4229835
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Red Mica Metallic		

Body / Panel Condition



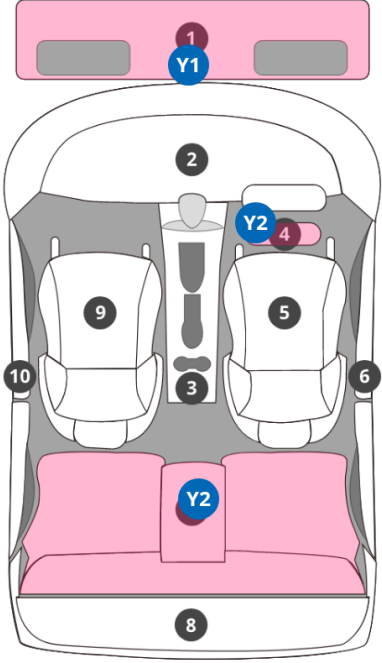
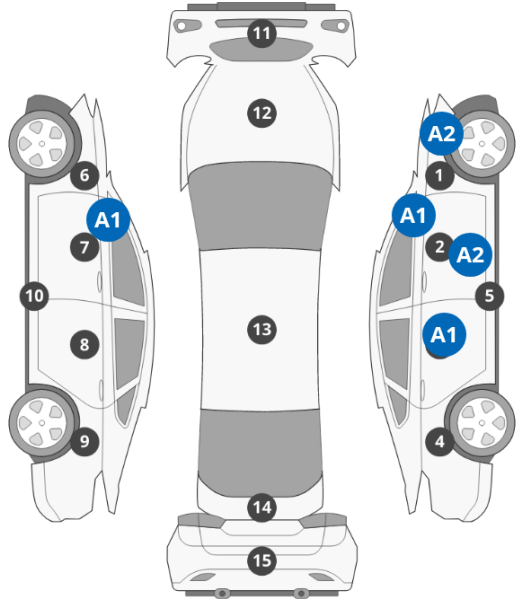
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	99.9	98	100	102
2	Boot Lid	105.5	99	114	104
3	Roof	95.8	100	87	97/100
4	Left Front Fender	88.5	92	89	85
5	Left Front Door	93.6	92	92	96
6	Center Panel Left				
7	Left Rear Door	102.8	108	106	94
8	Left Back Panel	99.8	97	99	104
9	Right Front Fender	90.8	101	84	88
10	Right Front Door	86.3	90	84	85
11	Center Panel Right				
12	Right Rear Door	97.3	95	97	99
13	Right Back Panel	87.8	88	87	89

Overall Evaluation :

A

Disclaimer

This Grading Report is intended to record the general appearance and condition of the interior, exterior & frame of the vehicle. This is not a detailed inspection report. This is issued on the date and time given herein and the company shall not be liable for the condition of the vehicle after this date and time. Any disputes regarding this report shall not be grounds for arbitration.

Interior Evaluation : A	Exterior Evaluation : A
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Ceiling - Grime - Minimal / Rear Seat - Grime - Small / (L) Front Floor Mat - Grime - Small	Remarks (R) Rear Door, Molding - Scratch - Minimal / (R) Front Door, Molding - Scratch - Small / (L) Mirror - Scratch - Minimal / (R) Front Fender, Molding - Scratch - Small / (R) Mirror - Scratch - Minimal
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Reverse Camera - N/A - Yes

Inspector Notes

without warranty booklet and tools. with spare tire and jack. with LTO plate.