

General Information

Date & Time: 25, Feb, 2025 10:16

Make	Toyota	Model	Vios
YOM	2023	Mileage	60,921
Registration No.	DBI5901	Chassis No.	PA1B18F39P4215938
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Blue		

Body / Panel Condition



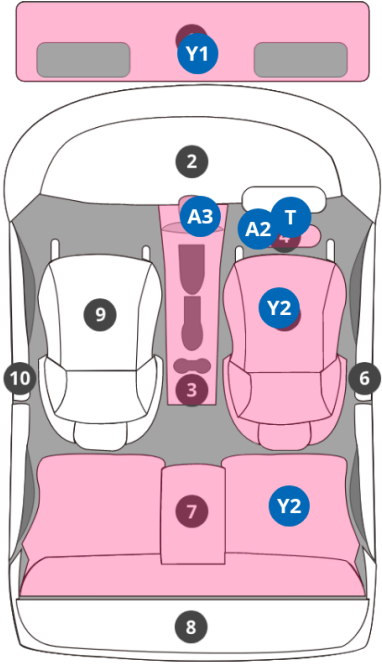
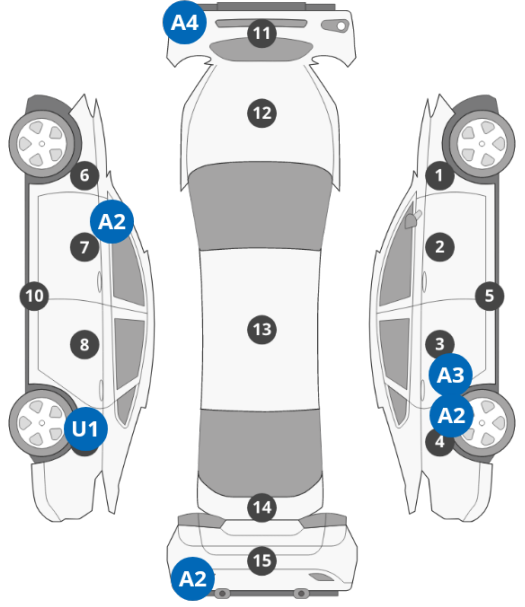
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	103.6	106	100	105
2	Boot Lid	100.4	99	101	101
3	Roof	101.4	103	95	112/96
4	Left Front Fender	87.6	89	89	85
5	Left Front Door	93.0	91	90	98
6	Center Panel Left				
7	Left Rear Door	102.8	111	100	98
8	Left Back Panel	98.5	99	98	98
9	Right Front Fender	89.7	89	90	90
10	Right Front Door	94.6	97	93	94
11	Center Panel Right				
12	Right Rear Door	100.3	94	99	109
13	Right Back Panel	95.3	95	92	99

Overall Evaluation :

B

Disclaimer

This Grading Report is intended to record the general appearance and condition of the interior, exterior & frame of the vehicle. This is not a detailed inspection report. This is issued on the date and time given herein and the company shall not be liable for the condition of the vehicle after this date and time. Any disputes regarding this report shall not be grounds for arbitration.

Interior Evaluation : B	Exterior Evaluation : C
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Ceiling - Grime - Minimal / (R) Front Seat - Grime - Small / Rear Seat - Grime - Small / (L) Front Floor Mat - Cut, Crack - Small / Carpet - Cigarette Burns - Burnt / Console, Switchs, Vents - Worn, Scratch, Cut, Crack - Medium	Remarks (L) Rear Fender, Molding - Dent - Minimal / (L) Mirror - Scratch - Small / Front Bumper, Grille, Lamps - Scratch - Large / (R) Rear Door, Molding - Scratch - Medium / (R) Rear Fender, Molding - Scratch - Small / Rear Bumper, Lamps, Panels - Scratch - Small
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Reverse Camera - N/A - Yes / Spare Key - Issue - Unexist

Inspector Notes
with spare tire and jack. without tools and warranty booklet. with LTO plate.