

General Information

Date & Time: 17, Jun, 2026 12:53

Make	Nissan	Model	NV350
YOM	2020	Odo Meter Reading	76,839
Registration No.	HAB7042	Chassis No.	JN1TC2E26Z0059727
CC	2.5	Transmission	A/T
Fuel Type	Diesel	Type of Body	Van
Colour	White		

Body / Panel Condition



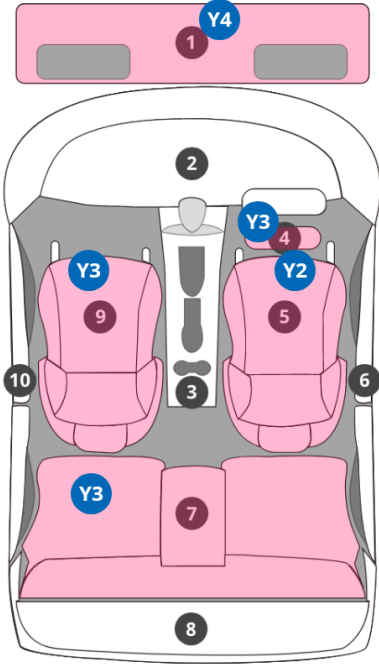
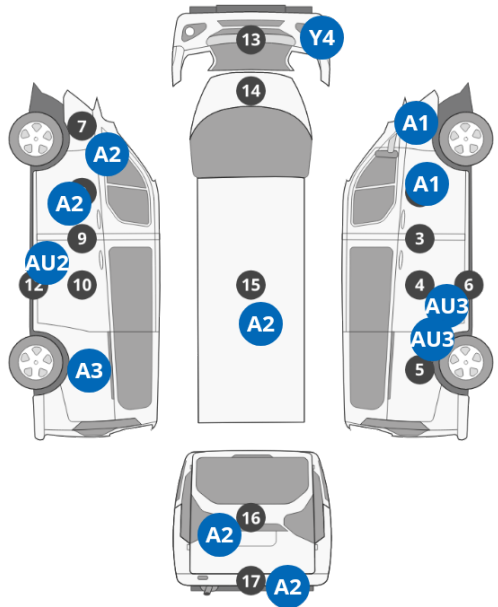
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	78.9	89	63	85
2	Boot Lid	172.0	135	174	207
3	Roof	77.9	67	75	69/101
4	Left Front Fender	77.3	86	71	76
5	Left Front Door	150.7	241	116	95
6	Center Panel Left	116.7	98	135	117
7	Left Rear Door	118.0	128	110	116
8	Left Back Panel	133.0	162	130	107
9	Right Front Fender	83.7	80	78	93
10	Right Front Door	66.0	62	64	73
11	Center Panel Right	81.4	71	87	86
12	Right Rear Door	66.2	63	67	68
13	Right Back Panel	76.5	78	75	77

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : D
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks (L) Front Seat - Grime - Medium / (R) Front Seat - Grime - Small / (R) Front Floor Mat - Grime - Medium / Ceiling - Grime - Large / Rear Seat - Grime - Medium	Remarks (L) Front Door - Repair Traces - Yes / (L) Rear Fender - Repair Traces - Yes / Trunk Hood, Rear Gate - Repair Traces - Yes / Rear Bumper, Lamps, Panels - Scratch - Small / Trunk Hood, Rear Gate - Scratch - Small / (L) Rear Fender, Molding - Scratch - Medium / (L) Rear Door, Molding - Scratch & Dent - Small / (L) Front Door, Molding - Scratch - Small / (L) Mirror - Scratch - Small / (R) Front Fender, Molding - Scratch - Minimal / (R) Front Door, Molding - Scratch - Minimal / (R) Rear Door, Molding - Scratch & Dent - Medium / (R) Rear Fender, Molding - Scratch & Dent - Medium / Roof - Scratch - Small / Front Bumper, Grille, Lamps - Crack, Gap - Large
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Spare Key - Issue - Unexist

Inspector Notes

with LTO plate, no warranty booklet, incomplete tools, with jackm crack right frobt headlight. mufler is modified, possible flooding, missing knob of shift gear, hairline scratches in the body, replcaed mags,