

General Information

Date & Time: 16, Jun, 2026 12:41

Make	Toyota	Model	Avanza
YOM	2023	Odo Meter Reading	1
Registration No.	GAK5760	Chassis No.	MHFAA1BY9N0010497
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	MPV
Colour	Black		

Body / Panel Condition



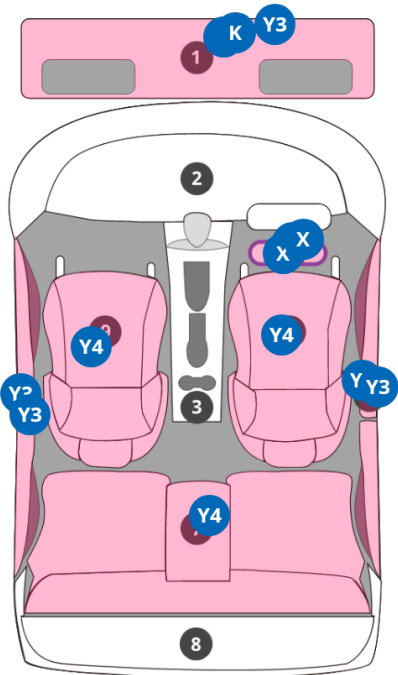
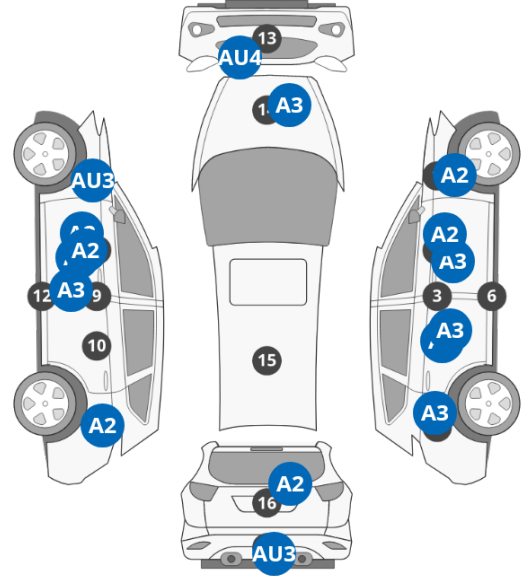
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	230.3	232	246	213
2	Boot Lid	123.3	131	118	121
3	Roof	119.7	132	121	110/116
4	Left Front Fender	123.6	124	122	125
5	Left Front Door	186.6	147	185	228
6	Center Panel Left				
7	Left Rear Door	129.0	133	126	128
8	Left Back Panel	130.0	147	124	119
9	Right Front Fender	126.6	123	126	131
10	Right Front Door	213.3	214	213	213
11	Center Panel Right				
12	Right Rear Door	120.6	123	117	122
13	Right Back Panel	124.0	116	123	133

Overall Evaluation :

D

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : E	Exterior Evaluation : E
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Overall Interior - Smell - Yes / Rear Seat - Grime - Large / (R) Rear Trim - Grime - Medium / (R) Front Floor Mat - Missing - Yes / (L) Front Floor Mat - Missing - Yes / Mat Other - Missing - Yes / (R) Front Seat - Grime - Large / (R) Front Trim - Grime - Medium / (L) Front Seat - Grime - Large / (L) Rear Trim - Grime - Medium / (L) Front Trim - Grime - Medium / Ceiling - Grime - Medium / Overall Interior - Animal Hair - Yes	Remarks (R) Front Door - Repair Traces - Yes / Bonnet - Repair Traces - Yes / (L) Front Door - Repair Traces - Yes / Front Bumper, Grille, Lamps - Scratch & Dent - Large / Bonnet, Headlight - Scratch - Medium / (L) Front Fender, Molding - Scratch & Dent - Medium / (L) Mirror - Scratch - Small / (L) Front Door, Molding - Scratch - Medium / (L) Rear Door, Molding - Scratch - Medium / (L) Rear Fender, Molding - Scratch - Small / Rear Bumper, Lamps, Panels - Scratch & Dent - Medium / Trunk Hood, Rear Gate - Scratch - Small / (R) Rear Fender, Molding - Scratch - Medium / (R) Rear Door, Molding - Scratch - Large / (R) Front Door, Molding - Scratch - Medium / (R) Step, In-panel, Side Spoiler - Scratch - Small / (L) Step, In-panel, Side Spoiler - Scratch - Small / (R) Mirror - Scratch - Medium / (R) Front Fender, Molding - Scratch - Small
Frame Evaluation : A	Functional Evaluation : E
Remarks Defects not found	Remarks Retractable Mirror - Issue - Yes / Warning Lamps - Issue - Yes / Panel, Meter - Issue - Yes / Power Window (each) - Stuck, Gap - Yes / Door Lock - Issue - Yes / Power Seat - Issue - Yes / Power Steering - Issue - Yes / Shift Shock - Function - Weak / Air Conditioner - Function - Weak / Power Steering Pump - Leak - Yes / Radiator Water Pump - Leak - Yes / Battery - Weak - Yes / Remote Key & Smart entry - Issue - Yes / Audio, Radio - Issue - Yes / Reverse Camera - N/A - Yes / Parking Brake - Function - Weak / Brake Pedal - Function - Weak / Turn Signal, Hazard Flasher - Issue - Yes / Head Light, High Beam - Issue - Yes / Lamps (Brake, Tail, Fog) - Issue - Yes / Wiper - Function - Weak / Horn - Issue - Yes / Spare Key - Issue - Unexist

Inspector Notes
Possible flooded. Towed unit. Functions cannot be determined. Mileage cannot be determined. Trunk room cannot be open. Visible hairline scratches. Incomplete tools. Without seatcover, warranty booklet. With jack, sparetire, LTO plate and 1key.