

General Information

Date & Time: 25, Feb, 2025 13:21

Make	Toyota	Model	Hilux
YOM	2021	Mileage	189,779
Registration No.	EAF5549	Chassis No.	MR0JB8DD1L3170494
CC	2.4	Transmission	M/T
Fuel Type	Diesel	Type of Body	Pickup
Colour	Orange		

Body / Panel Condition



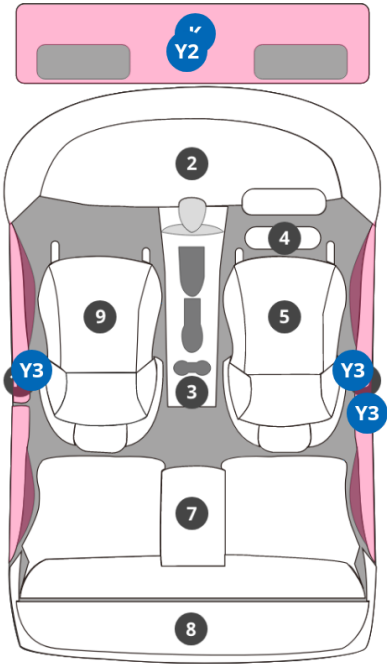
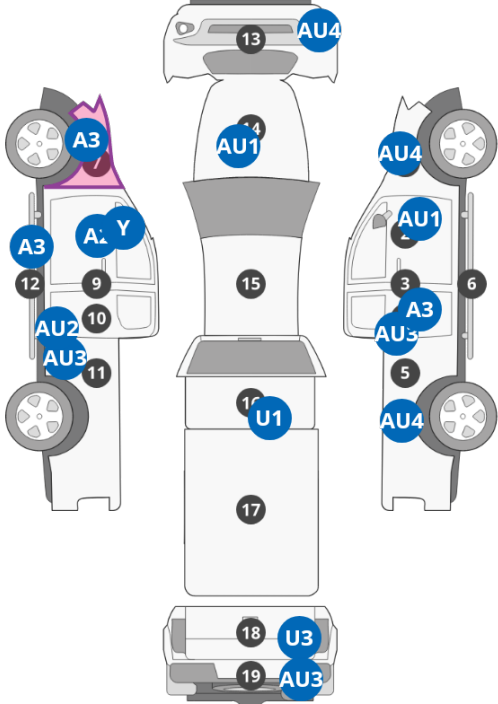
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	109.6	112	108	109
2	Boot Lid	96.0	97	92	99
3	Roof	103.4	104	103	100/107
4	Left Front Fender	84.9	89	85	82
5	Left Front Door	80.8	80	74	89
6	Center Panel Left				
7	Left Rear Door	72.2	72	75	70
8	Left Back Panel	136.6	125	145	140
9	Right Front Fender	95.3	100	93	93
10	Right Front Door	178.0	167	183	184
11	Center Panel Right				
12	Right Rear Door	406.6	497	385	338
13	Right Back Panel	125.3	109	128	139

Overall Evaluation :

C

Disclaimer

This Grading Report is intended to record the general appearance and condition of the interior, exterior & frame of the vehicle. This is not a detailed inspection report. This is issued on the date and time given herein and the company shall not be liable for the condition of the vehicle after this date and time. Any disputes regarding this report shall not be grounds for arbitration.

Interior Evaluation : B	Exterior Evaluation : E
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Overall Interior - Animal Hair - Yes / Ceiling - Grime - Small / (R) Front Trim - Grime - Medium / (R) Rear Trim - Grime - Medium / (L) Front Trim - Grime - Medium	Remarks (R) Front Door - Repair Traces - Yes / (R) Step - Repair Traces - Yes / (L) Front Door - Repair Traces - Yes / (L) Step - Repair Traces - Yes / (L) Rear Door - Repair Traces - Yes / (R) Rear Door - Repair Traces - Yes / Bonnet, Headlight - Scratch & Dent - Minimal / (R) Front Fender, Molding - Scratch & Dent - Large / (R) Front Door, Molding - Scratch & Dent - Minimal / (R) Side Gate - Scratch & Dent - Large / (R) Rear Corner Panel - Scratch & Dent - Medium / (R) Rear Door, Molding - Scratch - Medium / Rear Gate - Dent - Medium / (L) Side Gate - Scratch & Dent - Medium / (L) Rear Corner Panel - Scratch & Dent - Small / (L) Step, In-panel, Side Spoiler - Scratch - Medium / (L) Front Door, Molding - Scratch - Small / (L) Front Fender, Molding - Scratch - Medium / Front Bumper, Grille, Lamps - Scratch & Dent - Large / (L) Mirror - Crack - Damaged / Roof - Dent - Minimal / Rear Bumper, Lamps, Panels - Scratch & Dent - Medium / (L) Front Wheel, Cover - Cap Missing - Yes
Frame Evaluation : A	Functional Evaluation : C
Remarks Defects not found	Remarks Warning Lamps - Issue - Yes / Battery - Weak - Yes / Reverse Camera - N/A - Yes / Head Light, High Beam - Issue - Yes / Spare Key - Issue - Unexist

Inspector Notes
with jack but incomplete tools. one tire damage. no headlight low beam. with LTO plate. without warranty booklet. grime at the center console. no plate light. worn tires. gap at the front bumper. / ABS WARNING LAMP