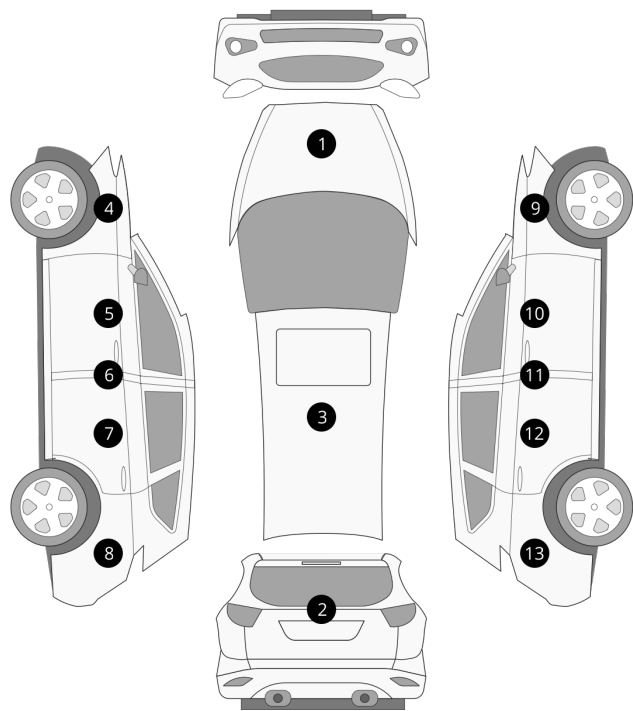


General Information

Date & Time: 25, Feb, 2025 11:06

Make	Toyota	Model	Vios
YOM	2021	Mileage	27,254
Registration No.	NER1207	Chassis No.	PA1B18F35M4158648
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Black		

Body / Panel Condition



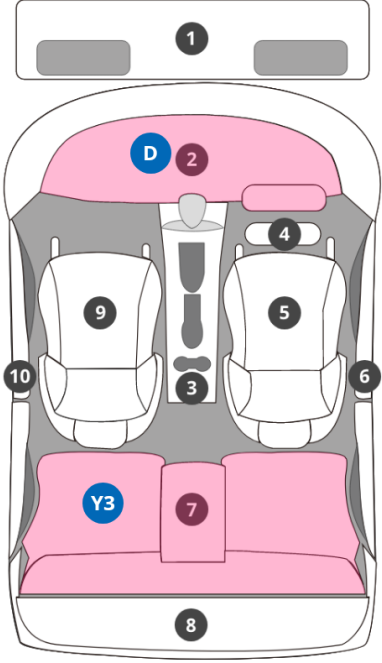
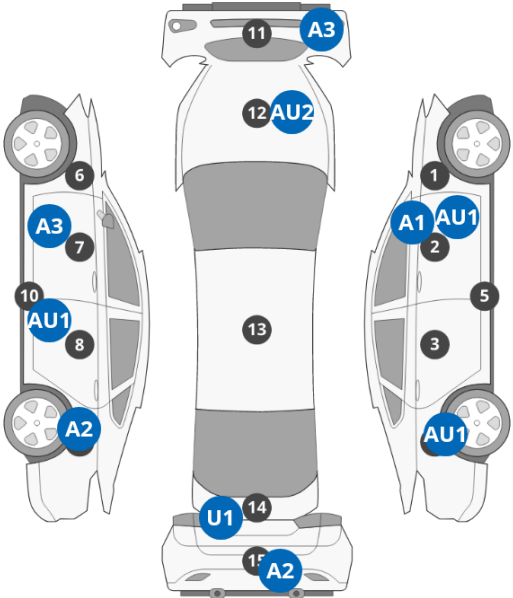
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	105.9	115	96	107
2	Boot Lid	109.0	106	106	115
3	Roof	94.5	93	94	90/101
4	Left Front Fender	240.6	226	235	261
5	Left Front Door	92.5	93	92	93
6	Center Panel Left				
7	Left Rear Door	92.4	95	92	91
8	Left Back Panel	99.8	103	101	96
9	Right Front Fender	85.6	84	94	80
10	Right Front Door	87.9	84	86	94
11	Center Panel Right				
12	Right Rear Door	99.3	90	98	110
13	Right Back Panel	128.6	129	125	132

Overall Evaluation :

A

Disclaimer

This Grading Report is intended to record the general appearance and condition of the interior, exterior & frame of the vehicle. This is not a detailed inspection report. This is issued on the date and time given herein and the company shall not be liable for the condition of the vehicle after this date and time. Any disputes regarding this report shall not be grounds for arbitration.

Interior Evaluation : B	Exterior Evaluation : B
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Dashboard - Traces of Adhesive Tape - Yes / Rear Seat - Grime - Medium	Remarks (L) Front Fender - Repair Traces - Yes / Bonnet, Headlight - Scratch & Dent - Small / Trunk Hood, Rear Gate - Dent - Minimal / (L) Front Door, Molding - Scratch - Medium / (R) Mirror - Scratch - Minimal / (R) Front Door, Molding - Scratch & Dent - Minimal / (R) Rear Fender, Molding - Scratch & Dent - Minimal / Rear Bumper, Lamps, Panels - Scratch - Small / (L) Rear Fender, Molding - Scratch - Small / (L) Rear Door, Molding - Scratch & Dent - Minimal / Front Bumper, Grille, Lamps - Scratch - Medium
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Head Light, High Beam - Issue - Yes / Spare Key - Issue - Unexist

Inspector Notes
with warranty booklet, tools, jack and spare tire. with LTO plate. leather seat cover and armrest.