

General Information

Date & Time: 24, Feb, 2025 11:02

Make	Toyota	Model	Vios
YOM	2012	Mileage	179,832
Registration No.	UCO586	Chassis No.	NCP929055620
CC	1.3	Transmission	A/T
Fuel Type	Gas	Type of Body	Sedan
Colour	Brown		

Body / Panel Condition



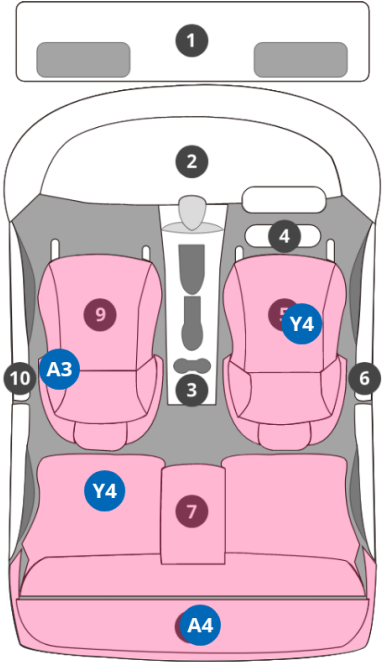
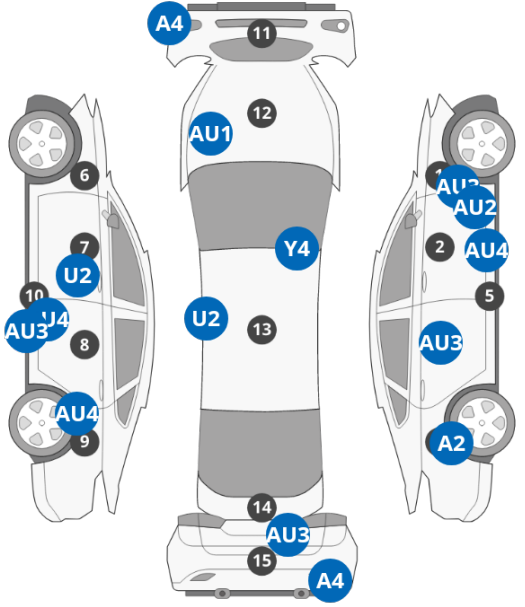
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	100.6	95	106	101
2	Boot Lid	113.6	120	101	120
3	Roof	111.5	124	106	105/111
4	Left Front Fender	106.3	103	108	108
5	Left Front Door	115.6	115	119	113
6	Center Panel Left				
7	Left Rear Door	112.3	113	110	114
8	Left Back Panel	114.6	129	110	105
9	Right Front Fender	103.3	108	102	100
10	Right Front Door	112.3	116	114	107
11	Center Panel Right				
12	Right Rear Door	113.3	111	110	119
13	Right Back Panel	113.3	109	106	125

Overall Evaluation :

D

Disclaimer

This Grading Report is intended to record the general appearance and condition of the interior, exterior & frame of the vehicle. This is not a detailed inspection report. This is issued on the date and time given herein and the company shall not be liable for the condition of the vehicle after this date and time. Any disputes regarding this report shall not be grounds for arbitration.

Interior Evaluation : C	Exterior Evaluation : E
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks (L) Front Seat - Cut, Crack - Medium / Rear Seat - Grime - Large / Trunk Room - Worn, Scratch, Cut, Crack - Large / (R) Front Seat - Grime - Large / Overall Interior - Worn as per age - Yes	Remarks (R) Front Fender - Repair Traces - Yes / (L) Front Fender - Repair Traces - Yes / (L) Rear Door, Molding - Scratch & Dent - Large / (L) Step, In-panel, Side Spoiler - Scratch & Dent - Medium / (L) Rear Fender, Molding - Scratch & Dent - Large / Trunk Hood, Rear Gate - Scratch & Dent - Medium / Rear Bumper, Lamps, Panels - Scratch - Large / (R) Rear Fender, Molding - Scratch - Small / (R) Rear Door, Molding - Scratch & Dent - Medium / (R) Step, In-panel, Side Spoiler - Scratch & Dent - Large / (R) Front Fender, Molding - Scratch & Dent - Medium / (R) Front Door, Molding - Scratch & Dent - Small / Front Bumper, Grille, Lamps - Scratch - Large / Bonnet, Headlight - Scratch & Dent - Minimal / Roof - Dent - Small / (L) Front Door, Molding - Dent - Small / Front Windshield - Damaged - Large
Frame Evaluation : A	Functional Evaluation : D
Remarks Defects not found	Remarks Air Conditioner - Function - Weak / Radiator Water Pump - Leak - Yes / Reverse Camera - N/A - Yes / Horn - Issue - Yes / Spare Key - Issue - Unexist

Inspector Notes
no tools and jack/ no warranty booklet/ with spare tire and LTO plate/ possible flooding/ no horn/ missing rear assist handle