

General Information

Date & Time: 24, Jun, 2026 13:28

Make	Toyota	Model	Vios
YOM	2024	Odo Meter Reading	36,476
Registration No.	NKE1085	Chassis No.	PA1B18F3XR4257229
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Red		

Body / Panel Condition



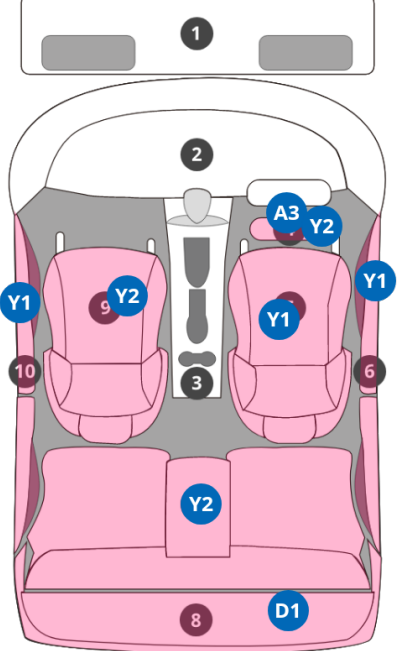
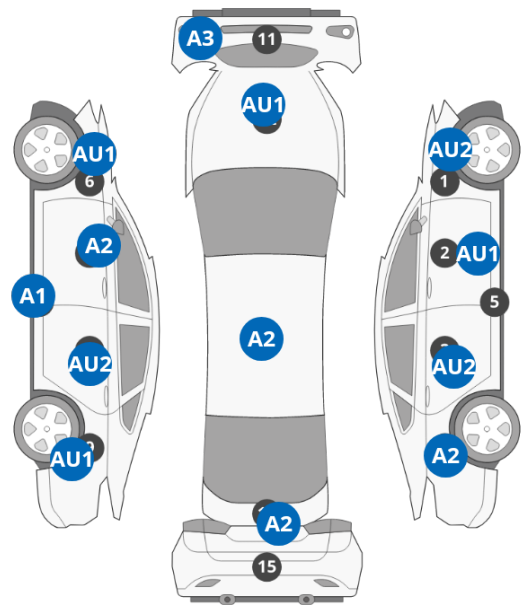
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	121.0	124	121	118
2	Boot Lid	132.0	139	117	140
3	Roof	125.0	129	119	128/124
4	Left Front Fender	118.6	115	125	116
5	Left Front Door	126.0	128	127	123
6	Center Panel Left				
7	Left Rear Door	129.6	139	128	122
8	Left Back Panel	121.3	123	121	120
9	Right Front Fender	126.6	133	125	122
10	Right Front Door	83.8	9	120	123
11	Center Panel Right				
12	Right Rear Door	128.3	128	121	136
13	Right Back Panel	122.6	121	118	129

Overall Evaluation :

B

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : C
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks (L) Front Floor Mat - Cut, Crack - Medium / (R) Front Floor Mat - Grime - Small / Rear Seat - Grime - Small / (L) Front Seat - Grime - Small / (R) Front Seat - Grime - Minimal / (R) Front Trim - Grime - Minimal / (L) Front Trim - Grime - Minimal / Trunk Room - Worked - Minimal	Remarks (R) Front Door - Repair Traces - Yes / (R) Front Fender - Repair Traces - Yes / Bonnet - Repair Traces - Yes / (L) Front Fender - Repair Traces - Yes / Roof - Scratch - Small / (L) Rear Door, Molding - Scratch & Dent - Small / (L) Rear Fender, Molding - Scratch & Dent - Minimal / Trunk Hood, Rear Gate - Scratch - Small / (R) Rear Fender, Molding - Scratch - Small / (R) Rear Door, Molding - Scratch & Dent - Small / (R) Front Door, Molding - Scratch & Dent - Minimal / (R) Front Fender, Molding - Scratch & Dent - Small / Bonnet, Headlight - Scratch & Dent - Minimal / Front Bumper, Grille, Lamps - Scratch - Medium / (L) Front Fender, Molding - Scratch & Dent - Minimal / (L) Front Door, Molding - Scratch - Small / (L) Step, In-panel, Side Spoiler - Scratch - Minimal
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Defects not found

Inspector Notes
only one LTO plate, with spare tire and key, with warranty and manual booklet, with jack, no tools, scratches and dent on exterior, scratches on taillight and headlight.