

General Information

Date & Time: 25, Feb, 2025 16:49

Make	Toyota	Model	Vios
YOM	2024	Mileage	6,421
Registration No.	NIU7143	Chassis No.	PA1B18F32R4243969
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Blue		

Body / Panel Condition



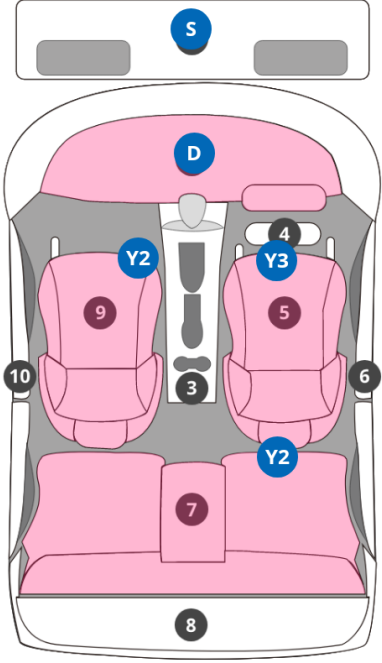
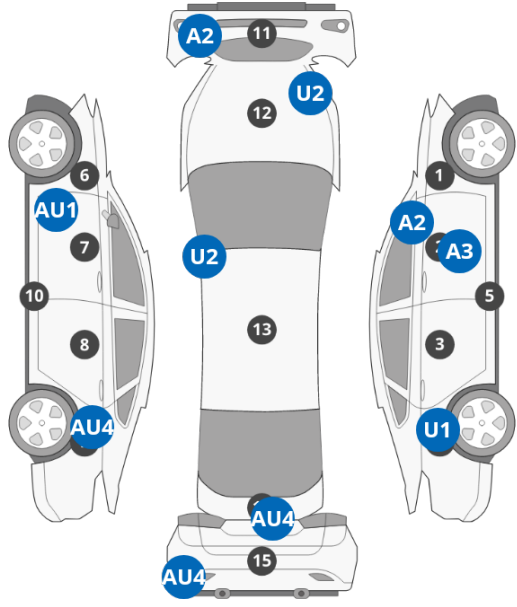
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	99.1	101	92	104
2	Boot Lid	94.9	97	94	95
3	Roof	101.4	99	101	100/106
4	Left Front Fender	84.8	83	85	87
5	Left Front Door	88.3	93	88	84
6	Center Panel Left				
7	Left Rear Door	96.7	98	99	93
8	Left Back Panel	97.8	100	97	97
9	Right Front Fender	93.6	92	94	95
10	Right Front Door	94.2	95	93	95
11	Center Panel Right				
12	Right Rear Door	106.3	100	104	115
13	Right Back Panel	99.1	100	97	101

Overall Evaluation :

C

Disclaimer

This Grading Report is intended to record the general appearance and condition of the interior, exterior & frame of the vehicle. This is not a detailed inspection report. This is issued on the date and time given herein and the company shall not be liable for the condition of the vehicle after this date and time. Any disputes regarding this report shall not be grounds for arbitration.

Interior Evaluation : B	Exterior Evaluation : D
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Dashboard - Traces of Adhesive Tape - Yes / Overall Interior - Smell - Yes / (R) Front Seat - Grime - Medium / Rear Seat - Grime - Small / (L) Front Seat - Grime - Small	Remarks Trunk Hood, Rear Gate - Repair Traces - Yes / Rear Bumper, Lamps, Panels - Scratch & Dent - Large / Roof - Dent - Small / Bonnet, Headlight - Dent - Small / (R) Rear Fender, Molding - Dent - Minimal / Front Bumper, Grille, Lamps - Scratch - Small / (R) Mirror - Scratch - Small / (R) Front Door, Molding - Scratch - Medium / (L) Front Door, Molding - Scratch & Dent - Minimal / (L) Rear Fender, Molding - Scratch & Dent - Large / Trunk Hood, Rear Gate - Scratch & Dent - Large
Frame Evaluation : A	Functional Evaluation : B
Remarks Defects not found	Remarks Battery - Weak - Yes / Reverse Camera - N/A - Yes

Inspector Notes
crack left taillight. with warranty booklet and spare tire. without tools and jack. with LTO plate.gap at the left rear bumper.