

General Information

Date & Time: 19, Jun, 2026 16:27

Make	Kia	Model	Stonic
YOM	2023	Odo Meter Reading	60,358
Registration No.	FAO3197	Chassis No.	LJD4AA19BP0111044
CC	1.4	Transmission	A/T
Fuel Type	Gas	Type of Body	SUV
Colour	Orange		

Body / Panel Condition



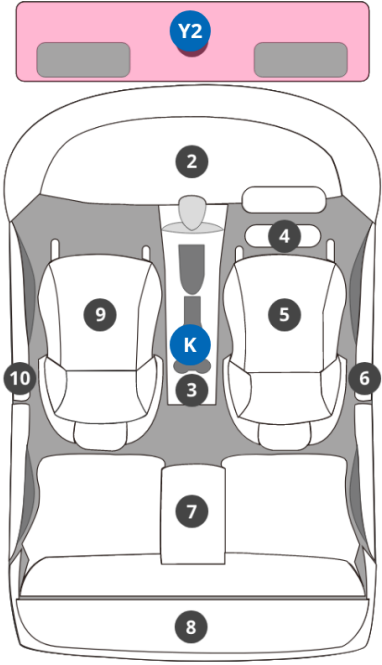
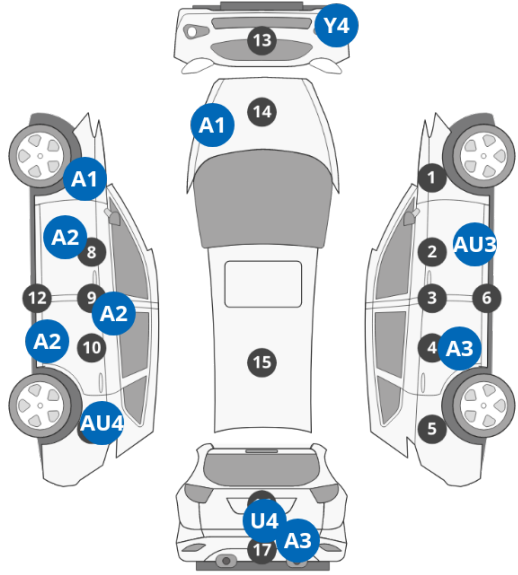
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	117.0	121	117	113
2	Boot Lid	216.0	374	160	114
3	Roof	121.5	146	135	105/100
4	Left Front Fender	110.8	126	107	99
5	Left Front Door	113.0	116	112	111
6	Center Panel Left				
7	Left Rear Door	249.3	301	241	206
8	Left Back Panel	113.0	120	111	108
9	Right Front Fender	113.6	100	109	132
10	Right Front Door	102.6	96	100	112
11	Center Panel Right				
12	Right Rear Door	107.3	108	104	110
13	Right Back Panel	115.3	108	115	123

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : E
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Ceiling - Grime - Small / Overall Interior - Animal Hair - Yes	Remarks (L) Rear Door - Repair Traces - Yes / Trunk Hood, Rear Gate - Repair Traces - Yes / Front Bumper, Grille, Lamps - Crack, Gap - Large / (R) Front Door, Molding - Scratch & Dent - Medium / (R) Rear Door, Molding - Scratch - Medium / Trunk Hood, Rear Gate - Dent - Large / Rear Bumper, Lamps, Panels - Scratch - Medium / (L) Rear Fender, Molding - Scratch & Dent - Large / (L) Rear Door, Molding - Scratch - Small / (L) Front Door, Molding - Scratch - Small / (L) Step, In-panel, Side Spoiler - Scratch - Small / (L) Front Fender, Molding - Scratch - Minimal / Bonnet, Headlight - Scratch - Minimal
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Spare Key - Issue - Unexist

Inspector Notes

with lto plate, no warranty booklet, no jack, no tools, with spare tire, with hairline scratches on the body