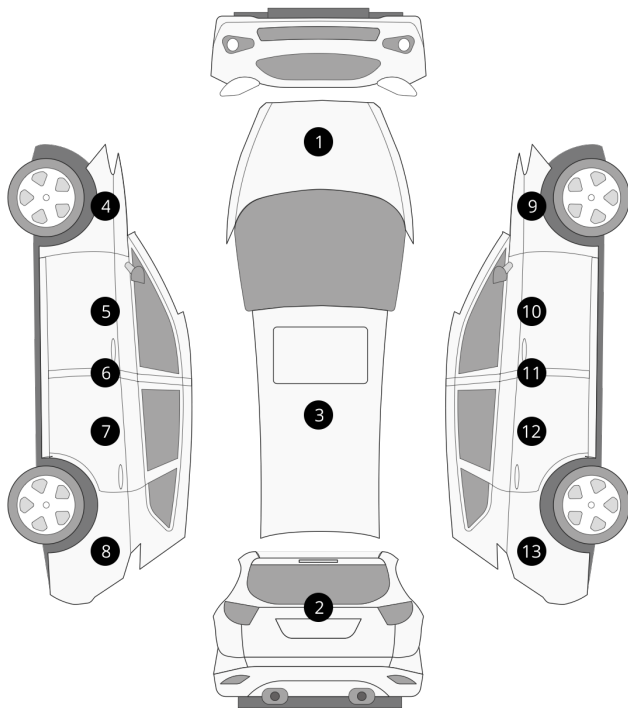


General Information

Date & Time: 25, Feb, 2025 15:07

Make	Toyota	Model	Vios
YOM	2024	Mileage	39,421
Registration No.	NHH7476	Chassis No.	PA1B18F30R4247227
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Silver		

Body / Panel Condition



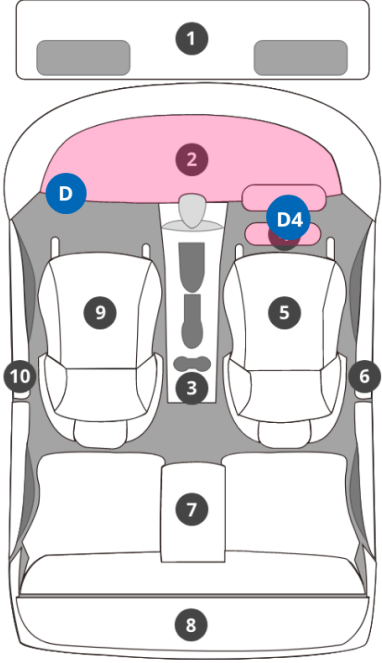
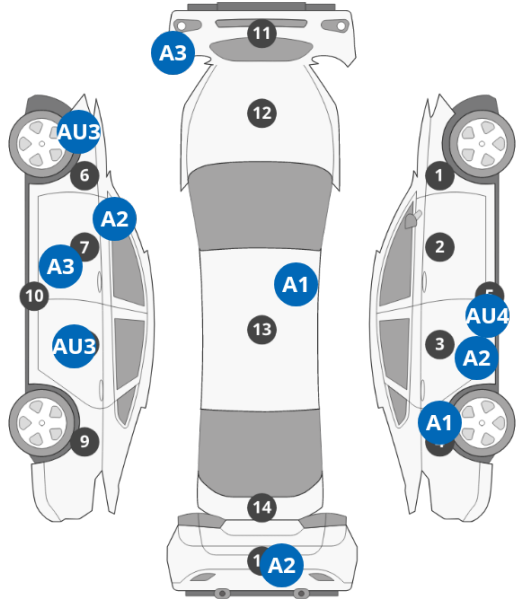
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	114.3	118	110	115
2	Boot Lid	109.0	105	108	114
3	Roof	105.2	113	108	97/103
4	Left Front Fender	96.8	97	101	92
5	Left Front Door	97.5	90	105	97
6	Center Panel Left				
7	Left Rear Door	102.6	118	103	87
8	Left Back Panel	107.2	117	108	97
9	Right Front Fender	103.1	98	101	111
10	Right Front Door	101.7	106	101	98
11	Center Panel Right				
12	Right Rear Door	112.0	100	114	122
13	Right Back Panel	106.3	95	112	112

Overall Evaluation :

B

Disclaimer

This Grading Report is intended to record the general appearance and condition of the interior, exterior & frame of the vehicle. This is not a detailed inspection report. This is issued on the date and time given herein and the company shall not be liable for the condition of the vehicle after this date and time. Any disputes regarding this report shall not be grounds for arbitration.

Interior Evaluation : C	Exterior Evaluation : C
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Mat Other - Worked - Large / (L) Front Floor Mat - Cut, Crack - Small / (L) Front Floor Mat - Worked - Large / Dashboard - Traces of Adhesive Tape - Yes	Remarks (R) Rear Door, Molding - Scratch - Small / (R) Step, In-panel, Side Spoiler - Scratch & Dent - Large / (R) Rear Fender, Molding - Scratch - Minimal / Roof - Scratch - Minimal / Rear Bumper, Lamps, Panels - Scratch - Small / (L) Front Fender, Molding - Scratch & Dent - Medium / (L) Mirror - Scratch - Small / Front Bumper, Grille, Lamps - Scratch - Medium / (L) Rear Door, Molding - Scratch & Dent - Medium / (L) Front Door, Molding - Scratch - Medium
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Spare Key - Issue - Unexist

Inspector Notes

no warranty booklet, with jack and tools, with spare tire, with LTO plate