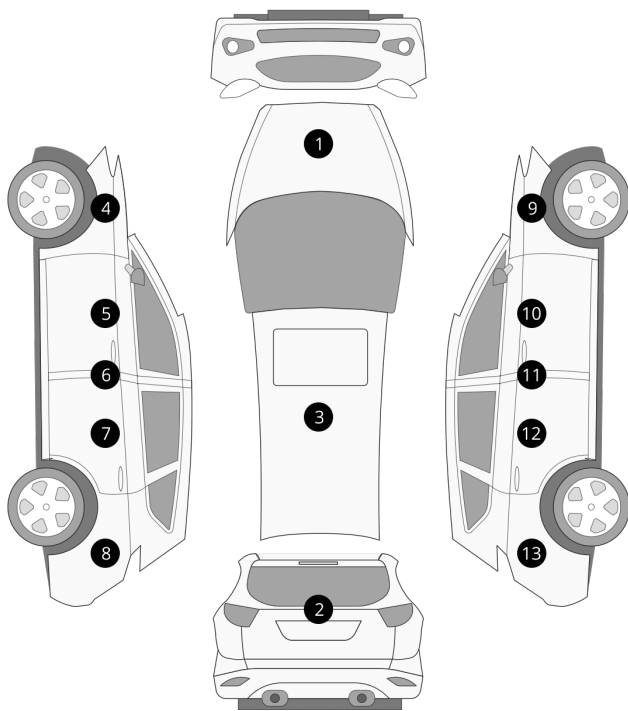


General Information

Date & Time: 11, Jul, 2026 14:43

Make	Toyota	Model	Wigo
YOM	2020	Odo Meter Reading	113,593
Registration No.	NEK1617	Chassis No.	MHKA4DF5FKJ034902
CC	1.0	Transmission	A/T
Fuel Type	Gas	Type of Body	Hatchback
Colour	Red		

Body / Panel Condition



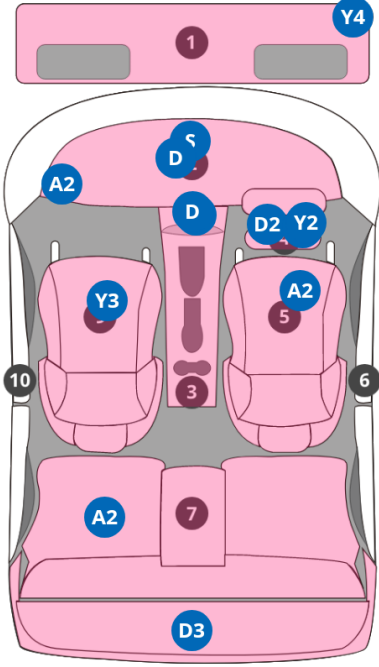
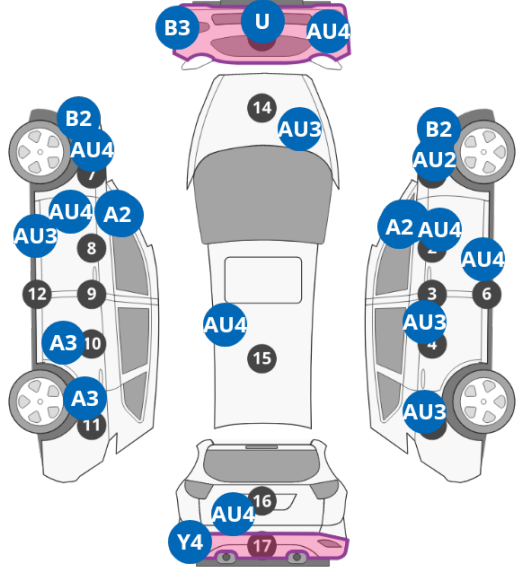
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	88.3	102	85	78
2	Boot Lid	98.7	90	106	100
3	Roof	80.5	70	84	85/83
4	Left Front Fender	315.3	451	244	251
5	Left Front Door	96.3	96	100	94
6	Center Panel Left				
7	Left Rear Door	95.1	91	96	99
8	Left Back Panel	95.4	102	97	87
9	Right Front Fender	99.7	100	105	94
10	Right Front Door	92.6	87	95	95
11	Center Panel Right				
12	Right Rear Door	96.3	96	100	93
13	Right Back Panel	96.0	97	98	93

Overall Evaluation :

D

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : D	Exterior Evaluation : E
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Overall Interior - Smell - Yes / Overall Interior - Worn as per age - Yes / (L) Front Floor Mat - Worked - Small / Carpet - Worked - Large / Console, Switches, Vents - Worn, Scratch, Cut, Crack - Small / Dashboard - Traces of Adhesive Tape - Yes / (L) Front Seat - Grime - Medium / Rear Seat - Cut, Crack - Small / Ceiling - Grime - Large / (R) Front Floor Mat - Grime - Small / Trunk Room - Loose, Deformed - Medium / Dashboard - Worn, Scratch, Cut, Crack - Small / Console, Switches, Vents - Repair Mark - Yes	Remarks (L) Front Fender - Repair Traces - Yes / (R) Front Fender, Molding - Modified - Small / (R) Front Fender, Molding - Scratch & Dent - Small / (R) Mirror - Scratch, Peeled - Yes / (R) Mirror - Faded(Color, Gloss) - Yes / (R) Mirror - Scratch - Small / Overall Exterior - Faded(Color, Gloss) - Yes / Overall Exterior - Worn as per age - Yes / (R) Step, In-panel, Side Spoiler - Scratch & Dent - Large / (R) Rear Door, Molding - Scratch & Dent - Medium / (R) Rear Fender, Molding - Scratch & Dent - Medium / (R) Front Door, Molding - Scratch & Dent - Large / Rear Bumper, Lamps, Panels - Crack, Gap - Large / Rear Bumper, Lamps, Panels - Repair mark - Yes / Trunk Hood, Rear Gate - Scratch & Dent - Large / (L) Rear Fender, Molding - Scratch - Medium / (L) Rear Door, Molding - Scratch - Medium / (L) Front Door, Molding - Scratch & Dent - Large / (L) Step, In-panel, Side Spoiler - Scratch & Dent - Medium / (L) Mirror - Crack - Damaged / (L) Mirror - Faded(Color, Gloss) - Yes / (L) Mirror - Scratch - Small / (L) Front Fender, Molding - Modified - Small / Front Bumper, Grille, Lamps - Modified - Medium / (L) Front Fender, Molding - Scratch & Dent - Large / Front Bumper, Grille, Lamps - Repair mark - Yes / Member (Bolted) - Dent - Yes / Front Bumper, Grille, Lamps - Scratch & Dent - Large / Bonnet, Headlight - Scratch & Dent - Medium / Roof - Scratch & Dent - Large
Frame Evaluation : B	Functional Evaluation : E
Remarks Under Spare Box - Bulge (Cuts, Major Deforms) or Corrosion ? - Yes	Remarks Retractable Mirror - Issue - Yes / Power Window (each) - Stuck, Gap - Yes / Shift Shock - Function - Weak / Radiator Water Pump - Leak - Yes / Reverse Camera - N/A - Yes / Head Light, High Beam - Issue - Yes / Lamps (Brake, Tail, Fog) - Issue - Yes / Horn - Issue - Yes / Seat Belts - Issue - Yes / Spare Key - Issue - Unexist

Inspector Notes

no warranty booklet, jack and tools, with spare tire, with LTO plate, scratches on headlight and tail light, left head light issue, plate light issue, coolant leak marks on reservoir tank, engine hood stand missing, driver's window issue, possible flooding, retractable mirror issue, abnormal noise on engine and rear bumper, passenger grab bar missing, trunk door issue, trunk floor mat/ cover missing,