

General Information

Date & Time: 25, Jun, 2026 07:32

Make	Toyota	Model	Vios
YOM	2021	Odo Meter Reading	67,728
Registration No.	DAV8405	Chassis No.	PA1B18F35M4151599
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Black		

Body / Panel Condition



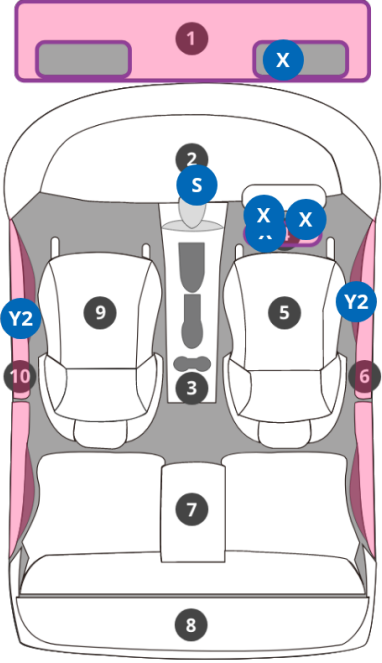
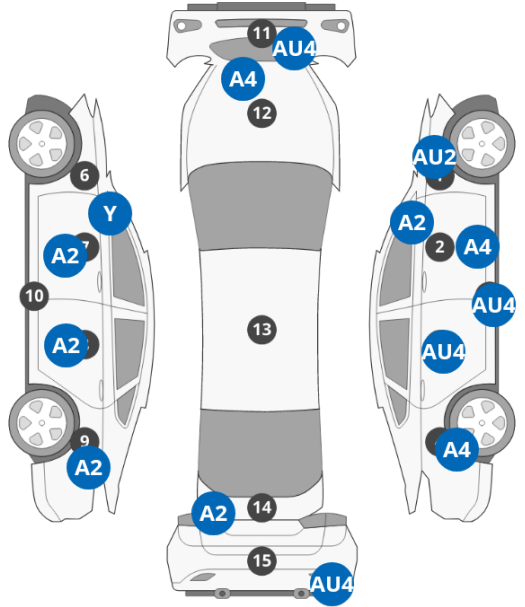
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	107.6	108	104	111
2	Boot Lid	105.3	101	106	109
3	Roof	100.9	112	93	92/107
4	Left Front Fender	93.8	100	96	86
5	Left Front Door	101.6	102	96	107
6	Center Panel Left				
7	Left Rear Door	109.6	116	106	107
8	Left Back Panel	117.3	121	111	120
9	Right Front Fender	93.2	92	93	95
10	Right Front Door	99.1	96	99	103
11	Center Panel Right				
12	Right Rear Door	102.0	99	99	108
13	Right Back Panel	110.6	100	103	129

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : E
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks (R) Front Floor Mat - Missing - Yes / (L) Front Floor Mat - Missing - Yes / Mat Other - Missing - Yes / Overall Interior - Smell - Yes / (L) Front Trim - Grime - Small / (R) Front Trim - Grime - Small / Sunvisor, Sunglass Holder - Missing - Yes	Remarks (R) Front Door, Molding - Scratch - Large / (R) Rear Door, Molding - Scratch & Dent - Large / (R) Rear Fender, Molding - Scratch - Large / Rear Bumper, Lamps, Panels - Scratch & Dent - Large / Trunk Hood, Rear Gate - Scratch - Small / (L) Mirror - Crack - Damaged / (L) Rear Fender, Molding - Scratch - Small / (L) Rear Door, Molding - Scratch - Small / (L) Front Door, Molding - Scratch - Small / Front Bumper, Grille, Lamps - Scratch & Dent - Large / Bonnet, Headlight - Scratch - Large / (R) Mirror - Scratch - Small / (R) Step, In-panel, Side Spoiler - Scratch & Dent - Large / (R) Front Fender, Molding - Scratch & Dent - Small
Frame Evaluation : A	Functional Evaluation : B
Remarks Defects not found	Remarks Retractable Mirror - Issue - Yes / Horn - Issue - Yes / Spare Key - Issue - Unexist

Inspector Notes
no tools and jack, no spare tire and warranty booklet/ worn tires/no LTO plate/ possible flooding/ light scratches around the exterior/ horn issue/ side mirror issue/