

General Information

Date & Time: 25, Jun, 2026 07:36

Make	Toyota	Model	Hilux
YOM	2024	Odo Meter Reading	55,199
Registration No.	CCA6588	Chassis No.	MR00JB8DD3P3550801
CC	2.4	Transmission	A/T
Fuel Type	Gas	Type of Body	Pickup
Colour	Blue		

Body / Panel Condition



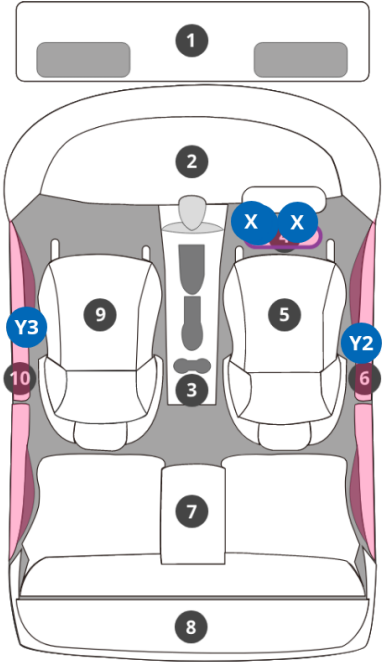
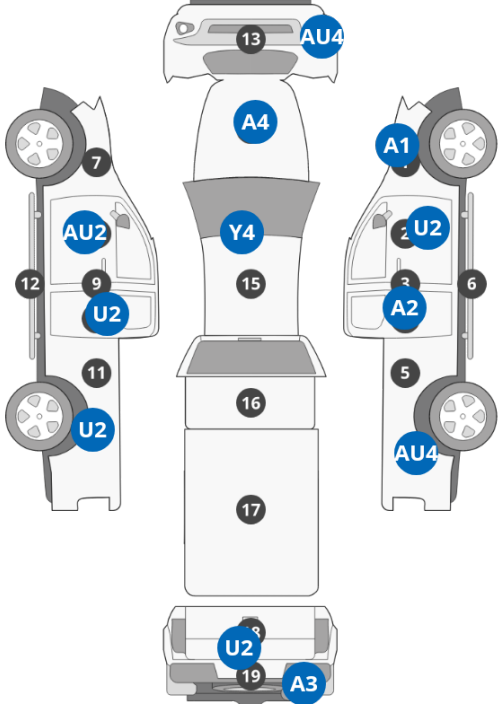
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	121.6	121	121	123
2	Boot Lid	110.3	122	99	110
3	Roof	126.7	125	110	151/121
4	Left Front Fender	113.3	114	115	111
5	Left Front Door	123.3	120	125	125
6	Center Panel Left				
7	Left Rear Door	105.0	110	108	97
8	Left Back Panel	124.6	127	121	126
9	Right Front Fender	115.6	113	116	118
10	Right Front Door	114.0	118	115	109
11	Center Panel Right				
12	Right Rear Door	106.0	102	104	112
13	Right Back Panel	120.3	120	123	118

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : E
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks (L) Front Trim - Grime - Medium / (R) Front Trim - Grime - Small / (R) Front Floor Mat - Missing - Yes / (L) Front Floor Mat - Missing - Yes / Mat Other - Missing - Yes	Remarks (L) Side Gate - Dent - Small / (L) Rear Door, Molding - Dent - Small / (L) Front Door, Molding - Scratch & Dent - Small / Bonnet, Headlight - Scratch - Large / Front Windshield - Damaged - Large / Front Bumper, Grille, Lamps - Scratch & Dent - Large / (R) Front Fender, Molding - Scratch - Minimal / (R) Front Door, Molding - Dent - Small / (R) Rear Door, Molding - Scratch - Small / (R) Side Gate - Scratch & Dent - Large / Rear Bumper, Lamps, Panels - Scratch - Medium / Rear Gate - Dent - Small
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Spare Key - Issue - Unexist

Inspector Notes
no warranty booklet/ no jack and tools/ no spare tire/ light scratches around the exterior/ with LTO Plate/ HPG recovered/