

General Information

Date & Time: 25, Jun, 2026 07:39

Make	Toyota	Model	Vios
YOM	2024	Odo Meter Reading	53,151
Registration No.	NHM8415	Chassis No.	PA1B18F35R4245358
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Blue		

Body / Panel Condition



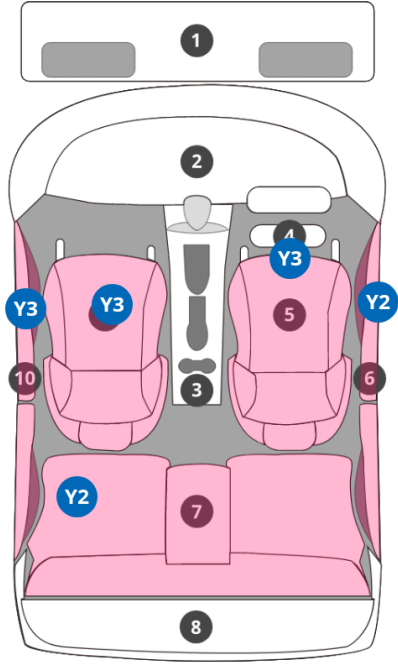
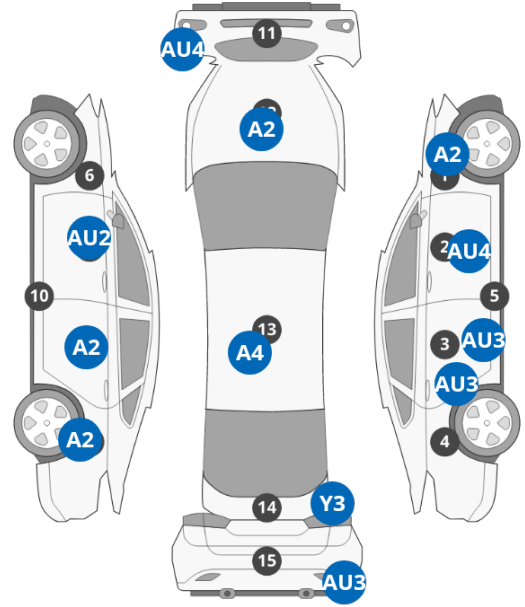
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	108.4	117	99	109
2	Boot Lid	105.3	97	111	108
3	Roof	100.1	101	99	98/103
4	Left Front Fender	94.7	94	94	96
5	Left Front Door	96.3	99	94	96
6	Center Panel Left				
7	Left Rear Door	103.5	108	104	99
8	Left Back Panel	106.3	108	107	104
9	Right Front Fender	97.7	98	98	98
10	Right Front Door	100.2	100	96	105
11	Center Panel Right				
12	Right Rear Door	113.3	108	111	121
13	Right Back Panel	106.6	104	102	114

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : E
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks (L) Front Trim - Grime - Medium / (L) Front Seat - Grime - Medium / Rear Seat - Grime - Small / (R) Front Seat - Grime - Medium / (R) Front Trim - Grime - Small	Remarks (L) Front Door, Molding - Scratch & Dent - Small / Front Bumper, Grille, Lamps - Scratch & Dent - Large / Bonnet, Headlight - Scratch - Small / (R) Front Fender, Molding - Scratch - Small / (R) Front Door, Molding - Scratch & Dent - Large / (R) Rear Fender, Molding - Scratch & Dent - Medium / (R) Rear Door, Molding - Scratch & Dent - Medium / Rear Bumper, Lamps, Panels - Scratch & Dent - Medium / Trunk Hood, Rear Gate - Crack, Gap - Medium / Roof - Scratch - Large / (L) Rear Door, Molding - Scratch - Small / (L) Rear Fender, Molding - Scratch - Small
Frame Evaluation : A	Functional Evaluation : D
Remarks Defects not found	Remarks Warning Lamps - Issue - Yes / Air Conditioner - Function - Weak / Battery - Weak - Yes / Reverse Camera - N/A - Yes / Lamps (Brake, Tail, Fog) - Issue - Yes / Horn - Issue - Yes / Spare Key - Issue - Unexist

Inspector Notes

light scratches around the exterior/traction control indicator on/ airbag warning light on/ ABS warning light on/ air-conditioning issue/ possible flooding/ no jack and tools/ no warranty booklet/ no spare tire and LTO plate/ plate light issue/ HPG recovered/