

General Information

Date & Time: 25, Feb, 2025 10:39

Make	Toyota	Model	Vios
YOM	2024	Mileage	4,509
Registration No.	DBN4720	Chassis No.	PA1B18F32P4232127
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Black		

Body / Panel Condition



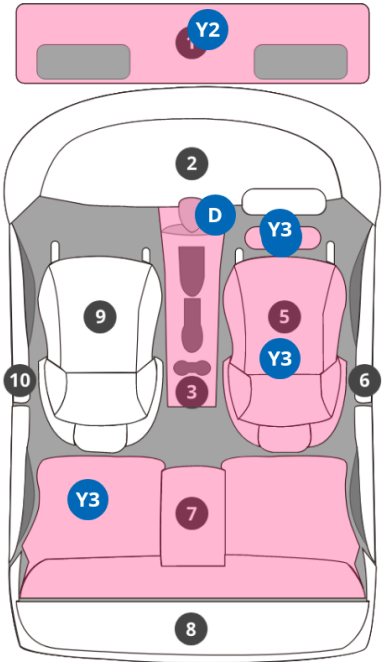
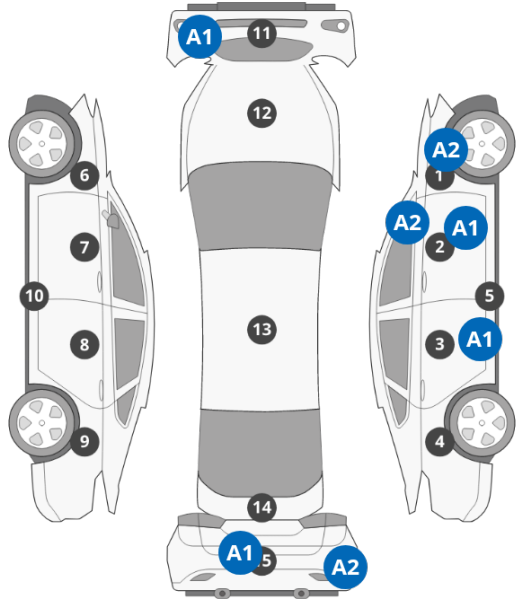
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	114.3	109	112	122
2	Boot Lid	105.3	101	106	109
3	Roof	110.0	116	102	110/112
4	Left Front Fender	100.0	97	100	104
5	Left Front Door	100.0	100	95	105
6	Center Panel Left				
7	Left Rear Door	105.5	112	113	92
8	Left Back Panel	105.6	117	100	100
9	Right Front Fender	107.0	107	104	110
10	Right Front Door	101.6	108	97	100
11	Center Panel Right				
12	Right Rear Door	105.2	97	99	120
13	Right Back Panel	111.3	104	103	127

Overall Evaluation :

B

Disclaimer

This Grading Report is intended to record the general appearance and condition of the interior, exterior & frame of the vehicle. This is not a detailed inspection report. This is issued on the date and time given herein and the company shall not be liable for the condition of the vehicle after this date and time. Any disputes regarding this report shall not be grounds for arbitration.

Interior Evaluation : C	Exterior Evaluation : B
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Mat Other - Grime - Medium / Rear Seat - Grime - Medium / (R) Front Seat - Grime - Medium / (L) Front Floor Mat - Grime - Medium / Ceiling - Grime - Small / Console, Switchs, Vents - Traces of Adhesive Tape - Yes	Remarks (R) Front Fender, Molding - Scratch - Small / (R) Mirror - Scratch - Small / (R) Front Door, Molding - Scratch - Minimal / (R) Rear Door, Molding - Scratch - Minimal / Rear Bumper, Lamps, Panels - Scratch - Small / Trunk Hood, Rear Gate - Scratch - Minimal / Front Bumper, Grille, Lamps - Scratch - Minimal
Frame Evaluation : A	Functional Evaluation : B
Remarks Defects not found	Remarks Retractable Mirror - Issue - Yes / Reverse Camera - N/A - Yes

Inspector Notes
no warranty booklet, with jack, no tools, no spare tire, with LTO plate, retractable mirror issue, no reverse camera