

General Information

Date & Time: 24, Jun, 2026 16:33

Make	Toyota	Model	Vios
YOM	2022	Odo Meter Reading	61,896
Registration No.	CBD9499	Chassis No.	PA1B18F3XN4187354
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Black		

Body / Panel Condition



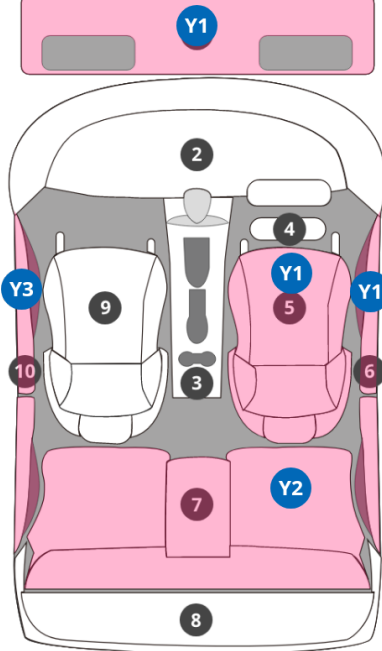
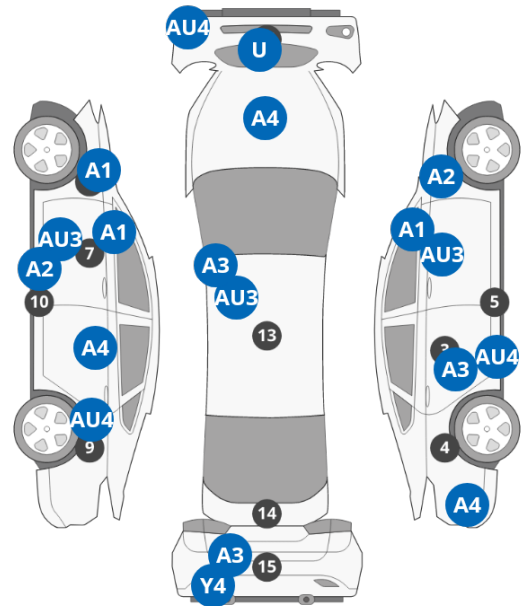
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	106.6	114	102	104
2	Boot Lid	111.6	118	101	116
3	Roof	96.8	106	93	94/94
4	Left Front Fender	108.6	108	110	108
5	Left Front Door	109.3	111	108	109
6	Center Panel Left				
7	Left Rear Door	107.6	107	106	110
8	Left Back Panel	112.6	119	111	108
9	Right Front Fender	106.0	106	108	104
10	Right Front Door	102.0	100	103	103
11	Center Panel Right				
12	Right Rear Door	108.6	104	102	120
13	Right Back Panel	108.6	104	104	118

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : E
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Rear Seat - Grime - Small / (R) Front Trim - Grime - Minimal / (R) Front Seat - Grime - Minimal / (L) Front Trim - Grime - Medium / Ceiling - Grime - Minimal	Remarks (R) Front Fender, Molding - Scratch - Small / (R) Mirror - Scratch - Minimal / (R) Front Door, Molding - Scratch & Dent - Medium / (R) Step, In-panel, Side Spoiler - Scratch & Dent - Large / (R) Rear Door, Molding - Scratch - Medium / (R) Rear Fender, Molding - Scratch - Large / Rear Bumper, Lamps, Panels - Crack, Gap - Large / Trunk Hood, Rear Gate - Scratch - Medium / (L) Rear Fender, Molding - Scratch & Dent - Large / (L) Rear Door, Molding - Scratch - Large / (L) Front Door, Molding - Scratch & Dent - Medium / (L) Step, In-panel, Side Spoiler - Scratch - Small / (L) Mirror - Scratch - Minimal / Roof - Scratch & Dent - Medium / Roof Spoiler, Molding - Scratch - Medium / (L) Front Fender, Molding - Scratch - Minimal / Front Bumper, Grille, Lamps - Scratch & Dent - Large / Bonnet, Headlight - Scratch - Large / Member (Bolted) - Dent - Yes
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Reverse Camera - N/A - Yes / Spare Key - Issue - Unexist

Inspector Notes

With Lto plate, with jack, 1key, no spare tire and warranty booklet and tools, scratches on headlights and taillights, visible hairlines scratches on vehicle,