

General Information

Date & Time: 24, Jun, 2026 16:35

Make	Toyota	Model	Vios
YOM	2022	Odo Meter Reading	69,163
Registration No.	NFH1442	Chassis No.	PA1B18F37M4165715
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Green		

Body / Panel Condition



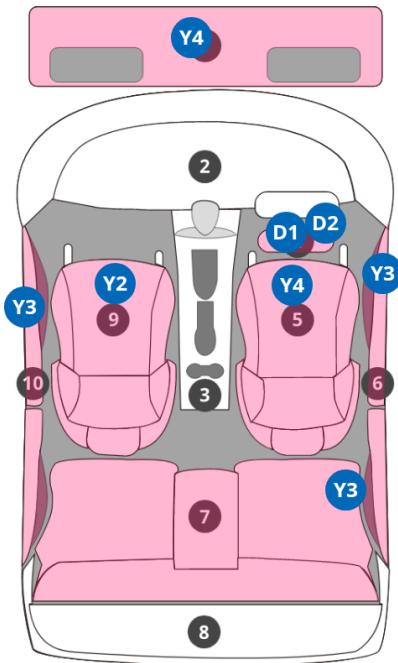
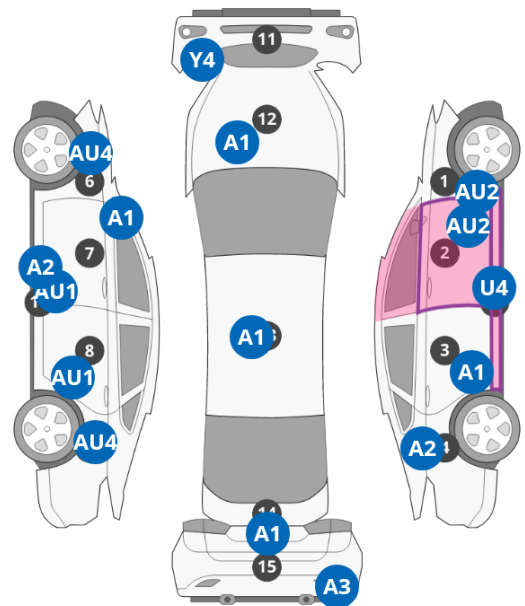
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	109.6	112	106	111
2	Boot Lid	114.3	117	110	116
3	Roof	95.2	106	86	97/93
4	Left Front Fender	259.6	324	229	226
5	Left Front Door	104.0	102	100	110
6	Center Panel Left				
7	Left Rear Door	104.0	107	103	102
8	Left Back Panel	119.0	114	104	139
9	Right Front Fender	142.6	151	148	129
10	Right Front Door	387.6	638	330	195
11	Center Panel Right				
12	Right Rear Door	293.6	204	217	460
13	Right Back Panel	192.3	183	160	234

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : E
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Ceiling - Grime - Large / (R) Front Seat - Grime - Large / (R) Front Trim - Grime - Medium / Rear Seat - Grime - Medium / (L) Front Trim - Grime - Medium / (L) Front Floor Mat - Worked - Small / Carpet - Worked - Minimal / (L) Front Seat - Grime - Small	Remarks (R) Front Door - Repair Traces - Yes / (R) Step - Repair Traces - Yes / Bonnet - Repair Traces - Yes / (L) Front Fender - Repair Traces - Yes / (L) Front Door - Repair Traces - Yes / (L) Rear Door - Repair Traces - Yes / (L) Rear Fender - Repair Traces - Yes / Trunk Hood, Rear Gate - Repair Traces - Yes / (R) Rear Fender - Repair Traces - Yes / (R) Rear Door - Repair Traces - Yes / Roof - Repair Traces - Yes / Overall Exterior - Full Re-Paint in same color - Yes / (R) Front Fender, Molding - Scratch & Dent - Small / (R) Front Door, Molding - Repair mark - Yes / (R) Step, In-panel, Side Spoiler - Dent - Large / (R) Rear Door, Molding - Scratch - Minimal / (R) Rear Fender, Molding - Scratch - Small / Trunk Hood, Rear Gate - Scratch - Minimal / Rear Bumper, Lamps, Panels - Scratch - Medium / (L) Rear Fender, Molding - Scratch & Dent - Large / (L) Rear Door, Molding - Scratch & Dent - Minimal / (L) Front Door, Molding - Scratch & Dent - Minimal / (L) Step, In-panel, Side Spoiler - Scratch - Small / (L) Mirror - Scratch - Minimal / (L) Front Fender, Molding - Scratch & Dent - Large / Front Bumper, Grille, Lamps - Crack, Gap - Large / Bonnet, Headlight - Scratch - Minimal / Roof - Scratch - Minimal
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Reverse Camera - N/A - Yes / Spare Key - Issue - Unexist

Inspector Notes

With Lto plate, with spare tire and jack and tools, 1key, no warranty booklet, scratches on headlights and taillights, worn rear tires,