

General Information

Date & Time: 25, Jun, 2026 07:34

Make	Toyota	Model	Hiace
YOM	2016	Odo Meter Reading	109,716
Registration No.	NDQ7872	Chassis No.	JTFJT02P0G0002404
CC	3.0	Transmission	M/T
Fuel Type	Diesel	Type of Body	Van
Colour	White		

Body / Panel Condition



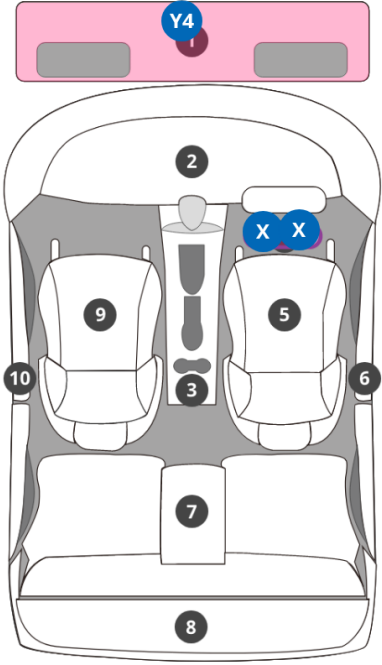
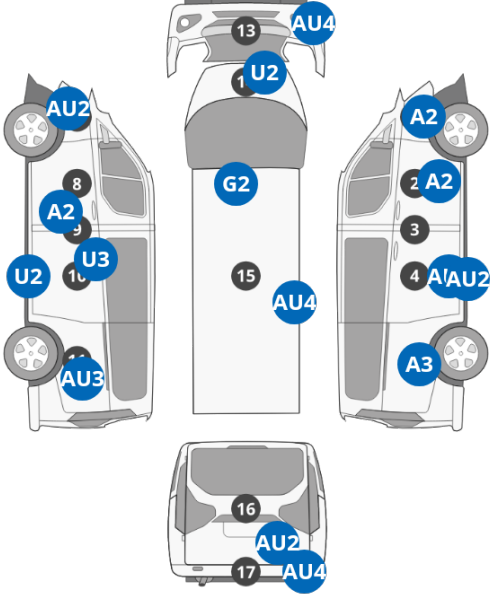
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	120.3	116	129	116
2	Boot Lid	127.3	134	128	120
3	Roof	75.2	65	73	75/88
4	Left Front Fender	95.0	85	83	117
5	Left Front Door	71.0	70	73	71
6	Center Panel Left				
7	Left Rear Door				
8	Left Back Panel	77.3	75	86	71
9	Right Front Fender	75.7	75	74	79
10	Right Front Door	72.7	76	77	65
11	Center Panel Right	80.3	85	84	72
12	Right Rear Door	77.4	79	75	79
13	Right Back Panel	91.1	71	123	79

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : E
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks (L) Front Floor Mat - Missing - Yes / (R) Front Floor Mat - Missing - Yes / Ceiling - Grime - Large / Overall Interior - Worn as per age - Yes	Remarks (L) Front Fender, Molding - Scratch & Dent - Small / (L) Step, In-panel, Side Spoiler - Dent - Small / (L) Front Door, Molding - Scratch - Small / (L) Rear Fender, Molding - Scratch & Dent - Medium / (L) Rear Door, Molding - Dent - Medium / Rear Bumper, Lamps, Panels - Scratch & Dent - Large / Trunk Hood, Rear Gate - Scratch & Dent - Small / (R) Rear Fender, Molding - Scratch - Medium / (R) Rear Door, Molding - Scratch & Dent - Large / (R) Step, In-panel, Side Spoiler - Scratch & Dent - Small / Front Bumper, Grille, Lamps - Scratch & Dent - Large / (R) Front Door, Molding - Scratch - Small / (R) Front Fender, Molding - Scratch - Small / Roof - Scratch & Dent - Large / Bonnet, Headlight - Dent - Small / Front Windshield - Scratch, Stone chip - Small
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Reverse Camera - N/A - Yes / Spare Key - Issue - Unexist

Inspector Notes
no warranty booklet/ no jack and tools/ light scratches around the exterior/ back door issue/ with LTO Plate and spare tire/