

General Information

Date & Time: 25, Jun, 2026 07:38

Make	Toyota	Model	Hilux Tamaraw
YOM	2025	Odo Meter Reading	21,132
Registration No.	CCD8218	Chassis No.	PAHACACA1S6427490
CC	2.4	Transmission	M/T
Fuel Type	Diesel	Type of Body	Commercial Vehicles
Colour	White		

Body / Panel Condition



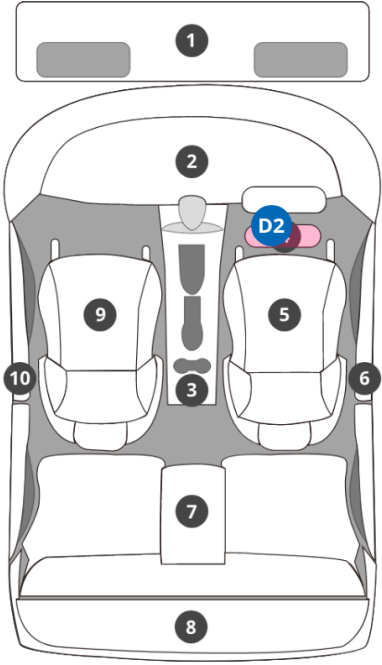
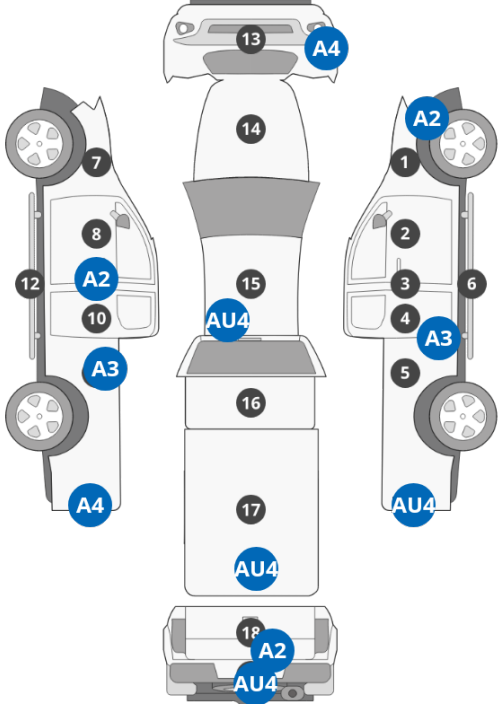
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	100.3	102	103	96
2	Boot Lid	51.1	50	49	55
3	Roof	101.8	125	121	55/106
4	Left Front Fender	104.3	99	104	110
5	Left Front Door	101.8	99	106	101
6	Center Panel Left				
7	Left Rear Door				
8	Left Back Panel	60.2	58	61	62
9	Right Front Fender	104.3	104	108	101
10	Right Front Door	105.6	101	106	110
11	Center Panel Right				
12	Right Rear Door				
13	Right Back Panel	58.4	56	58	62

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : A	Exterior Evaluation : E
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks (L) Front Floor Mat - Worked - Small	Remarks (R) Guard Frame - Scratch & Dent - Large / (R) Side Gate - Scratch - Medium / Rear Bumper, Lamps, Panels - Scratch & Dent - Large / Cargo Bed Floor - Scratch & Dent - Large / Rear Gate - Scratch - Small / (L) Side Gate - Scratch - Medium / Roof - Scratch & Dent - Large / (L) Guard Frame - Scratch - Large / (L) Front Door, Molding - Scratch - Small / Front Bumper, Grille, Lamps - Scratch - Large / (R) Front Fender, Molding - Scratch - Small
Frame Evaluation : A	Functional Evaluation : C
Remarks Defects not found	Remarks Warning Lamps - Issue - Yes

Inspector Notes

with maintenance warning light/ check engine light on/ possible flooding/ light scratches around the exterior/ no spare tire and jack/ no tools / with warranty booklet/ with LTO Plate/