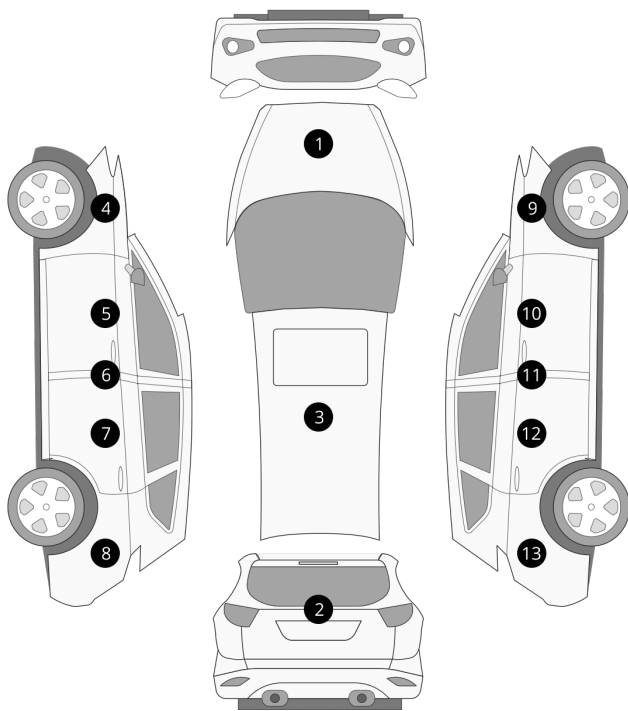


General Information

Date & Time: 25, Jun, 2026 07:35

Make	Honda	Model	City
YOM	2017	Odo Meter Reading	67,286
Registration No.	NAV9116	Chassis No.	PADGM66200HV308547
CC	1.5	Transmission	A/T
Fuel Type	Gas	Type of Body	Sedan
Colour	White		

Body / Panel Condition



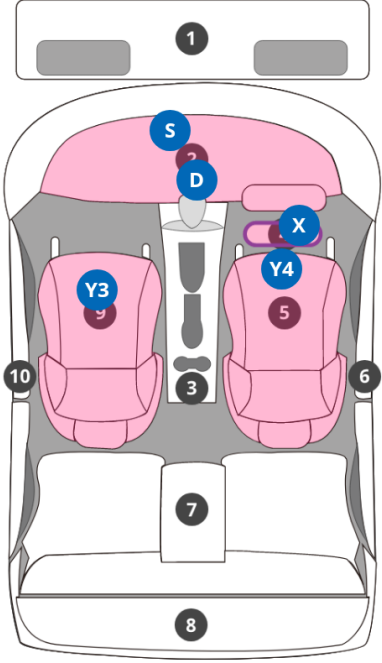
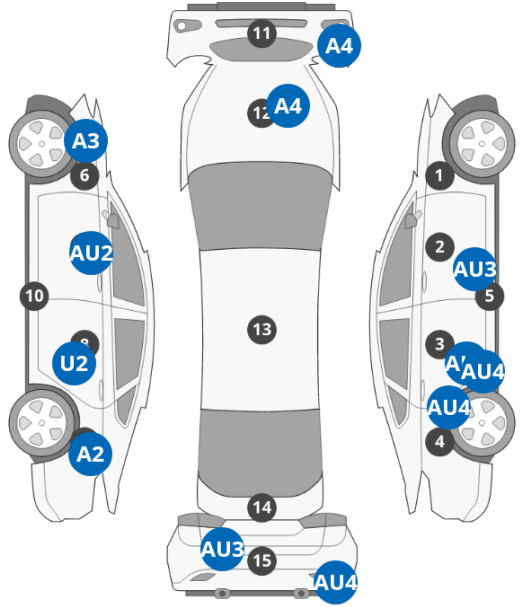
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	85.8	80	78	100
2	Boot Lid	113.8	95	89	158
3	Roof	174.5	178	179	152/189
4	Left Front Fender	121.0	135	135	93
5	Left Front Door	86.4	88	79	93
6	Center Panel Left				
7	Left Rear Door	207.3	207	198	217
8	Left Back Panel	526.3	1,145	187	247
9	Right Front Fender	90.3	100	87	85
10	Right Front Door	104.0	106	95	111
11	Center Panel Right				
12	Right Rear Door	139.3	120	130	168
13	Right Back Panel	127.6	131	121	131

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : E
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Overall Interior - Smell - Yes / Overall Interior - Worn as per age - Yes / (R) Front Seat - Grime - Large / (L) Front Seat - Grime - Medium / Dashboard - Traces of Adhesive Tape - Yes / Mat Other - Missing - Yes	Remarks (R) Front Door - Repair Traces - Yes / (R) Step - Repair Traces - Yes / (R) Front Fender - Repair Traces - Yes / Bonnet - Repair Traces - Yes / (L) Front Fender - Repair Traces - Yes / (L) Front Door - Repair Traces - Yes / (L) Step - Repair Traces - Yes / (L) Rear Door - Repair Traces - Yes / (L) Rear Fender - Repair Traces - Yes / Trunk Hood, Rear Gate - Repair Traces - Yes / (R) Rear Door - Repair Traces - Yes / Roof - Repair Traces - Yes / (R) Front Door, Molding - Scratch & Dent - Medium / (R) Rear Door, Molding - Scratch & Dent - Large / (R) Rear Fender, Molding - Scratch & Dent - Large / (R) Step, In-panel, Side Spoiler - Scratch & Dent - Large / Rear Bumper, Lamps, Panels - Scratch & Dent - Large / Trunk Hood, Rear Gate - Scratch & Dent - Medium / (L) Rear Fender, Molding - Scratch - Small / (L) Rear Door, Molding - Dent - Small / (L) Front Door, Molding - Scratch & Dent - Small / (L) Front Fender, Molding - Scratch - Medium / Front Bumper, Grille, Lamps - Scratch - Large / Bonnet, Headlight - Scratch - Large
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Spare Key - Issue - Unexist

Inspector Notes
no jack and tools/ light scratches around the exterior/ possible flooding/ with LTO Plate and warranty booklet/ with Spare tire/