

General Information

Date & Time: 24, Jun, 2026 16:29

Make	Ford	Model	Everest
YOM	2018	Odo Meter Reading	98,044
Registration No.	NDL3602	Chassis No.	MNCAXXMAWAJT32857
CC	2.2	Transmission	A/T
Fuel Type	Diesel	Type of Body	SUV
Colour	Black		

Body / Panel Condition



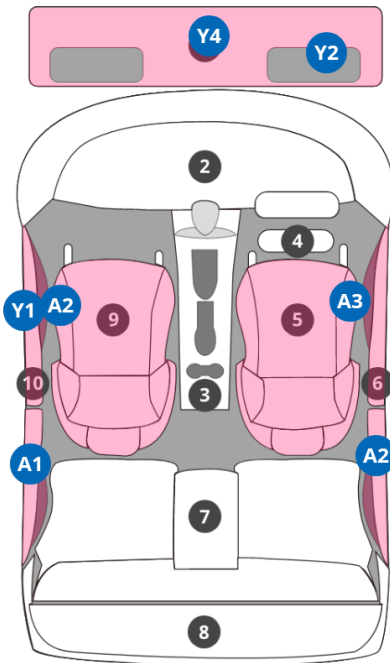
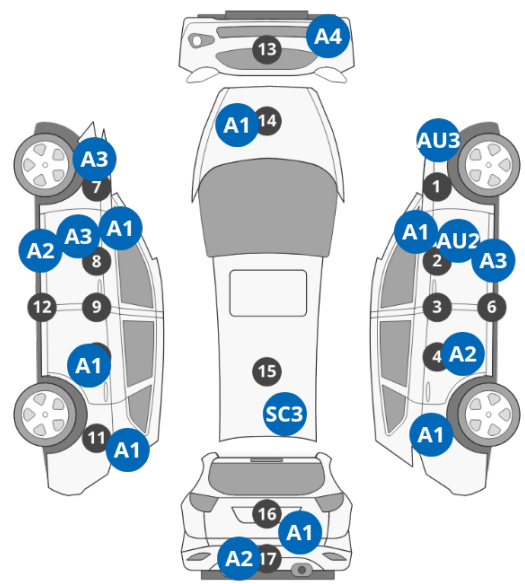
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	104.3	106	102	105
2	Boot Lid	114.0	105	125	112
3	Roof	105.2	108	100	105/108
4	Left Front Fender	108.3	105	106	114
5	Left Front Door	109.6	116	103	110
6	Center Panel Left				
7	Left Rear Door	104.3	110	100	103
8	Left Back Panel	115.0	123	114	108
9	Right Front Fender	109.3	113	107	108
10	Right Front Door	109.6	114	105	110
11	Center Panel Right				
12	Right Rear Door	106.0	104	101	113
13	Right Back Panel	112.3	109	118	110

Overall Evaluation :

D

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : E
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Ceiling - Grime - Large / (R) Rear Trim - Cut, Crack - Small / (R) Front Seat - Cut, Crack - Medium / Sunvisor, Sunglass Holder - Grime - Small / (L) Front Trim - Grime - Minimal / (L) Front Seat - Cut, Crack - Small / (L) Rear Trim - Cut, Crack - Minimal	Remarks (R) Front Fender, Molding - Scratch & Dent - Medium / (R) Mirror - Scratch - Minimal / (R) Front Door, Molding - Scratch & Dent - Small / (R) Step, In-panel, Side Spoiler - Scratch - Medium / (R) Rear Door, Molding - Scratch - Small / (R) Rear Fender, Molding - Scratch - Minimal / Trunk Hood, Rear Gate - Scratch - Minimal / (L) Rear Fender, Molding - Scratch - Minimal / Roof - Rust, Corrosion - Medium / (L) Front Door, Molding - Scratch - Medium / (L) Front Fender, Molding - Scratch - Medium / Front Bumper, Grille, Lamps - Scratch - Large / Rear Bumper, Lamps, Panels - Scratch - Small / (L) Rear Door, Molding - Scratch - Minimal / Bonnet, Headlight - Scratch - Minimal / (L) Mirror - Scratch - Minimal / (L) Step, In-panel, Side Spoiler - Scratch - Small
Frame Evaluation : A	Functional Evaluation : C
Remarks Defects not found	Remarks Warning Lamps - Issue - Yes / Reverse Camera - N/A - Yes / Spare Key - Issue - Unexist

Inspector Notes
With Lto plate, with spare tire, 1key, no warranty booklet and tools and Jack, scratches on headlights and taillights, Abnormal noise on engine, check engine warning lamp on