

General Information

Date & Time: 24, Jun, 2026 16:28

Make	Mitsubishi	Model	Mirage
YOM	2024	Odo Meter Reading	36,370
Registration No.	NKE4781	Chassis No.	PAEA13TJRRRA029852
CC	1.2	Transmission	A/T
Fuel Type	Gas	Type of Body	Sedan
Colour	Silver		

Body / Panel Condition



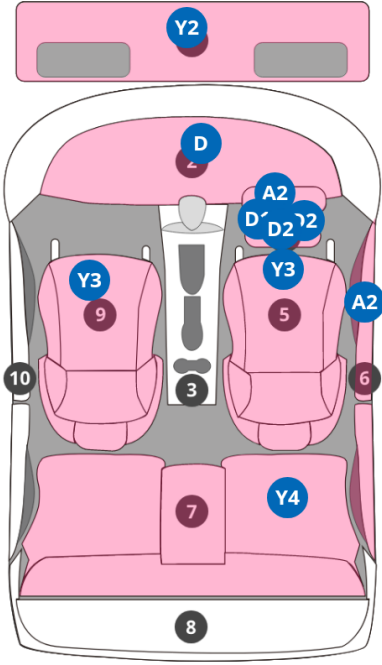
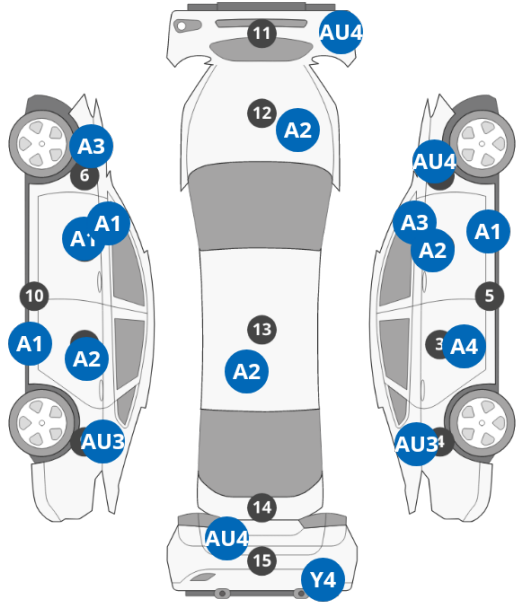
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	125.6	126	120	131
2	Boot Lid	110.0	103	124	103
3	Roof	103.2	99	107	101/106
4	Left Front Fender	107.3	103	109	110
5	Left Front Door	109.0	108	109	110
6	Center Panel Left				
7	Left Rear Door	105.6	109	107	101
8	Left Back Panel	110.6	114	108	110
9	Right Front Fender	104.3	101	104	108
10	Right Front Door	113.0	111	113	115
11	Center Panel Right				
12	Right Rear Door	110.6	107	108	117
13	Right Back Panel	104.2	105	100	108

Overall Evaluation :

D

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : E
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Ceiling - Grime - Small / Rear Seat - Grime - Large / (R) Front Seat - Grime - Medium / Dashboard - Traces of Adhesive Tape - Yes / (R) Front Floor Mat - Worked - Small / (R) Front Trim - Cut, Crack - Small / Glove Box - Worn, Scratch, Cut, Crack - Small / Mat Other - Grime - Small / (L) Front Seat - Grime - Medium / Carpet - Worked - Minimal / (L) Front Floor Mat - Worked - Small	Remarks (R) Front Fender, Molding - Scratch & Dent - Large / (R) Mirror - Scratch - Medium / (R) Front Door, Molding - Scratch - Small / (R) Rear Door, Molding - Scratch - Large / (R) Front Door, Molding - Scratch & Dent - Medium / (R) Step, In-panel, Side Spoiler - Scratch - Minimal / Rear Bumper, Lamps, Panels - Crack, Gap - Large / Trunk Hood, Rear Gate - Scratch & Dent - Large / (L) Rear Fender, Molding - Scratch & Dent - Medium / (L) Rear Door, Molding - Scratch - Small / (L) Step, In-panel, Side Spoiler - Scratch - Minimal / (L) Front Door, Molding - Scratch - Minimal / (L) Mirror - Scratch - Minimal / (L) Front Fender, Molding - Scratch - Medium / Front Bumper, Grille, Lamps - Scratch & Dent - Large / Bonnet, Headlight - Scratch - Small / Roof - Scratch - Small
Frame Evaluation : B	Functional Evaluation : A
Remarks Rear Side Member & Trunk Room Floor - Traces of Bending, or Marks of Panel Repair ? - Yes	Remarks Reverse Camera - N/A - Yes / Spare Key - Issue - Unexist

Inspector Notes
With Lto plate, with spare tire and jack, 1key, no warranty booklet and tools, scratches on headlights, Crack taillight, latch trunk door issue