

General Information

Date & Time: 25, Jun, 2026 12:56

Make	Toyota	Model	Fortuner
YOM	2014	Odo Meter Reading	146,766
Registration No.	APA2749	Chassis No.	MHFZR69G603101658
CC	2.4	Transmission	A/T
Fuel Type	Diesel	Type of Body	SUV
Colour	Pearl White		

Body / Panel Condition



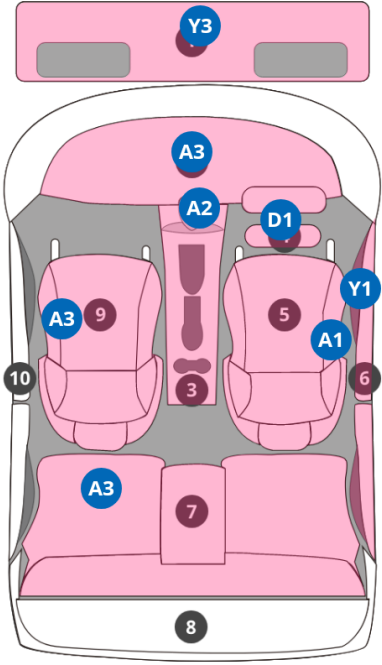
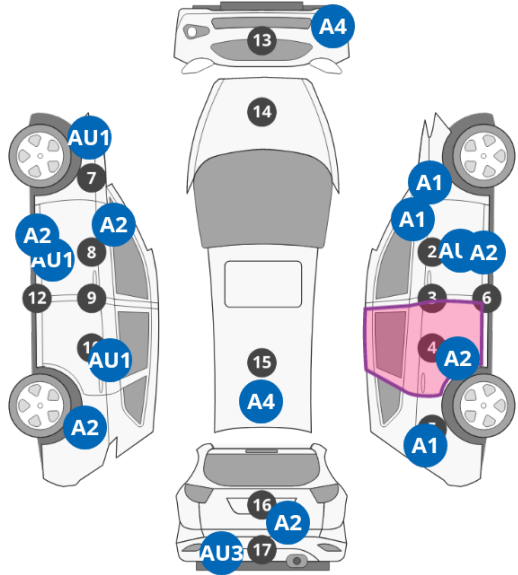
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	111.3	109	113	112
2	Boot Lid	232.0	144	158	394
3	Roof	106.7	94	95	117/121
4	Left Front Fender	104.0	105	107	100
5	Left Front Door	107.0	90	115	116
6	Center Panel Left				
7	Left Rear Door	114.3	109	120	114
8	Left Back Panel	147.6	140	158	145
9	Right Front Fender	106.8	116	107	98
10	Right Front Door	116.3	105	130	114
11	Center Panel Right				
12	Right Rear Door	229.6	209	252	228
13	Right Back Panel	148.3	154	148	143

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : E
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Ceiling - Grime - Medium / Rear Seat - Cut, Crack - Medium / (R) Front Trim - Grime - Minimal / (R) Front Seat - Cut, Crack - Minimal / (L) Front Seat - Cut, Crack - Medium / Console, Switchs, Vents - Worn, Scratch, Cut, Crack - Small / Carpet - Worked - Minimal / Steering Wheel - Worn, Peel, Crack - Medium	Remarks Trunk Hood, Rear Gate - Repair Traces - Yes / (R) Rear Door - Repair Traces - Yes / (R) Front Fender, Molding - Scratch - Minimal / (R) Mirror - Scratch - Minimal / (R) Front Door, Molding - Scratch & Dent - Large / (R) Step, In-panel, Side Spoiler - Scratch - Small / (R) Rear Door, Molding - Repair mark - Difference in Color / (R) Rear Door, Molding - Scratch - Small / Roof Spoiler, Molding - Scratch - Large / (R) Rear Fender, Molding - Scratch - Minimal / Rear Bumper, Lamps, Panels - Scratch & Dent - Medium / Trunk Hood, Rear Gate - Scratch - Small / (L) Rear Fender, Molding - Scratch - Small / (L) Rear Door, Molding - Scratch & Dent - Minimal / (L) Front Door, Molding - Scratch & Dent - Minimal / (L) Step, In-panel, Side Spoiler - Scratch - Small / (L) Mirror - Scratch - Small / (L) Front Fender, Molding - Scratch & Dent - Minimal / Front Bumper, Grille, Lamps - Scratch - Large
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Horn - Issue - Yes / Spare Key - Issue - Unexist

Inspector Notes

With Lto plate, with spare tire, 1key, no warranty booklet and tools and Jack, scratches on headlights and taillights, plate light issue, issue on radio button on steering wheel,