

General Information

Date & Time: 24, Jun, 2026 16:37

Make	Toyota	Model	Vios
YOM	2023	Odo Meter Reading	63,939
Registration No.	BAF5073	Chassis No.	PA1B18F37P4224862
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Red Mica Metallic		

Body / Panel Condition



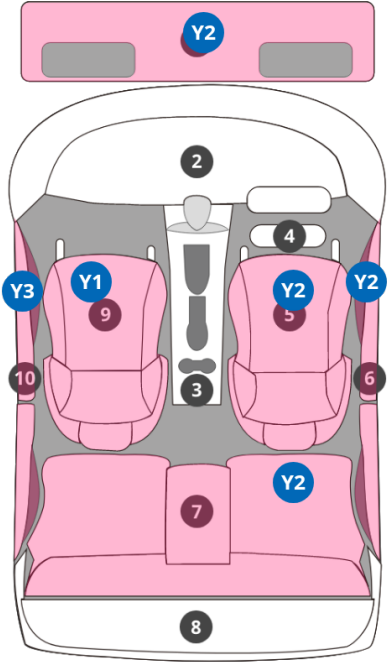
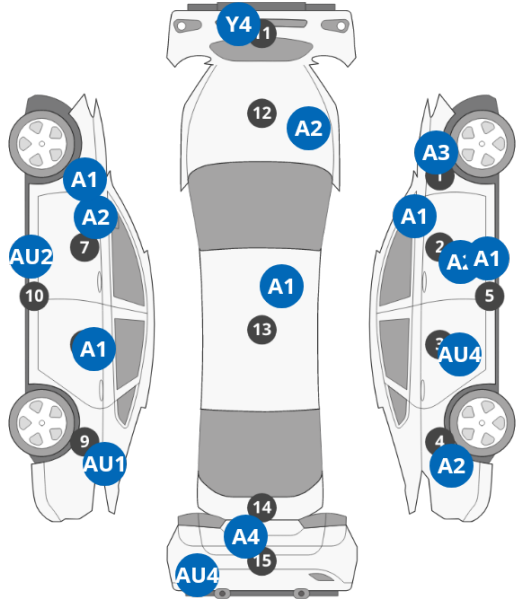
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	110.6	121	103	108
2	Boot Lid	122.3	125	137	105
3	Roof	102.4	105	95	106/104
4	Left Front Fender	106.0	106	106	106
5	Left Front Door	102.1	98	101	107
6	Center Panel Left				
7	Left Rear Door	109.3	122	101	105
8	Left Back Panel	120.0	124	120	116
9	Right Front Fender	110.6	112	115	105
10	Right Front Door	102.3	106	100	101
11	Center Panel Right				
12	Right Rear Door	109.6	104	107	118
13	Right Back Panel	108.0	103	115	106

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : E
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Ceiling - Grime - Small / Rear Seat - Grime - Small / (R) Front Trim - Grime - Small / (R) Front Seat - Grime - Small / (L) Front Trim - Grime - Medium / (L) Front Seat - Grime - Minimal	Remarks (R) Front Fender, Molding - Scratch - Medium / (R) Mirror - Scratch - Minimal / (R) Front Door, Molding - Scratch - Small / (R) Step, In-panel, Side Spoiler - Scratch - Minimal / (R) Rear Door, Molding - Scratch & Dent - Large / (R) Rear Fender, Molding - Scratch - Small / Rear Bumper, Lamps, Panels - Scratch & Dent - Large / Trunk Hood, Rear Gate - Scratch - Large / (L) Rear Fender, Molding - Scratch & Dent - Minimal / (L) Front Door, Molding - Scratch - Small / (L) Front Fender, Molding - Scratch - Minimal / Front Bumper, Grille, Lamps - Crack, Gap - Large / Bonnet, Headlight - Scratch - Small / (L) Step, In-panel, Side Spoiler - Scratch & Dent - Small / (L) Rear Door, Molding - Scratch - Minimal / Roof - Scratch - Minimal
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Spare Key - Issue - Unexist

Inspector Notes
With Lto plate, with spare tire and jack and tools, 1key, no warranty booklet, scratches on headlights and taillights, worn tires,