

General Information

Date & Time: 24, Jun, 2026 20:19

Make	Toyota	Model	Vios
YOM	2022	Odo Meter Reading	10,147
Registration No.	CAX4414	Chassis No.	PA1B18F32N4171858
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Green		

Body / Panel Condition



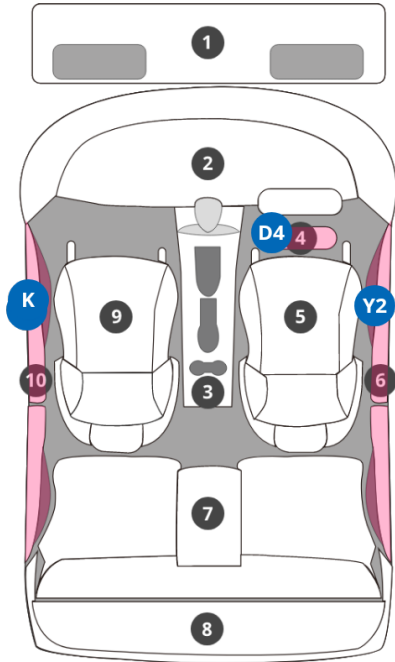
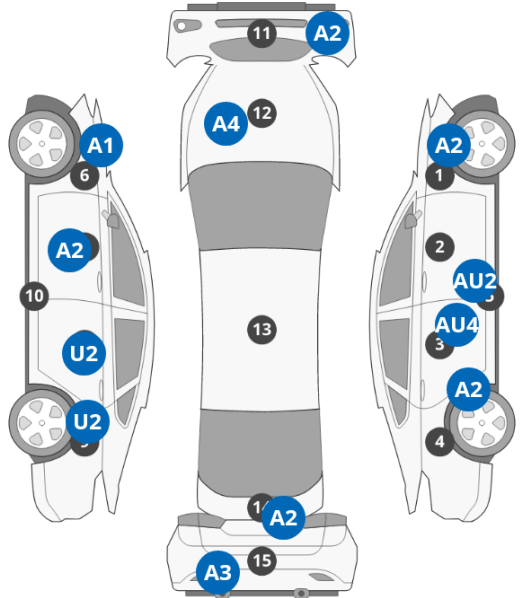
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	118.0	114	116	124
2	Boot Lid	115.0	111	114	120
3	Roof	106.1	119	103	98/105
4	Left Front Fender	99.4	98	103	98
5	Left Front Door	110.6	111	112	109
6	Center Panel Left				
7	Left Rear Door	113.3	114	113	113
8	Left Back Panel	116.6	126	114	110
9	Right Front Fender	101.9	106	98	102
10	Right Front Door	108.0	106	102	116
11	Center Panel Right				
12	Right Rear Door	111.3	109	112	113
13	Right Back Panel	113.0	111	106	122

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : D
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks (L) Front Trim - Grime - Medium / (R) Front Trim - Grime - Small / Overall Interior - Animal Hair - Yes / (L) Front Floor Mat - Worked - Large	Remarks (R) Rear Door, Molding - Scratch & Dent - Large / (R) Front Door, Molding - Scratch & Dent - Small / (R) Rear Fender, Molding - Scratch - Small / (L) Rear Fender, Molding - Dent - Small / (L) Rear Door, Molding - Dent - Small / Rear Bumper, Lamps, Panels - Scratch - Medium / Bonnet, Headlight - Scratch - Large / Overall Exterior - Faded(Color, Gloss) - Yes / Front Bumper, Grille, Lamps - Scratch - Small / (R) Front Fender, Molding - Scratch - Small / Trunk Hood, Rear Gate - Scratch - Small / (L) Front Door, Molding - Scratch - Small / (L) Front Fender, Molding - Scratch - Minimal
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Reverse Camera - N/A - Yes / Spare Key - Issue - Unexist

Inspector Notes

possible flooding/ windshield issue/no warranty booklet and Incomplete tools/ light scratches around the exterior/ with LTO Plate and spare tire/