

General Information

Date & Time: 23, Jun, 2026 14:32

Make	Toyota	Model	Vios
YOM	2025	Odo Meter Reading	24,814
Registration No.	NHS5642	Chassis No.	PA1B18F32R4264725
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Red		

Body / Panel Condition



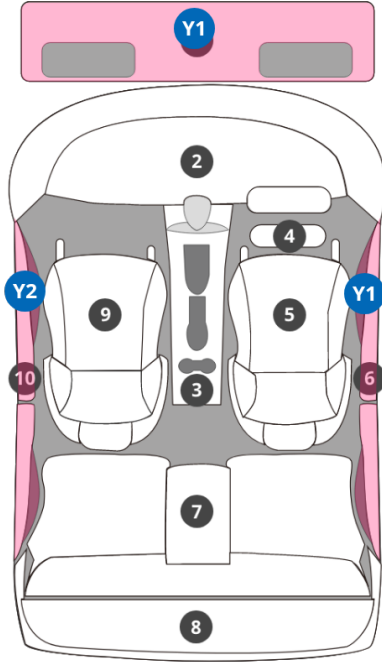
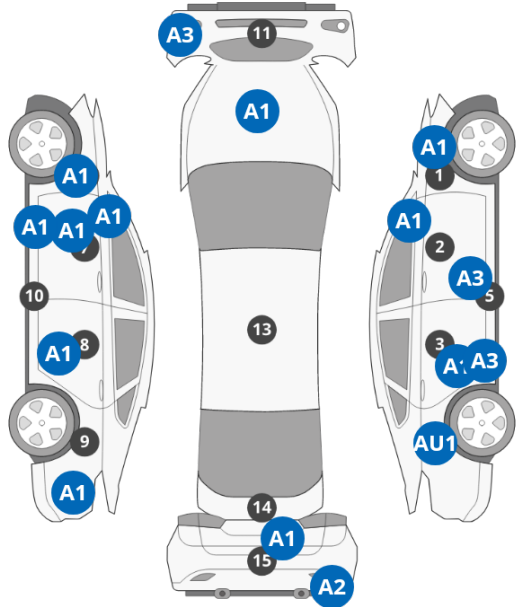
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	120.6	127	117	118
2	Boot Lid	119.6	120	114	125
3	Roof	103.8	109	103	105/98
4	Left Front Fender	108.6	107	106	113
5	Left Front Door	117.0	111	115	125
6	Center Panel Left				
7	Left Rear Door	114.0	120	114	108
8	Left Back Panel	120.6	124	124	114
9	Right Front Fender	106.0	106	104	108
10	Right Front Door	110.0	108	115	107
11	Center Panel Right				
12	Right Rear Door	115.0	115	114	116
13	Right Back Panel	116.0	109	107	132

Overall Evaluation :

A

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : A	Exterior Evaluation : C
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Ceiling - Grime - Minimal / (R) Front Trim - Grime - Minimal / (L) Front Trim - Grime - Small	Remarks (R) Front Fender, Molding - Scratch - Minimal / (R) Mirror - Scratch - Minimal / (R) Front Door, Molding - Scratch - Medium / (R) Rear Door, Molding - Scratch - Minimal / (R) Step, In-panel, Side Spoiler - Scratch - Medium / (R) Rear Fender, Molding - Scratch & Dent - Minimal / Rear Bumper, Lamps, Panels - Scratch - Small / Trunk Hood, Rear Gate - Scratch - Minimal / (L) Rear Fender, Molding - Scratch - Minimal / (L) Rear Door, Molding - Scratch - Minimal / (L) Front Door, Molding - Scratch - Minimal / (L) Step, In-panel, Side Spoiler - Scratch - Minimal / (L) Mirror - Scratch - Minimal / (L) Front Fender, Molding - Scratch - Minimal / Front Bumper, Grille, Lamps - Scratch - Medium / Bonnet, Headlight - Scratch - Minimal
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Spare Key - Issue - Unexist

Inspector Notes

With Lto plate, with spare tire and tools and Jack, 1key, no warranty booklet, scratches on headlights and taillights, plate light issue, left fender light issue