

General Information

Date & Time: 10, Jul, 2026 08:50

Make	Toyota	Model	Vios
YOM	2023	Odo Meter Reading	46,458
Registration No.	EAI8900	Chassis No.	PA1B18F35P4221302
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Green		

Body / Panel Condition



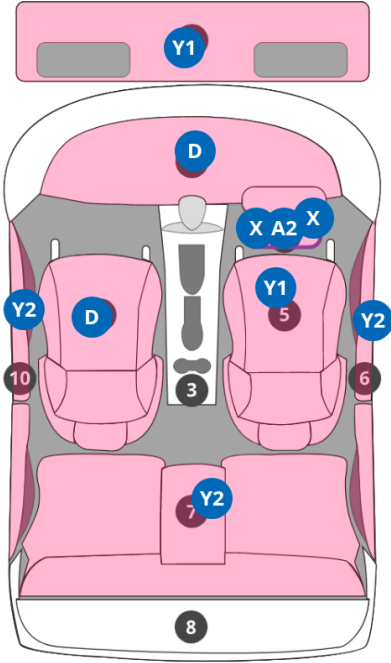
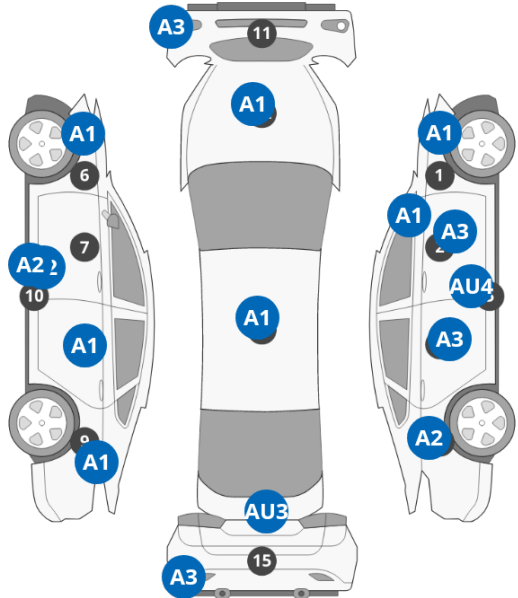
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	107.3	100	110	112
2	Boot Lid	116.3	114	119	116
3	Roof	99.3	100	98	100/100
4	Left Front Fender	105.6	104	109	104
5	Left Front Door	106.6	111	106	103
6	Center Panel Left				
7	Left Rear Door	111.3	114	109	111
8	Left Back Panel	114.0	117	110	115
9	Right Front Fender	101.6	100	101	104
10	Right Front Door	109.6	114	108	107
11	Center Panel Right				
12	Right Rear Door	111.6	109	106	120
13	Right Back Panel	116.0	109	112	127

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : D
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Rear Seat - Grime - Small / (R) Front Trim - Grime - Small / (R) Front Seat - Grime - Minimal / (R) Front Floor Mat - Missing - Yes / (L) Front Floor Mat - Missing - Yes / (L) Front Trim - Grime - Small / (L) Front Seat - Worn - Yes / Ceiling - Grime - Minimal / Dashboard - Traces of Adhesive Tape - Yes / Carpet - Worn, Scratch, Cut, Crack - Small	Remarks (L) Front Fender, Molding - Scratch - Minimal / (L) Front Door, Molding - Scratch - Small / (L) Step, In-panel, Side Spoiler - Scratch - Small / (L) Rear Door, Molding - Scratch - Minimal / (L) Rear Fender, Molding - Scratch - Minimal / Rear Bumper, Lamps, Panels - Scratch - Medium / Trunk Hood, Rear Gate - Scratch & Dent - Medium / (R) Rear Fender, Molding - Scratch - Small / (R) Rear Door, Molding - Scratch - Medium / (R) Step, In-panel, Side Spoiler - Scratch & Dent - Large / (R) Front Door, Molding - Scratch - Medium / (R) Mirror - Scratch - Minimal / (R) Front Fender, Molding - Scratch - Minimal / Bonnet, Headlight - Scratch - Minimal / Front Bumper, Grille, Lamps - Scratch - Medium / Roof - Scratch - Minimal
Frame Evaluation : A	Functional Evaluation : B
Remarks Defects not found	Remarks Battery - Weak - Yes

Inspector Notes

with LTO plate/no warranty booklet/with incomplete tools with jack/with spare tire/with spare key/gap on trunk door/hairline scratches on the body/worn tires