

General Information

Date & Time: 08, Jul, 2026 14:26

Make	Toyota	Model	Wigo
YOM	2023	Odo Meter Reading	103,165
Registration No.	NHJ2103	Chassis No.	MHKA4DF5FPJ080225
CC	1.0	Transmission	A/T
Fuel Type	Gas	Type of Body	Hatchback
Colour	Silver		

Body / Panel Condition



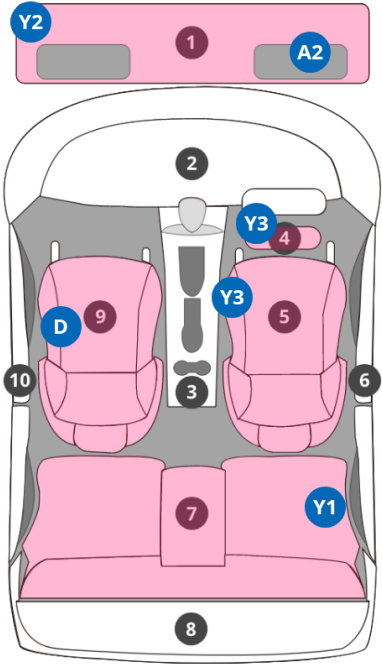
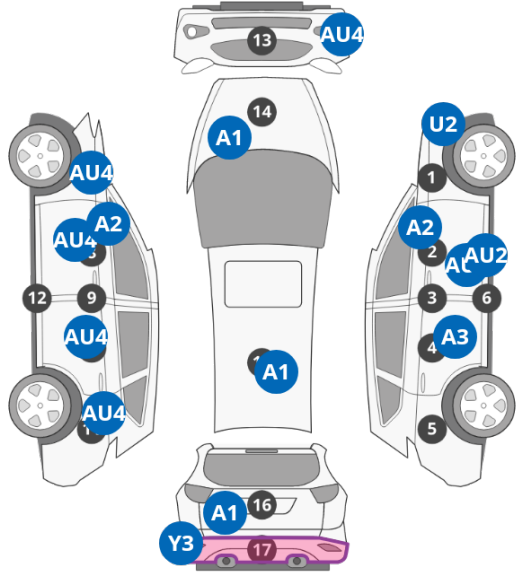
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	91.1	91	94	89
2	Boot Lid	108.2	98	128	99
3	Roof	92.2	87	94	102/85
4	Left Front Fender	105.1	98	111	106
5	Left Front Door	106.3	105	102	112
6	Center Panel Left				
7	Left Rear Door	100.8	102	101	99
8	Left Back Panel	104.3	100	109	104
9	Right Front Fender	99.6	99	102	98
10	Right Front Door	92.5	89	93	97
11	Center Panel Right				
12	Right Rear Door	94.3	103	95	85
13	Right Back Panel	94.6	94	96	93

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : E
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks (L) Front Floor Mat - Grime - Medium / (R) Front Seat - Grime - Medium / (L) Front Seat - Worn - Yes / Overall Interior - Worn as per age - Yes / Ceiling - Grime - Small / Rear Seat - Grime - Minimal / Sunvisor, Sunglass Holder - Cut, Crack - Small	Remarks (R) Front Fender, Molding - Dent - Small / (R) Mirror - Scratch - Small / (R) Front Door, Molding - Scratch & Dent - Medium / Rear Bumper, Lamps, Panels - Repair mark - Yes / (R) Rear Door, Molding - Scratch - Medium / (R) Step, In-panel, Side Spoiler - Scratch & Dent - Small / Rear Bumper, Lamps, Panels - Crack, Gap - Medium / Trunk Hood, Rear Gate - Scratch - Minimal / (L) Rear Fender, Molding - Scratch & Dent - Large / (L) Rear Door, Molding - Scratch & Dent - Large / (L) Front Door, Molding - Scratch & Dent - Large / (L) Front Fender, Molding - Scratch & Dent - Large / (L) Mirror - Scratch - Small / Front Bumper, Grille, Lamps - Scratch & Dent - Large / Bonnet, Headlight - Scratch - Minimal / Roof - Scratch - Minimal
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Remote Key & Smart entry - Issue - Yes / Lamps (Brake, Tail, Fog) - Issue - Yes / Spare Key - Issue - Unexist

Inspector Notes
with warranty booklet, no jack and tools, with spare tire, with LTO plate, scratches on tail light, fog lamp issue, front right support grab bar missing