

General Information

Date & Time: 26, Jun, 2026 16:56

Make	Toyota	Model	Wigo
YOM	2024	Odo Meter Reading	49,022
Registration No.	GBE6603	Chassis No.	MHKAA1BC4RJ022403
CC	1.0	Transmission	CVT
Fuel Type	Gas	Type of Body	Hatchback
Colour	Gray		

Body / Panel Condition



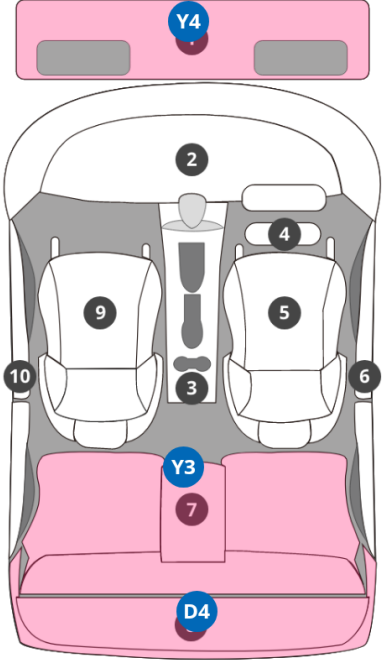
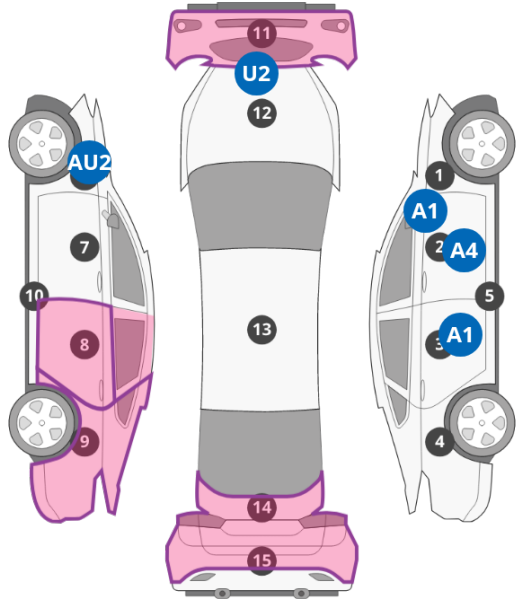
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	94.3	97	96	91
2	Boot Lid	419.0	122	144	991
3	Roof	71.0	72	67	75/71
4	Left Front Fender	83.0	73	92	85
5	Left Front Door	99.0	93	98	106
6	Center Panel Left				
7	Left Rear Door	95.7	107	97	83
8	Left Back Panel	251.3	189	267	298
9	Right Front Fender	71.5	73	73	69
10	Right Front Door	71.3	73	75	65
11	Center Panel Right				
12	Right Rear Door	86.2	80	85	93
13	Right Back Panel	77.3	87	68	77

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : C
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Ceiling - Grime - Large / Rear Seat - Grime - Medium / Trunk Room - Worked - Large	Remarks (R) Front Door - Repair Traces - Yes / Bonnet - Repair Traces - Yes / (L) Rear Fender - Repair Traces - Yes / Trunk Hood, Rear Gate - Repair Traces - Yes / Roof - Repair Traces - Yes / (R) Mirror - Scratch, Peeled - Minimal / (R) Rear Door, Molding - Scratch - Minimal / (R) Front Door, Molding - Scratch - Large / Trunk Hood, Rear Gate - Repair mark - Yes / (L) Rear Fender, Molding - Repair mark - Yes / (L) Rear Door, Molding - Repair mark - Yes / (L) Front Fender, Molding - Scratch & Dent - Small / Bonnet, Headlight - Dent - Small / Front Bumper, Grille, Lamps - Repair mark - Difference in Color
Frame Evaluation : A	Functional Evaluation : B
Remarks Defects not found	Remarks Battery - Weak - Yes

Inspector Notes

with lto plate, with warranty booklet, with spare tire, no jack, no tools, hairlike scratch in the body, weak battery