

General Information

Date & Time: 25, Jun, 2026 17:09

Make	Toyota	Model	Vios
YOM	2025	Odo Meter Reading	4,968
Registration No.	FAT3133	Chassis No.	PA1B18F38S4286993
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Blackish Red Mica		

Body / Panel Condition



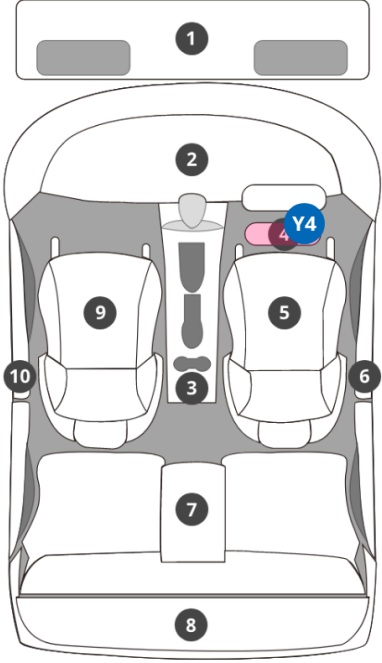
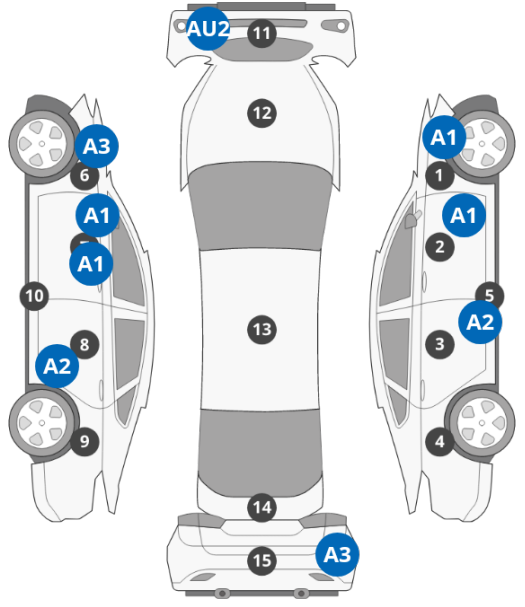
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	102.0	103	108	95
2	Boot Lid	101.6	101	98	106
3	Roof	91.3	93	89	82/102
4	Left Front Fender	91.5	87	95	93
5	Left Front Door	85.4	87	82	87
6	Center Panel Left				
7	Left Rear Door	87.7	96	85	83
8	Left Back Panel	102.1	105	103	98
9	Right Front Fender	90.0	87	92	91
10	Right Front Door	87.9	90	85	88
11	Center Panel Right				
12	Right Rear Door	98.1	86	99	109
13	Right Back Panel	89.3	89	92	87

Overall Evaluation :

B

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : B
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Mat Other - Grime - Large	Remarks (R) Front Door, Molding - Scratch - Minimal / (R) Front Fender, Molding - Scratch - Minimal / (R) Rear Door, Molding - Scratch - Small / Trunk Hood, Rear Gate - Scratch - Medium / (L) Rear Door, Molding - Scratch - Small / (L) Front Door, Molding - Scratch - Minimal / (L) Front Fender, Molding - Scratch - Medium / Front Bumper, Grille, Lamps - Scratch & Dent - Small / (L) Mirror - Scratch - Minimal
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Spare Key - Issue - Unexist

Inspector Notes

with Ito plate, no warranty booklet, with spare tire, with jack, with tools, with hairline scratches in the body