

General Information

Date & Time: 25, Jun, 2026 17:03

Make	Toyota	Model	Hilux Tamaraw
YOM	2025	Odo Meter Reading	20,236
Registration No.	FAT7940	Chassis No.	PAHACACAXS6424944
CC	2.4	Transmission	M/T
Fuel Type	Diesel	Type of Body	Utility Passenger
Colour	White		

Body / Panel Condition



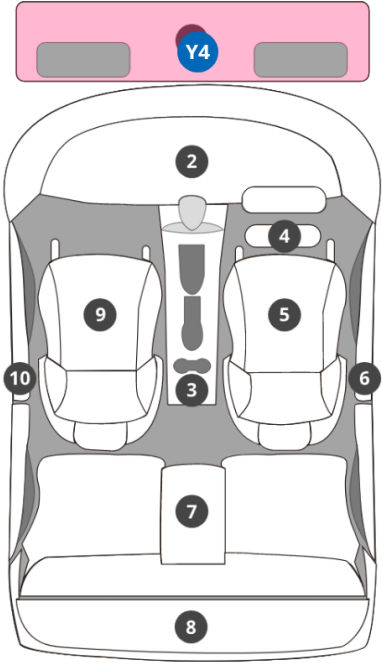
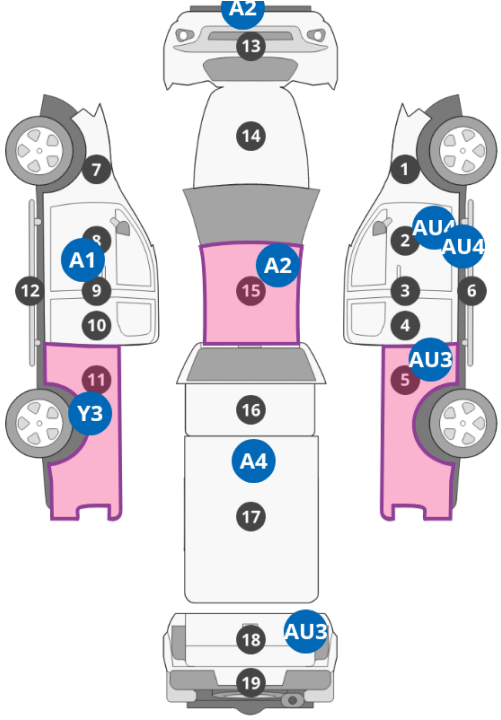
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	88.9	86	91	90
2	Boot Lid	59.2	61	62	55
3	Roof	109.3	105	99	135/99
4	Left Front Fender	90.0	93	92	86
5	Left Front Door	88.3	87	89	88
6	Center Panel Left				
7	Left Rear Door				
8	Left Back Panel	66.7	61	78	61
9	Right Front Fender	90.7	91	94	87
10	Right Front Door	92.2	93	94	90
11	Center Panel Right				
12	Right Rear Door				
13	Right Back Panel	66.6	60	78	62

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : E
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Ceiling - Grime - Large	Remarks (R) Front Door, Molding - Scratch & Dent - Large / (R) Step, In-panel, Side Spoiler - Scratch & Dent - Large / (R) Guard Frame - Repair mark - Yes / (R) Guard Frame - Scratch & Dent - Medium / Rear Gate - Scratch & Dent - Medium / (L) Guard Frame - Crack, Gap - Medium / (L) Guard Frame - Repair mark - Yes / (L) Front Door, Molding - Scratch - Minimal / Front Bumper, Grille, Lamps - Scratch - Small / Roof - Scratch - Small / Roof - Repair mark - Yes / Cargo Bed Floor - Scratch - Large
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Defects not found

Inspector Notes
with Ito plate, with warranty booklet, with jack, with tools, with spare tire,