

General Information

Date & Time: 29, Jun, 2026 11:34

Make	Toyota	Model	Vios
YOM	2025	Odo Meter Reading	13,088
Registration No.	GBB3413	Chassis No.	PA1B18F39S4291684
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Silver		

Body / Panel Condition



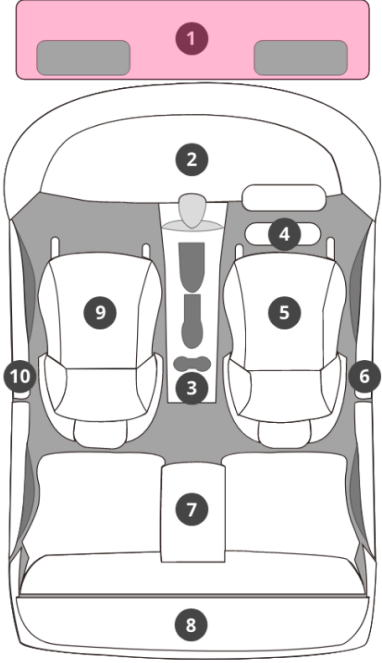
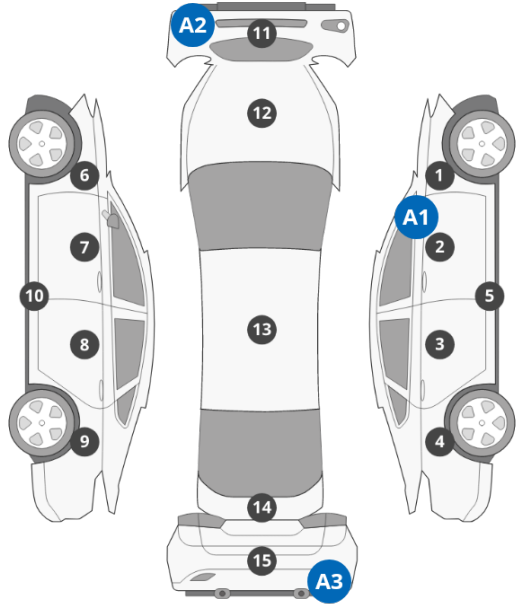
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	94.7	92	93	100
2	Boot Lid	97.3	100	95	97
3	Roof	87.1	95	87	86/81
4	Left Front Fender	88.5	88	88	89
5	Left Front Door	87.4	86	86	90
6	Center Panel Left				
7	Left Rear Door	118.6	115	111	130
8	Left Back Panel	147.6	187	147	109
9	Right Front Fender	93.8	91	94	96
10	Right Front Door	87.8	88	89	87
11	Center Panel Right				
12	Right Rear Door	93.4	90	90	100
13	Right Back Panel	96.3	95	96	97

Overall Evaluation :

A

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : A	Exterior Evaluation : B
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Defects not found	Remarks (L) Rear Fender - Repair Traces - Yes / (R) Mirror - Scratch, Peeled - Minimal / Rear Bumper, Lamps, Panels - Scratch - Medium / Front Bumper, Grille, Lamps - Scratch - Small
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Spare Key - Issue - Unexist

Inspector Notes
no lto plate, with warranty booklet, with spare tire, no jack , no tools, with hairline scratch in the body