

General Information

Date & Time: 25, Feb, 2025 17:44

Make	Toyota	Model	Vios
YOM	2024	Mileage	8,350
Registration No.	NHR6887	Chassis No.	PA1B18F30P4232045
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Green		

Body / Panel Condition



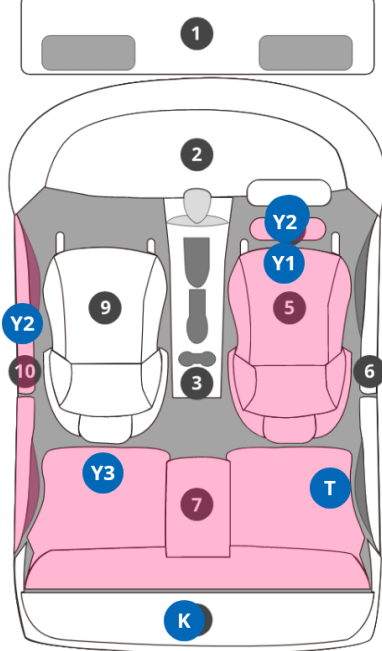
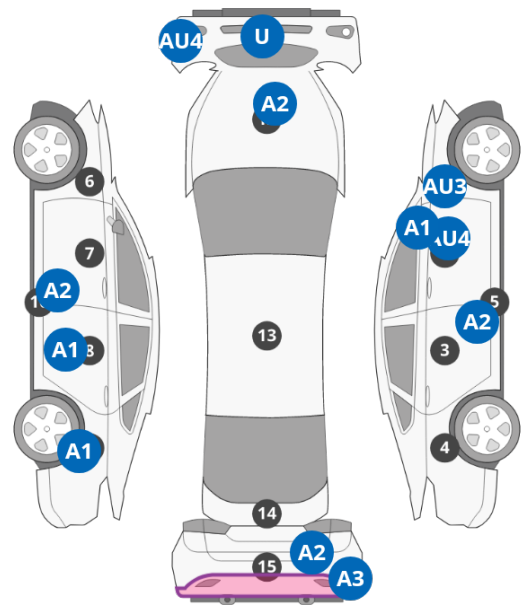
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	160.0	161	151	168
2	Boot Lid	111.9	98	104	134
3	Roof	99.2	100	99	97/101
4	Left Front Fender	88.3	95	86	84
5	Left Front Door	89.3	87	94	87
6	Center Panel Left				
7	Left Rear Door	97.1	97	99	95
8	Left Back Panel	104.2	109	106	98
9	Right Front Fender	224.3	113	286	274
10	Right Front Door	163.3	160	166	164
11	Center Panel Right				
12	Right Rear Door	180.3	167	148	226
13	Right Back Panel	226.6	227	207	246

Overall Evaluation :

C

Disclaimer

This Grading Report is intended to record the general appearance and condition of the interior, exterior & frame of the vehicle. This is not a detailed inspection report. This is issued on the date and time given herein and the company shall not be liable for the condition of the vehicle after this date and time. Any disputes regarding this report shall not be grounds for arbitration.

Interior Evaluation : C	Exterior Evaluation : D
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Overall Interior - Animal Hair - Yes / Rear Seat - Cigarette Burns - Burnt, Hole / Rear Seat - Grime - Medium / (R) Front Seat - Grime - Minimal / (L) Front Trim - Grime - Small / (L) Front Floor Mat - Worked - Small / Mat Other - Grime - Medium / (R) Front Floor Mat - Grime - Small	Remarks (R) Front Door - Repair Traces - Yes / (R) Front Fender - Repair Traces - Yes / Bonnet - Repair Traces - Yes / (R) Rear Fender - Repair Traces - Yes / (R) Rear Door - Repair Traces - Yes / (R) Front Fender, Molding - Scratch & Dent - Medium / (R) Front Door, Molding - Scratch & Dent - Large / (R) Rear Door, Molding - Scratch - Small / Trunk Hood, Rear Gate - Scratch - Small / Rear Bumper, Lamps, Panels - Repair mark - Yes / Rear Bumper, Lamps, Panels - Scratch - Medium / (L) Front Door, Molding - Scratch - Small / (L) Rear Door, Molding - Scratch - Minimal / Front Bumper, Grille, Lamps - Scratch & Dent - Large / (R) Mirror - Scratch - Minimal / (L) Rear Fender, Molding - Scratch - Minimal / Member (Bolted) - Dent - Yes / Bonnet, Headlight - Scratch - Small
Frame Evaluation : A	Functional Evaluation : B
Remarks Defects not found	Remarks Battery - Weak - Yes / Reverse Camera - N/A - Yes / Spare Key - Issue - Unexist

Inspector Notes
no warranty booklet, with jack and tools, with spare tire, with LTO plate, weak battery, no reverse camera