

## General Information

Date & Time: 11, Jul, 2026 08:17

|                  |         |                   |                   |
|------------------|---------|-------------------|-------------------|
| Make             | Toyota  | Model             | Vios              |
| YOM              | 2022    | Odo Meter Reading | 169,528           |
| Registration No. | NFE6794 | Chassis No.       | PA1B18F39N4187474 |
| CC               | 1.3     | Transmission      | CVT               |
| Fuel Type        | Gas     | Type of Body      | Sedan             |
| Colour           | Red     |                   |                   |

## Body / Panel Condition



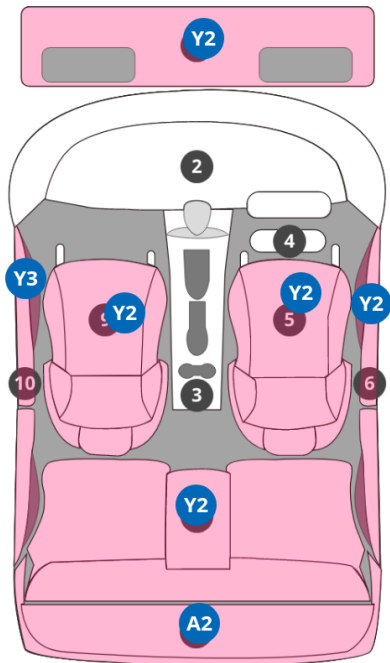
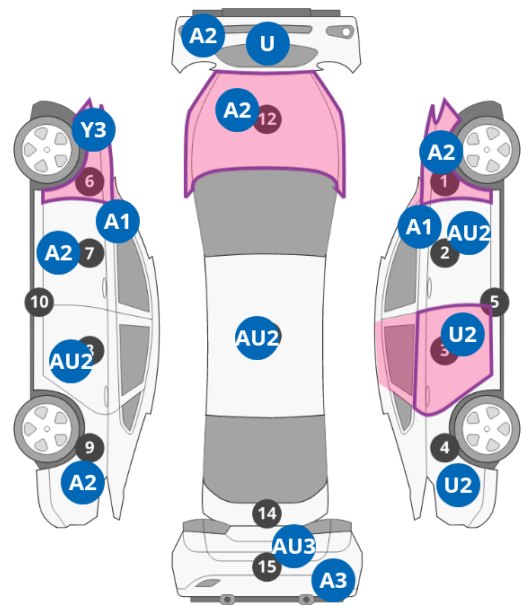
| #  | Area               | Thickness(um) |        |        |          |
|----|--------------------|---------------|--------|--------|----------|
|    |                    | Average       | Value1 | Value2 | Value3/4 |
| 1  | Bonnet             | 401.6         | 291    | 612    | 302      |
| 2  | Boot Lid           | 103.6         | 107    | 99     | 105      |
| 3  | Roof               | 93.1          | 98     | 96     | 91/88    |
| 4  | Left Front Fender  | 239.0         | 256    | 186    | 275      |
| 5  | Left Front Door    | 101.6         | 102    | 103    | 100      |
| 6  | Center Panel Left  |               |        |        |          |
| 7  | Left Rear Door     | 104.1         | 101    | 112    | 99       |
| 8  | Left Back Panel    | 111.0         | 114    | 110    | 109      |
| 9  | Right Front Fender | 289.0         | 279    | 347    | 241      |
| 10 | Right Front Door   | 152.6         | 204    | 125    | 129      |
| 11 | Center Panel Right |               |        |        |          |
| 12 | Right Rear Door    | 316.6         | 192    | 189    | 569      |
| 13 | Right Back Panel   | 156.3         | 131    | 139    | 199      |

## Overall Evaluation :

**D**

### Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

| Interior Evaluation : <b>B</b>                                                                                                                                                                                                                              | Exterior Evaluation : <b>E</b>                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                              |
|-------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|-------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|
|  <p><b>a</b> : Cut, Fray <b>d</b> : Loose, Deformed <b>k</b> : Animal Hair <b>s</b> : Smell <b>t</b> : Cigarette Burns <b>x</b> : Defective <b>y</b> : Stain</p>          |  <p><b>A</b> : Scratch <b>AU</b> : Scratch &amp; Dent <b>B</b> : Modified <b>C</b> : Corrosion <b>G</b> : Stone chip <b>P</b> : Faded <b>S</b> : Rust <b>SC</b> : Rust &amp; Corrosion <b>U</b> : Dent <b>X</b> : Defective <b>Y</b> : Crack, Gap</p>                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                     |
| <b>Remarks</b><br>Rear Seat - Grime - Small / (R) Front Trim - Grime - Small / (R) Front Seat - Grime - Small / Trunk Room - Worn, Scratch, Cut, Crack - Small / (L) Front Trim - Grime - Medium / Ceiling - Grime - Small / (L) Front Seat - Grime - Small | <b>Remarks</b><br>(R) Front Door - Repair Traces - Yes / (R) Front Fender - Repair Traces - Yes / Bonnet - Repair Traces - Yes / (L) Front Fender - Repair Traces - Yes / (L) Front Door - Repair Traces - Yes / (L) Rear Door - Repair Traces - Yes / (L) Rear Fender - Repair Traces - Yes / Trunk Hood, Rear Gate - Repair Traces - Yes / (R) Rear Door - Repair Traces - Yes / Roof - Repair Traces - Yes / Member (Bolted) - Dent - Yes / (L) Mirror - Scratch - Minimal / (L) Front Fender, Molding - Repair mark - Yes / Bonnet, Headlight - Repair mark - Yes / (R) Front Fender, Molding - Repair mark - Yes / (R) Rear Door, Molding - Repair mark - Yes / Front Bumper, Grille, Lamps - Scratch - Small / (L) Front Door, Molding - Scratch - Small / (L) Rear Door, Molding - Scratch & Dent - Small / Roof - Scratch & Dent - Small / (L) Rear Fender, Molding - Scratch - Small / Trunk Hood, Rear Gate - Scratch & Dent - Medium / Rear Bumper, Lamps, Panels - Scratch - Medium / (R) Rear Fender, Molding - Dent - Small / (R) Rear Door, Molding - Dent - Small / (R) Mirror - Scratch - Minimal / (R) Front Door, Molding - Scratch & Dent - Small / (L) Front Fender, Molding - Crack, Gap - Medium / Bonnet, Headlight - Scratch - Small / (R) Front Fender, Molding - Scratch - Small |
| Frame Evaluation : <b>B</b>                                                                                                                                                                                                                                 | Functional Evaluation : <b>D</b>                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                            |
| <b>Remarks</b><br>Front Cross Member Support - Traces of Bending, or Marks of Panel Repair ? - Yes                                                                                                                                                          | <b>Remarks</b><br>Warning Lamps - Issue - Yes / Shift Shock - Function - Weak / Battery - Weak - Yes / Reverse Camera - N/A - Yes                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                           |

## Inspector Notes

with LTO plate/with spare tire/No seat cover/with 1 spare key/with jack and incomplete tools/with warranty booklet/Dome light issue/reverse camera issue/rear seat issue/cross member support traces of repair/right side rear door issue/driver side door issue/