

General Information

Date & Time: 26, Jun, 2026 16:00

Make	Toyota	Model	Avanza
YOM	2024	Odo Meter Reading	41,622
Registration No.	CCA3120	Chassis No.	MHFAA1BY0P0017938
CC	1.3	Transmission	A/T
Fuel Type	Gas	Type of Body	Wagon
Colour	Black		

Body / Panel Condition



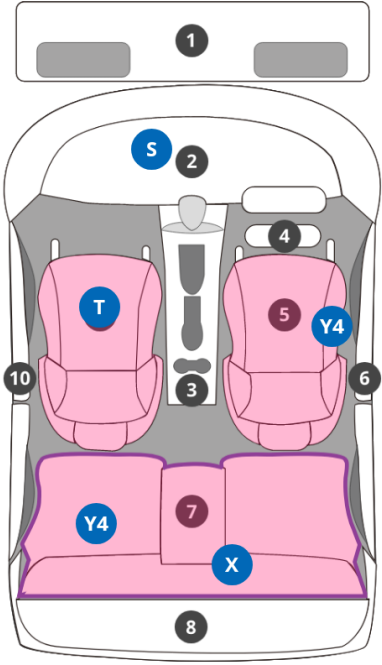
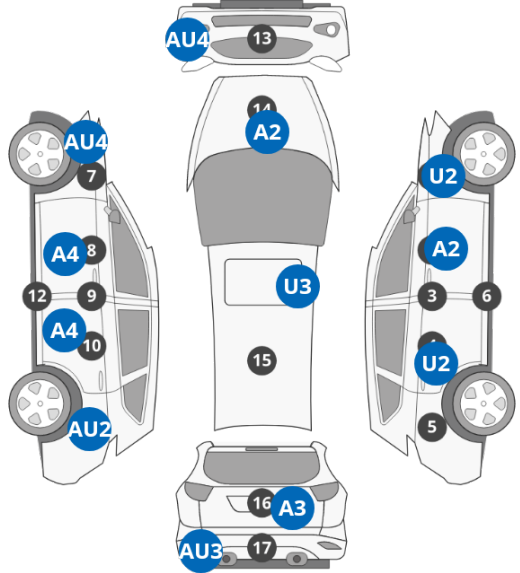
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	153.6	144	154	163
2	Boot Lid	142.0	147	139	140
3	Roof	137.0	124	132	150/142
4	Left Front Fender	111.6	115	112	108
5	Left Front Door	117.0	110	115	126
6	Center Panel Left				
7	Left Rear Door	112.6	111	112	115
8	Left Back Panel	126.6	148	127	105
9	Right Front Fender	109.3	115	109	104
10	Right Front Door	117.3	124	117	111
11	Center Panel Right				
12	Right Rear Door	136.3	133	131	145
13	Right Back Panel	114.6	110	115	119

Overall Evaluation :

D

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : E
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Overall Interior - Smell - Yes / (L) Front Seat - Cigarette Burns - Burnt, Hole / Rear Seat - Grime - Large / Rear Seat - Partially Missing - Yes / (R) Front Seat - Grime - Large	Remarks Front Bumper, Grille, Lamps - Scratch & Dent - Large / (L) Front Fender, Molding - Scratch & Dent - Large / (L) Front Door, Molding - Scratch - Large / (L) Rear Door, Molding - Scratch - Large / (L) Rear Fender, Molding - Scratch & Dent - Small / Rear Bumper, Lamps, Panels - Scratch & Dent - Medium / Trunk Hood, Rear Gate - Scratch - Medium / (R) Rear Door, Molding - Dent - Small / (R) Front Fender, Molding - Dent - Small / Roof - Dent - Medium / Bonnet, Headlight - Scratch - Small / (R) Front Door, Molding - Scratch - Small
Frame Evaluation : A	Functional Evaluation : C
Remarks Defects not found	Remarks Warning Lamps - Issue - Yes / Head Light, High Beam - Issue - Yes / Lamps (Brake, Tail, Fog) - Issue - Yes / Wiper - Function - Weak / Horn - Issue - Yes

Inspector Notes
possible flooding/ airbag warning light on/missng 3rd row seat/ traction control light on/ power steering warning light on/ head light issue/ wiper issue/ fog light issue/ horn issue/ steering wheel issue/ no jack and tools/ no warranty booklet / no spare tire/ with LTO plate/