

General Information

Date & Time: 26, Jun, 2026 16:01

Make	Mitsubishi	Model	Mirage
YOM	2023	Odo Meter Reading	27,302
Registration No.	NFA3325	Chassis No.	PAEA03RJPPA006666
CC	1.2	Transmission	CVT
Fuel Type	Gas	Type of Body	Hatchback
Colour	Gray		

Body / Panel Condition



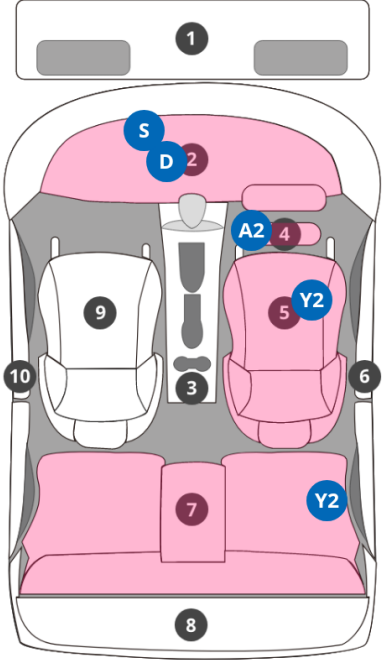
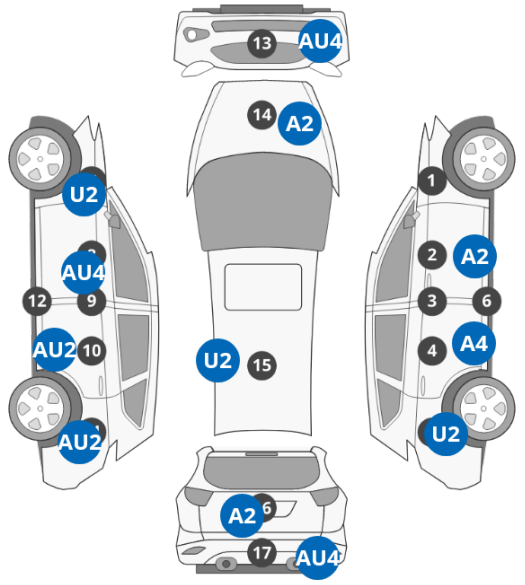
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	134.6	131	127	146
2	Boot Lid	122.3	126	120	121
3	Roof	114.7	116	104	114/125
4	Left Front Fender	237.3	170	157	385
5	Left Front Door	172.3	154	153	210
6	Center Panel Left				
7	Left Rear Door	234.0	313	211	178
8	Left Back Panel	120.6	118	119	125
9	Right Front Fender	106.0	100	102	116
10	Right Front Door	108.3	109	107	109
11	Center Panel Right				
12	Right Rear Door	106.3	107	106	106
13	Right Back Panel	126.0	138	129	111

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : E
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Dashboard - Traces of Adhesive Tape - Yes / (R) Front Seat - Grime - Small / (L) Front Floor Mat - Cut, Crack - Small / Rear Seat - Grime - Small / Overall Interior - Smell - Yes	Remarks (L) Front Fender - Repair Traces - Yes / (L) Front Door - Repair Traces - Yes / (L) Rear Door - Repair Traces - Yes / Rear Bumper, Lamps, Panels - Scratch & Dent - Large / (R) Rear Fender, Molding - Dent - Small / (R) Rear Door, Molding - Scratch - Large / Front Bumper, Grille, Lamps - Scratch & Dent - Large / (R) Front Door, Molding - Scratch - Small / Bonnet, Headlight - Scratch - Small / (L) Front Fender, Molding - Dent - Small / (L) Front Door, Molding - Scratch & Dent - Large / (L) Rear Door, Molding - Scratch & Dent - Small / (L) Rear Fender, Molding - Scratch & Dent - Small / Trunk Hood, Rear Gate - Scratch - Small / Roof - Dent - Small
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Audio, Radio - Issue - Yes / Spare Key - Issue - Unexist

Inspector Notes

no warranty booklet/ no jack and tools/possible flooding/ light scratches around the exterior/ with spare tire and LTO plate/