

## General Information

Date & Time: 26, Jun, 2026 15:56

|                  |         |                   |                    |
|------------------|---------|-------------------|--------------------|
| Make             | Ford    | Model             | Ranger             |
| YOM              | 2020    | Odo Meter Reading | 105,216            |
| Registration No. | NEG6483 | Chassis No.       | MNCUMFF40KW0237080 |
| CC               | 2.0     | Transmission      | A/T                |
| Fuel Type        | Diesel  | Type of Body      | Pickup             |
| Colour           | White   |                   |                    |

## Body / Panel Condition



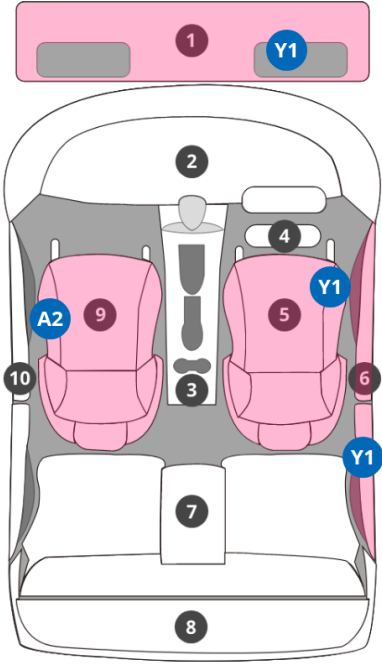
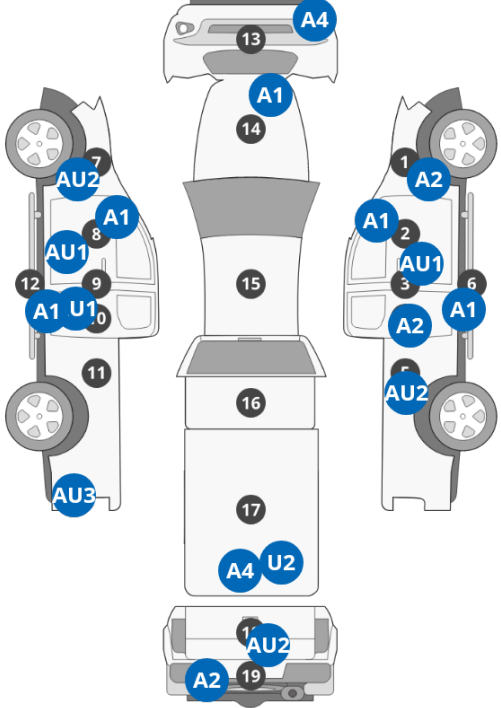
| #  | Area               | Thickness(um) |        |        |          |
|----|--------------------|---------------|--------|--------|----------|
|    |                    | Average       | Value1 | Value2 | Value3/4 |
| 1  | Bonnet             | 112.3         | 109    | 122    | 106      |
| 2  | Boot Lid           | 106.3         | 105    | 110    | 104      |
| 3  | Roof               | 108.7         | 102    | 108    | 116/109  |
| 4  | Left Front Fender  | 114.0         | 119    | 111    | 112      |
| 5  | Left Front Door    | 114.0         | 114    | 115    | 113      |
| 6  | Center Panel Left  |               |        |        |          |
| 7  | Left Rear Door     | 117.3         | 131    | 113    | 108      |
| 8  | Left Back Panel    | 107.7         | 92     | 119    | 112      |
| 9  | Right Front Fender | 117.6         | 110    | 119    | 124      |
| 10 | Right Front Door   | 122.3         | 117    | 127    | 123      |
| 11 | Center Panel Right |               |        |        |          |
| 12 | Right Rear Door    | 119.0         | 112    | 108    | 137      |
| 13 | Right Back Panel   | 274.0         | 203    | 234    | 385      |

## Overall Evaluation :

**B**

### Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

| Interior Evaluation : <b>A</b>                                                                                                                                                                                                                     | Exterior Evaluation : <b>D</b>                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                          |
|----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|-------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|
|  <p><b>a</b> : Cut, Fray <b>d</b> : Loose, Deformed <b>k</b> : Animal Hair <b>s</b> : Smell <b>t</b> : Cigarette Burns <b>x</b> : Defective <b>y</b> : Stain</p> |  <p><b>A</b> : Scratch <b>AU</b> : Scratch &amp; Dent <b>B</b> : Modified <b>C</b> : Corrosion <b>G</b> : Stone chip <b>P</b> : Faded <b>S</b> : Rust <b>SC</b> : Rust &amp; Corrosion <b>U</b> : Dent <b>X</b> : Defective <b>Y</b> : Crack, Gap</p>                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                |
| <p><b>Remarks</b><br/>Sunvisor, Sunglass Holder - Grime - Minimal / (R) Front Seat - Grime - Minimal / (R) Rear Trim - Grime - Minimal / (L) Front Seat - Cut, Crack - Small</p>                                                                   | <p><b>Remarks</b><br/>(R) Front Fender, Molding - Scratch - Small / (R) Mirror - Scratch - Minimal / (R) Step, In-panel, Side Spoiler - Scratch - Minimal / Roof - Dent - Small / (R) Rear Door, Molding - Scratch - Small / (R) Side Gate - Scratch &amp; Dent - Small / Rear Bumper, Lamps, Panels - Scratch - Small / Rear Gate - Scratch &amp; Dent - Small / (L) Side Gate - Scratch &amp; Dent - Medium / (L) Rear Door, Molding - Scratch &amp; Dent - Minimal / (L) Front Door, Molding - Scratch &amp; Dent - Minimal / (L) Mirror - Scratch - Minimal / (L) Front Fender, Molding - Scratch &amp; Dent - Small / Front Bumper, Grille, Lamps - Scratch - Large / Bonnet, Headlight - Scratch - Minimal / (L) Step, In-panel, Side Spoiler - Scratch - Minimal / (R) Front Door, Molding - Scratch &amp; Dent - Minimal / Cab Back Panel - Scratch - Large</p> |
| Frame Evaluation : <b>A</b>                                                                                                                                                                                                                        | Functional Evaluation : <b>A</b>                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                        |
| <p><b>Remarks</b><br/>Defects not found</p>                                                                                                                                                                                                        | <p><b>Remarks</b><br/>Reverse Camera - N/A - Yes / Spare Key - Issue - Unexist</p>                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                      |

| Inspector Notes                                                                                                                          |
|------------------------------------------------------------------------------------------------------------------------------------------|
| With Lto plate, with spare tire and warranty booklet, 1key, no jack and tools, scratches on headlights and taillights, plate light issue |