

General Information

Date & Time: 27, Jun, 2026 13:01

Make	Toyota	Model	Vios
YOM	2025	Odo Meter Reading	30,586
Registration No.	CCF4076	Chassis No.	PA1B18F31R4265423
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Black		

Body / Panel Condition



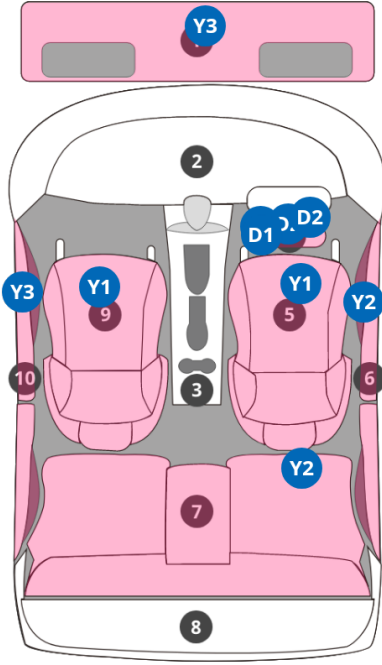
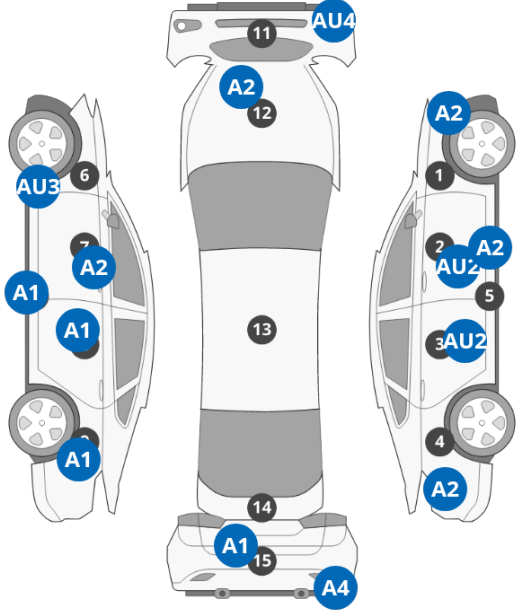
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	109.6	109	107	113
2	Boot Lid	106.3	109	96	114
3	Roof	100.0	107	95	99/100
4	Left Front Fender	99.4	94	101	103
5	Left Front Door	79.0	81	73	83
6	Center Panel Left				
7	Left Rear Door	73.9	75	74	73
8	Left Back Panel	111.3	110	120	104
9	Right Front Fender	108.3	106	110	109
10	Right Front Door	103.3	107	103	100
11	Center Panel Right				
12	Right Rear Door	102.7	97	102	109
13	Right Back Panel	108.0	104	105	115

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : D
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Ceiling - Grime - Medium / (R) Front Floor Mat - Worked - Small / (R) Front Trim - Grime - Small / (R) Front Seat - Grime - Minimal / Rear Seat - Grime - Small / Mat Other - Worked - Small / (L) Front Trim - Grime - Medium / (L) Front Seat - Grime - Minimal / (L) Front Floor Mat - Worked - Small / Carpet - Worked - Minimal	Remarks (R) Front Fender, Molding - Scratch - Small / (R) Front Door, Molding - Scratch & Dent - Small / (R) Rear Door, Molding - Scratch & Dent - Small / (R) Step, In-panel, Side Spoiler - Scratch - Small / (R) Rear Fender, Molding - Scratch - Small / Rear Bumper, Lamps, Panels - Scratch - Large / Trunk Hood, Rear Gate - Scratch - Minimal / (L) Rear Fender, Molding - Scratch - Minimal / (L) Rear Door, Molding - Scratch - Minimal / (L) Front Door, Molding - Scratch - Small / (L) Step, In-panel, Side Spoiler - Scratch - Minimal / (L) Front Fender, Molding - Scratch & Dent - Medium / Front Bumper, Grille, Lamps - Scratch & Dent - Large / Bonnet, Headlight - Scratch - Small
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Defects not found

Inspector Notes
With Lto plate, with warranty booklet and tools and Jack, 2keys, no spare tire, scratches on headlights and taillights,Worn front tires