

General Information

Date & Time: 27, Jun, 2026 13:08

Make	Toyota	Model	Avanza
YOM	2023	Odo Meter Reading	50,902
Registration No.	CCA2282	Chassis No.	MHFAA1BY3P0016993
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Wagon
Colour	Silver		

Body / Panel Condition



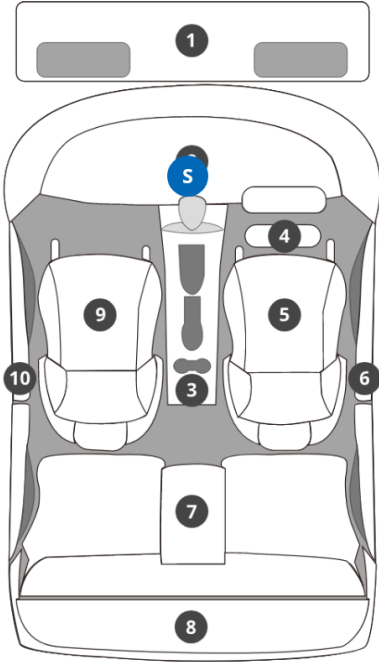
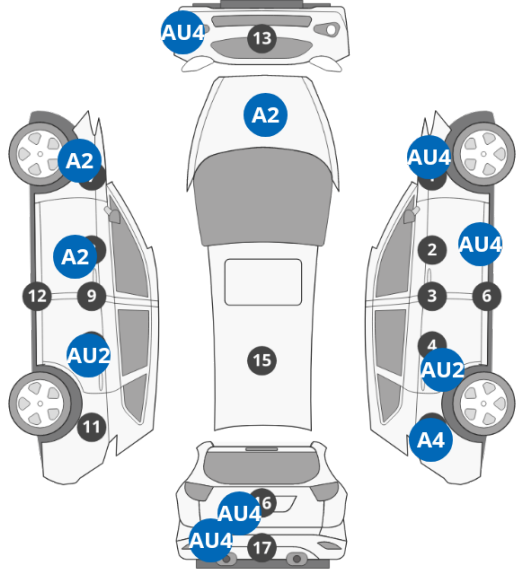
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	121.6	118	124	123
2	Boot Lid	106.0	109	105	104
3	Roof	123.5	146	118	123/107
4	Left Front Fender	98.7	99	100	97
5	Left Front Door	114.6	110	118	116
6	Center Panel Left				
7	Left Rear Door	109.6	109	107	113
8	Left Back Panel	105.1	112	108	95
9	Right Front Fender	103.7	111	107	93
10	Right Front Door	114.0	114	115	113
11	Center Panel Right				
12	Right Rear Door	115.3	118	113	115
13	Right Back Panel	103.9	97	99	115

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : E
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Overall Interior - Smell - Yes	Remarks Front Bumper, Grille, Lamps - Scratch & Dent - Large / (R) Front Fender, Molding - Scratch & Dent - Large / (R) Step, In-panel, Side Spoiler - Scratch & Dent - Large / (R) Rear Door, Molding - Scratch & Dent - Small / (R) Rear Fender, Molding - Scratch - Large / Rear Bumper, Lamps, Panels - Scratch & Dent - Large / Trunk Hood, Rear Gate - Scratch & Dent - Large / (L) Rear Door, Molding - Scratch & Dent - Small / (L) Front Door, Molding - Scratch - Small / (L) Front Fender, Molding - Scratch - Small / Bonnet, Headlight - Scratch - Small
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Spare Key - Issue - Unexist

Inspector Notes

no warranty booklet/ no jack and tools/ light scratches around the exterior/possible flooding/ with LTO plate/