

General Information

Date & Time: 08, Jul, 2026 15:03

Make	Toyota	Model	Vios
YOM	2023	Odo Meter Reading	119,524
Registration No.	NHI6572	Chassis No.	PA1B18F37P4207420
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Blue		

Body / Panel Condition



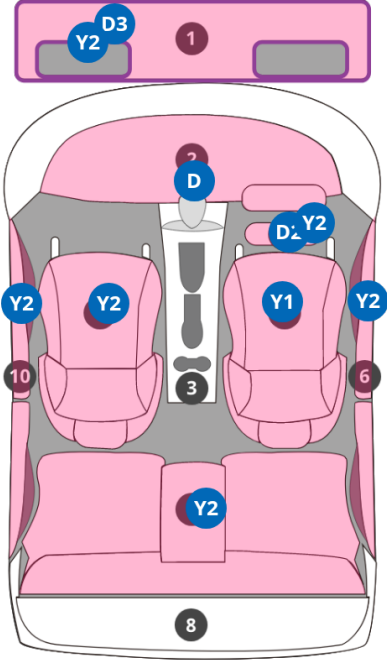
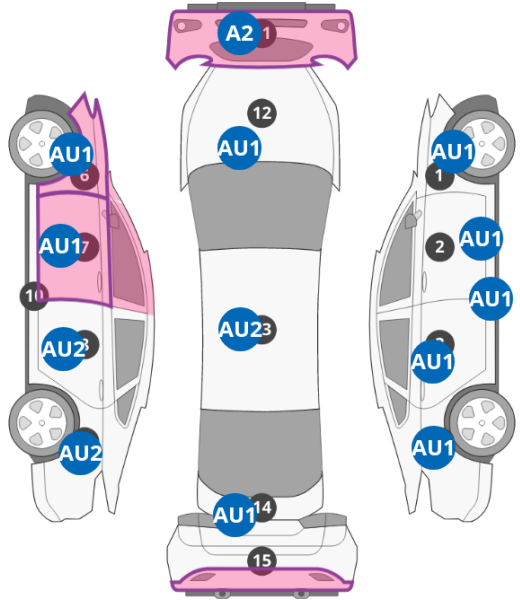
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	112.6	107	108	123
2	Boot Lid	122.6	127	119	122
3	Roof	109.0	115	106	108/107
4	Left Front Fender	635.3	223	773	910
5	Left Front Door	159.6	199	140	140
6	Center Panel Left				
7	Left Rear Door	110.6	119	108	105
8	Left Back Panel	117.0	121	113	117
9	Right Front Fender	102.6	110	94	104
10	Right Front Door	102.7	109	100	99
11	Center Panel Right				
12	Right Rear Door	108.3	106	108	111
13	Right Back Panel	106.3	104	105	110

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : C
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks (L) Front Floor Mat - Worked - Small / (R) Front Floor Mat - Grime - Small / (R) Front Seat - Grime - Minimal / (L) Front Seat - Grime - Small / Rear Seat - Grime - Small / (L) Front Trim - Grime - Small / (R) Front Trim - Grime - Small / Ceiling - Crinkle - Medium / Sunvisor, Sunglass Holder - Grime - Small / Dashboard - Traces of Adhesive Tape - Yes / Room Lamp - Missing - Yes	Remarks (R) Front Door - Repair Traces - Yes / (R) Front Fender - Repair Traces - Yes / Bonnet - Repair Traces - Yes / (L) Front Fender - Repair Traces - Yes / Trunk Hood, Rear Gate - Repair Traces - Yes / Trunk Hood, Rear Gate - Scratch & Dent - Minimal / Rear Bumper, Lamps, Panels - Repair mark - Yes / (L) Rear Fender, Molding - Scratch & Dent - Small / (L) Rear Door, Molding - Scratch & Dent - Small / Roof - Scratch & Dent - Small / (L) Front Fender, Molding - Repair mark - Yes / (L) Front Door, Molding - Repair mark - Yes / (L) Front Door, Molding - Scratch & Dent - Minimal / (L) Front Fender, Molding - Scratch & Dent - Minimal / Front Bumper, Grille, Lamps - Repair mark - Yes / Bonnet, Headlight - Scratch & Dent - Minimal / (R) Front Fender, Molding - Scratch & Dent - Minimal / (R) Front Door, Molding - Scratch & Dent - Minimal / (R) Rear Door, Molding - Scratch & Dent - Minimal / (R) Step, In-panel, Side Spoiler - Scratch & Dent - Minimal / (R) Rear Fender, Molding - Scratch & Dent - Minimal / Front Bumper, Grille, Lamps - Scratch - Small
Frame Evaluation : B	Functional Evaluation : A
Remarks Left Front Inside Panel (Front Side) - Traces of Bending, or Marks of Panel Repair ? - Yes	Remarks Reverse Camera - N/A - Yes / Spare Key - Issue - Unexist

Inspector Notes
with LTO plate, with warranty booklet, with jack, with spare tire, no tools, no reverse camera, no manual booklet, scratches and dent on exterior, scratches on taillight and headlight, no spare key.